

How cables and connectors impact measurement uncertainty

Application Note

More often than perhaps known, the outcome of a calibration procedure can depend on the technician knowing which cables and connectors are appropriate for the calibration setup. Choosing the wrong cables and/or connectors can have a significant impact on the overall uncertainty of the setup or calibration system.

If you're new to dc and low frequency ac calibration, it's important to understand the impact connectors and cables have on overall measurement uncertainty, as well as the importance of cable maintenance.

Cables, connectors, and traceability

Because a calibrator must be electrically connected to the unit under test (UUT), there is at least one pair of connectors involved on both. These electrical cables or test leads bring the parameter represented by the calibrator to the UUT. In an ideal situation, the UUT would 'see' the standard value from the calibrator without any deterioration. Unfortunately, this is not always the case.

If a user fails to select the appropriate cables, the uncertainty chain can be violated because the cable-to-connector circuit may introduce serious errors into the signal that arrives at the UUT. In some cases, these errors may even be larger than the expected signal. So, to minimize the effect on "total uncertainty" you must consider these possible error sources.

Model of a test connection

Figure 1 depicts a schematic diagram of a simple test setup including cabling and connectors. You can quickly see there are many influences that might contribute uncertainty to the measurement system. Some of

these influences are in series with the signal circuit, and others are in parallel.

Moving from left to right in the diagram, possible contributions to total measurement uncertainty are:

- Contact resistance between the connectors and cable junction at the calibrator.
- Thermal EMFs are generated at the connector and cable junctions at the calibrator.
- Series lead *resistance* in the cable wires.
- Series lead *inductance* in the cable wires.
- Parallel *capacitance* between the cable wires.
- Susceptibility to external electromagnetic interference (EMI) in the cables.
- Leakage resistance between the cable wires via their insulation resistance or external contamination.
- Thermal EMFs (voltages) generated at the connector/cable junctions at the UUT.
- Contact resistance between the connectors/cable junction at the UUT.

These possible error sources are present in dc, ac, and RF measurements, but they affect each one differently.

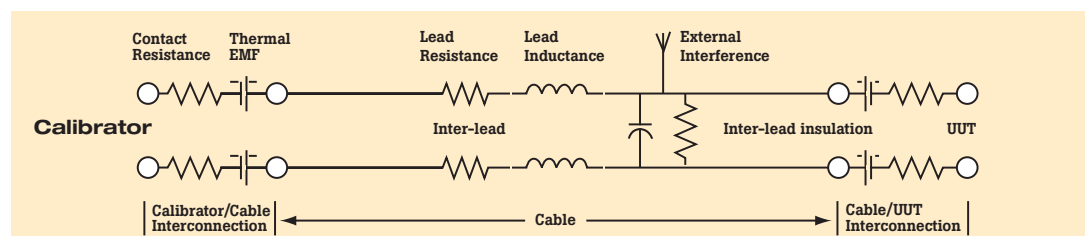


Figure 1: Schematic of a complete test setup, including the cables.

Thermal voltages are a major problem in low level voltage dc voltage measurements. It's not unusual for connecting leads to binding posts to bring two dissimilar metals into contact with each other and thereby create a thermal junction. When this happens, the net thermal EMF generated induces a continuous current into the measurement system. That current can cause an error.

Looking at the four thermal junctions created in Figure 1, if we assume the temperature is the same at all connections, the thermal voltages will be equal and opposite, thereby canceling each other. If this is the case, then there is no contribution to error. Most often the temperatures at each binding post are identical, because they are very close together. But, if the calibrator's binding posts are at a different temperature than the UUT's binding posts, a net voltage difference may result in series with the calibrator and UUT, causing an error.

Whenever possible, it's best to use pure copper connectors and cables in a measurement setup to avoid uncertainties due to thermals. Or, if it's necessary to use other than pure copper against copper, ensure that any junctions between dissimilar metals are at the same temperature. It's good calibration practice to try to do both as much as is practical, especially at low levels.*

As an example, if a meter is going to be calibrated at 10 mV dc, you should first check to see if there is any internal offset at the meter. To do this, replace the direct voltage source with a copper short. If there's an offset, it can be eliminated by adjusting the meter to null. This compensates for its internally generated thermal EMFs. Then, reestablish the normal test connection and wait a few minutes to allow the temperature differences to equalize and the meter should return to zero. If it doesn't, there may be thermal errors in the setup.

*Since pure copper tends to tarnish, make sure all corrosion is removed before making a connection.

Temperature differences at the connections can result from two causes:

1. The cable's connector may be at a different (usually lower) temperature than the terminals of a warmed-up instrument.
2. Handling the leads and meter terminals may cause them to heat up slightly due to body heat.

Another factor might come into play if the meter has brass terminals and there are temperature gradients across the terminals due to air currents. These air currents may come from nearby heat sources, such as other operating instruments and air conditioning vents.

Measuring low value resistance

Because ac signals are continuously switching polarity, they are not nearly as affected by thermal currents. You can achieve better accuracy and stability in low value resistor measurements, for example, by applying an ac signal across the resistor and measuring the ac voltage developed across it. This makes the measurement impervious to thermal EMFs, whose effects are inevitably present when trying to measure in the milliohm region.

As mentioned above, it's not altogether possible to completely prevent thermal voltages. Taking precautions, such as using untinned copper leads to connect at binding posts and having the binding posts made of gold-flashed material, can minimize the problem.

Soldered connectors

When a wire is soldered to a spade lug, a thermocouple pair is created. Therefore, don't use the cable until the junctions temperature matches the ambient surrounding area. Cover these joints with insulating material and take care not to handle the cables close to the joints when changing connections. Overall, solder (especially low thermal

solder) is probably superior to other connection methods, which may have a tendency to result in poor connections over time due to loosening or corrosion.

Low resistance applications

In low resistance measurements, the first requirement is for cable/connector resistance to be low and constant. Using spade lug connectors under securely tightened binding posts [Figure 2] or simply a bare solid copper wire [Figure 3] is recommended.

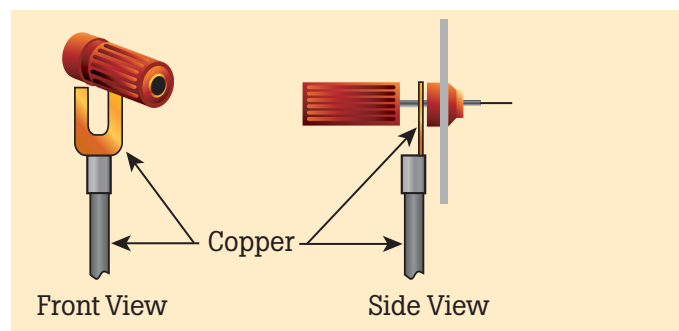


Figure 2: Low resistance connection using a spade lug.

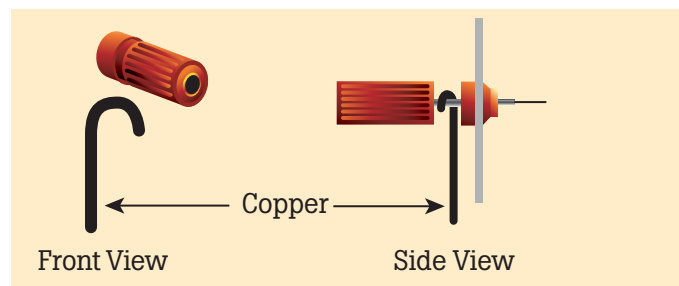


Figure 3: Low resistance connection using a bare copper wire.

Precision measurements in low resistance applications, such as two-terminal resistors, generally begin below 10 K ohms. However, for measurements in the 100 ppm uncertainty range, considerations of low resistance techniques may be reduced to 1 K ohm or less. Using four-terminal techniques minimizes the effects of cable and connector lead and contact resistance. Most modern calibrators and laboratory DMMs have built-in features that nullify the effects of lead resistance by using remote sensing techniques.

High resistance applications

A very high proportion of the cal lab work load may include calibrating DMMs and measuring high resistances. This is where the high quality banana plug cables really shine. Not only does connecting spade lugs to equipment take valuable time, but many meters with millivolt ranges (where thermal EMFs are a problem) do not have binding posts which even allow use of spade lugs.

Also, in high resistance applications a cable must have very high insulation resistance. Commonly, polytetrafluoroethylene is used as the insulation material. This will have the normally required $\geq 10^{12}$ ohms or greater insulation resistance.

Insulators commonly used for low voltage wiring may not have high enough insulation. Should this kind of wire come close to a low point in the high resistance circuit, it will cause the high impedance to be shunted, possibly causing an undetected error. Wire with a shiny plastic coating will usually have the required insulation qualities. Never use low voltage wire coated with other materials for high resistance applications.

AC applications

In general, all the factors applying to the various dc and resistance applications also apply to ac. But, there are a few additional conditions to be considered, as well.

Cable capacitance

The major differing factor to consider for ac is the effect of cable capacitance on the measurement. The ac source, in addition to supplying the current required by the load, must also supply the current to drive the capacitance represented by the cable attached to its output terminals. Therefore, it's always advantageous to keep the cable capacitance as low as possible.

A cable with the lowest possible capacitance is a pair of unshielded wires separated by at least one or two inches. This will work at relatively high voltage values in relatively low impedance circuits. An example would be calibrating a source at levels of 0.5 V or higher and at frequencies up to 500 kHz.

However, sourcing voltages at the millivolt levels into the higher input impedance of electronic voltmeters or DMMs may lead to problems with excessive noise pickup due to lack of shielding. Also, at frequencies of 1 MHz and above, the cable inductance begins to reduce the signal delivered at the end of the cable.

These two problems are best solved by using a high quality, shielded, insulated, twisted pair cable. Such a cable should have a capacitance rating below 20 pF per foot. Also, a twisted pair minimizes the cable inductance as well and will work quite well up to around 1 MHz. It also affectively prevents emfs from affecting the measurement.

Using coaxial cable

One of the greatest surprises to the uninitiated is how quickly the capacitance of coaxial cable can run up with just a few feet. For example, one of the most common types (RG 58U, a 50 ohm RF impedance cable) runs around 30 pF per foot. That means a common four foot cable in calibration work will load a source with 120 pF. This is a considerable load. Calculating the capacitive reactance at 1 MHz yields; X_c of 1326 ohms. If the source impedance is significant, a reduced signal will occur at the end of the measuring cable. Therefore, for the greatest precision ac work, shielded twisted pair cable is recommended. Coax should only be used in moderate accuracy situations.

Cable maintenance

Time and usage will cause gradual deterioration of any cable and connector. Visual inspection can detect the obvious problems of corroded cable connectors, or even frayed cable strands where the connector is mated to the conductor. Before using unknown quality cabling for the first time, use an ohmmeter to check the cable while flexing it for any detectable variation. Cable strands can become broken internally (Figure 4). When this happens, the strands can make intermittent contact as the cable is flexed.

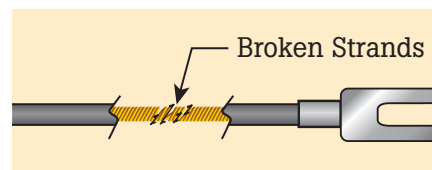


Figure 4: Cable with broken strands.

Cable maintenance for the spade lug type may include re-termination of the lugs when broken strands are evident or simply cleaning the lug if it's oxidized. Presumably, the broken strands will be near the end of the cable where most of the flexing occurs. That means the cable can probably be clipped back about one inch, stripped, and soldered to a new lug. The soldered area should then be covered with heat shrinkable tubing to protect against surface grime and lend some rigidity to the connection.

Cleaning oxidized spade lugs is quite easy, using a pencil eraser that is not contaminated with pencil lead.

Although surface contamination on the outer insulator of a cable is normally not a serious problem, except in terms of esthetics, it could be of considerable concern in high voltage measurements. The area of concern is at the cable ends where surface contamination can connect the area between both conductors. This could create a leakage path when measuring in high impedance circuits. Cleaning this area with denatured alcohol can remedy the situation.

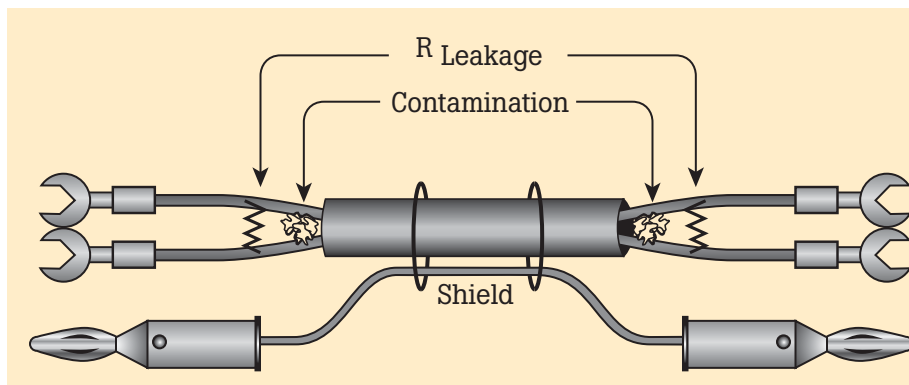


Figure 5: Contaminated cable.

Summary

In summary, there are many factors that affect measurements that are not necessarily pointed out in calibration procedures. The information contained in this article is meant to help minimize uncertainty due to choosing the wrong cable for the setup, inappropriate connections, or problems caused by inadequate preventative maintenance. It is the knowledge and skill of the technician performing the measurement that impacts the overall uncertainty of a measurement.

References

- “Principles of Metrology,”
Fluke Corporation course workbook.
- “Calibration: Philosophy in Practice,”
Fluke Corporation, 2nd Edition.

Fluke Calibration. *Precision, performance, confidence.™*

Electrical	RF	Temperature	Pressure	Flow	Software
------------	----	-------------	----------	------	----------

Fluke Calibration
PO Box 9090,
Everett, WA 98206 U.S.A.

Fluke Europe B.V.
PO Box 1186, 5602 BD
Eindhoven, The Netherlands

For more information call:
In the U.S.A. (877) 385-3225 or Fax (425) 446-5116
In Europe/M-East/Africa +31 (0) 40 2675 200 or Fax +31 (0) 40 2675 222
In Canada (800)-36-FLUKE or Fax (905) 890-6866
From other countries +1 (425) 446-5500 or Fax +1 (425) 446-5116
Web access: <http://www.flukecal.com>

©2005-2012 Fluke Calibration. Specifications subject to change without notice.
Printed in U.S.A. 5/2012 2548277B_EN Pub_ID: 11917-eng rev 01

Modification of this document is not permitted without written permission from Fluke Calibration.