



Keysight i3070 08.40pc Software Patch

Software Release Date: Oct, 2014

System Requirements: Keysight i3070 test system or test development workstation

Controller Requirements: Windows PC

Operating System: Microsoft Windows 7 or Microsoft Windows XP

Software Requirement: Keysight i3070 08.40p

This software patch should only be installed on systems with i3070 08.40p software release. It can be installed on i3070 test system or i3070 test development.

The 08.40pc software patch addresses following change requests included 08.40sa.

Change Request	Description
195946	08.21p: Fixed Utility card plugin modules wiring reversed.
199774	08.40p: Ability to output system temperature to a file.
210063	08.40p: Inline - Operator Widget should remove Faon / Faoff buttons
218788	Illegal XML characters in the board file cause Coverage Analyst to abort with non-descriptive error message
221346	08.40p: Ability to display program name and version in i3070 interface.
223646	08.40p: Probe Select crashes with "2788 segmentation violation" message.
237576	08.30p: "Internal Error -11" or "In filter caught AV as expected" message appears if "enter...using.." statement is heavily used in large and complex testplan.
242922	08.30p: Subsequent High Voltage Zener tests on the same board using same module resources fail when executed sequentially.
242923	08.30p: Subsequent High Voltage Zener tests from different boards of the panel fail Source Over Voltage if using the same module.
278346	08.40p : Fixed DGN T2340 not displaying the results
315320	08.40p: Inline - The default keepout area between the edge of the board and the front edge of the fixture incorrect when placing panelized board in fixture consultant.
352246	08.40p: Fixed incorrect board placement with i3070 Inline

The software patch must be installed using the administrator login (or a login with administrator privileges).

Installing the 08.40pc software patch

Follow these steps to install the 08.40pc software patch:

1. Save the **Keysighti3070_0840pc.exe** file to your hard disk.
2. Close all open programs.
3. Double-click **Keysighti3070_0840pc.exe**
4. Follow the on-screen instructions for installation.
5. To validate that the software was installed correctly:
 - a. On the **Start** menu, select **Programs > Agilent ICT > Korn Shell**
 - b. In the Korn Shell window, type version and press **Enter**.

The following software revision should be displayed:

Agilent Medalist i3070 08.40pc 1113 WN.