

Agilent N9322C **Spectrum Analyzer**

User's Guide



Notices

© Agilent Technologies, Inc. 2012

No part of this manual may be reproduced in any form or by any means (including electronic storage and retrieval or translation into a foreign language) without prior agreement and written consent from Agilent Technologies, Inc. as governed by United States and international copyright laws.

Manual Part Number

N9322-90002

Edition

First Edition, November 2012

Printed in China

Agilent Technologies, Inc. No. 116 Tian Fu 4st Street Hi-Tech Industrial Zone (South) Chengdu 610041, China

Software Revision

This guide is valid for firmware revision A.04.20 or later of the N9322C Spectrum Analyzer.

Warranty

The material contained in this document is provided "as is," and is subject to being changed, without notice, in future editions. Further, to the maximum extent permitted by applicable law, Agilent disclaims all warranties, either express or implied, with regard to this manual and any information contained herein. including but not limited to the implied warranties of merchantability and fitness for a particular purpose. Agilent shall not be liable for errors or for incidental or consequential damages in connection with the furnishing, use, or performance of this document or of any information contained herein. Should Agilent and the user have a separate written agreement with warranty terms covering the material in this document that conflict with these terms, the warranty terms in the separate agreement shall control.

Technology Licenses

The hardware and/or software described in this document are furnished under a license and may be used or copied only in accordance with the terms of such license.

Restricted Rights Legend

U.S. Government Restricted Rights. Software and technical data rights granted to the federal government include only those rights customarily provided to end user customers. Agilent provides this customary commercial license in Software and technical data pursuant to FAR 12.211 (Technical Data) and 12.212 (Computer Software) and, for the Department of Defense, DFARS 252.227-7015 (Technical Data - Commercial Items) and DFARS 227.7202-3 (Rights in Commercial Computer Software or Computer Software Documentation).

Safety Notices

CAUTION

A **CAUTION** notice denotes a hazard. It calls attention to an operating procedure, practice, or the like that, if not correctly performed or adhered to, could result in damage to the product or loss of important data. Do not proceed beyond a **CAUTION** notice until the indicated conditions are fully understood and met.

WARNING

A WARNING notice denotes a hazard. It calls attention to an operating procedure, practice, or the like that, if not correctly performed or adhered to, could result in personal injury or death. Do not proceed beyond a WARNING notice until the indicated conditions are fully understood and met.

In This User's Guide...

This guide contains operation information for the N9322C Spectrum Analyzer. The following are descriptions of the chapters within this book.

1 Overview

A description of the front and rear panels.

2 Getting Started

Unpacking and setting up the analyzer.

3 Functions and Measurements How to use the basic applications of the analyzer.

4 Key Reference

Front-panel hardkey descriptions and the related softkeys menu functions.

5 Instrument Messages

Descriptions of the instrument messages of the analyzer.

6 Troubleshooting

Information and tips on what to do when instrument difficulties are encountered.

7 Menu Maps

Menu maps, the structure of the menus and what the user will see when making instrument parameter selections.

For more information about N9322C Spectrum Analyzer, see www.agilent.com/find/n9322c.

N9322C Spectrum Analyzer

10verview 1 Agilent N9322C at a Glance 2 Front Panel Overview 4 **Display Annotations** 7 **Rear Panel Overview** 9 Front and rear panel symbols 10 **2Getting Started** 11 Check the Shipment and Order List 12 Options 12 Safety Notice 13 **Power Requirements** 14 Power On and Check 16 **Environmental Requirements** 18 **Electrostatic Discharge Protection** 21 **BSA PC software** 22 **Helpful Tips** 23 Perform Calibration 23 Using an External Reference 24 **Enable an Options** 24 25 Firmware Upgrade **IO** Configuration 25 Timed Power On/Off 26 Power Preset Last 26 **Data Securities** 27 **Probe Power Output** 27 **3Functions and Measurements** 29

Making a Basic Measurement 30

Using the Front Panel 30 Presetting the Spectrum Analyzer 31 Viewing a Signal 33 35 Measuring Multiple Signals Comparing Signals on the Same Screen Using Marker Delta 35 Comparing Signals not on the Same Screen Using Marker Delta 37 **Resolving Signals of Equal Amplitude** 39 **Resolving Small Signals Hidden by Large Signals** 42 Measuring a Low-Level Signal 44 **Reducing Input Attenuation** 44 **Decreasing the Resolution Bandwidth** 46 Trace Averaging 47 Improving Frequency Resolution and Accuracy 49 Tracking Drifting Signals 51 **Making Distortion Measurements** 53 53 Identifying Analyzer Generated Distortion Third-Order Intermodulation Distortion 56 **Stimulus Response Transmission** 59 Measuring Stop Band Attenuation of a Lowpass Filter 61 **Channel Scanner** 64 Top/Bottom N Channel Scanner 64 List N Channel Scanner 66 68 Channel Scanner Setup Spectrum Monitor 69 **Reflection Measurement** 71 Preparation 71 **Measuring Cable Reflection** 72 72 Measuring Distance to Fault

Making a Power Measurement with USB Power Sensor 74

Making an Average Power Measurement75Making a Peak Power Measurement79Power Meter Settings81Demodulate the AM/FM signal84Demodulating an AM Signal84Demodulating an FM Signal85Analysis the Modulated Signals87AM/FM Modulation Analysis87ASK/FSK Modulation Analysis90
Measuring Channel Power 93
Files Operation 95
4Key Reference 101
Amplitude 102
BW 106
Display 109
Enter 110
ESC <- 110
Frequency 111
Marker 114
Meas 119 Channel Power 119 Occupied BW 121 ACPR 123 Spectrum Emission Mask 124
MODE 130 Tracking Generator 130 Power Meter 133 Spectrum Monitor 136

Reflection Measurement 138 AM/FM Modulation Analysis 140 ASK/FSK Modulation Analysis 144				
Peak Search 148				
System 151				
Span 154				
Sweep 155				
Limit 159				
Trace 162				
5Instrument Messages 167				
Overview 168				
Command Errors 169				
Execution Conflict 171				
Device-Specific Errors 173				
6Troubleshooting 177				
Check the basics 178				
Contact Agilent Technologies 180				

7Menu Maps 181

Amplitude Menu 182

- BW/Avg Menu 183
- Det/Display Menu 184
- File Menu (1 of 2) 185
- File Menu (2 of 2) 186
- Frequency Menu 187

Marker Menu 188 Marker-> Menu 189 Measure Menu (1 of 2) 190 Measure Menu (2 of 2) 191 **MODE** - Tracking Generator 192 **MODE - Power Meter** 193 MODE - AM/FM Modulation Analysis 194 MODE - ASK/FSK Modulation Analysis 195 Name Editor Menu 196 Peak Search Menu 197 Preset/System Menu 198 SPAN Menu 199 Sweep/Trig Menu 200 Trace Menu 201 Index 203



Agilent N9322C Spectrum Analyzer User's Guide

Overview

Agilent N9322C at a Glance2Front Panel Overview4Rear Panel Overview9Front and rear panel symbols10

This chapter provides a description of the Agilent N9322C spectrum analyzer and an introduction to the buttons, features, and functions of the front and rear instrument panels.

For the latest product information, please refer to the link below:

http://www.agilent.com/find/n9322c

For the latest option information, please refer to the link below:

http://www.agilent.com/find/sa_upgrades



Agilent N9322C at a Glance

The Agilent N9322C spectrum analyzer is a portable, swept spectrum analyzer with a frequency range of 9 kHz to 7.0 GHz. It can be widely used in an electronic manufacturing environment and in functional/final/QA test systems.

Features

The Agilent N9322C spectrum analyzer primary features and functions are described below:

Power Measurement Suite

The built-in one-button power measurement suite offers channel power, ACP, OBW, and TOI measurements, and contains a Pass/Fail testing capability with a mask for out-of-channel emissions measurement.

Precision Frequency Reference (Option PFR)

The optinal OCXO frequency reference provides the precise frquency measurement capability.

Spectrum Monitor (Option MNT)

Provides the capability to analyze the stability of a signal over time. The analyzer can be used to monitor the signal capturing performance or intermittent event over extended periods of time.

High Sensitive Measurement (Option P07)

Includes an optional pre-amplifier for signals in the frequency range up to 7 GHz, enabling more sensitive measurements. This feature is a great help in analysis of low level signals.

High Accuracy Power Measurement

Supports Agilent U2000 series (option PWM) and U2020 series (option PWP) power sensors for high accuracy power measurement as a power meter.

Modulation Analysis Function

provides optional AM/FM and ASK/FSK modulation analysis function. (AM/FM: Option-AMA ASK/FSK: Option-DMA)

Tracking Generator (Option TG7)

provides an RF source for scalar network analysis.

Baseband Channel (Option BB1)

Provides superior DANL and SSB between 9 kHz to 10 MHz.

Cable & Antenna Test (Option RM7; Requires option TG7)

Provides VSWR, return loss, cable loss and distance-to-fault function for reflection measurement.

Task Planner (Option TPN)

Provides task planner function to integrate different measurements for test automation.

Time-gated Spectrum Analysis (Option TMG)

Measures any one of several signals separated in time and xxclude interfering signals.

Channel Scanner (Option SCN)


provide the channel scan function in spectrum monitoring, coverage test, and band clearance.

Optimized Usability

The analyzer provides the enhanced usability as below:

- Socket/Telnet remote control via USB, and LAN port.
- The **BSA PC Software** on help kit CD provides further editing and data analysis functions.
- Keypad can be **locked** and unlocked with password to forbid undesired keypad operation.
- The **GPIB** interface (option G01) make the unit easily compatible with your GPIB test system.
- Security feartures (Option SEC) allows user to erase all customized files and data in analyzer for security.

Front Panel Overview

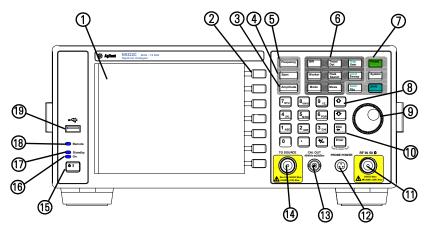


- **1 Screen** 6.5 inch TFT color screen shows information of the current function, including the signal traces, status indicators, and instrument messages. Labels for softkeys are located on the right-hand side of the screen.
- **2 Softkeys** are the unlabeled keys next to the screen. They activate functions displayed to the left of each key.
- **3 Amplitude** activates the reference level function and accesses the amplitude softkeys, with which you set functions that affect data on the vertical axis.
- **4 SPAN** sets the frequency range symmetrically about the center frequency. The frequency-span readout describes the total displayed frequency range.
- **5 Frequency** activates the center-frequency function, and accesses the menu of frequency functions.
- 6 Function Keys relate directly to the following main functions:
 - **BW** activates the resolution bandwidth function and accesses the softkeys that control the bandwidth functions and averaging.
 - **Trace/Det** accesses the softkeys that allow you to set up the trace settings and detector functions.

- **Disp User** accesses the submenu to recall the frequently used user-defined state, or control what is displayed on the analyzer, including the display line, graticule and annotation after pressing **Shift**.
- **Mode** selects the measurement mode according to the activated options.
- **Marker** accesses the marker control keys that select the type and number of markers and turns them on and off.
- Limit Sweep accesses the softkeys that allow you to set the sweep time, select the sweep mode and trigger mode, or to set the limit functions after pressing Shift.
- Peak Search places a marker on the signal peak.
- **Meas** accesses the measurements mode selection submenu in spectrum analyzer mode or the measurement submenu in other optional modes.
- 7 Utility Keys relate directly to the following utilities:
 - Preset resets the analyzer to a known state
 - **System** accesses the submenu to configure a series of system settings, such as ports, option and languages.
 - **Shift** switches alternate upper blue function of the hardkeys.
 - Save File accesses the file operation submenu or activate the quick-save function after pressing Shift.
- 8 Arrow Keys The up and down arrow keys shift the selected item when you press [MODE] hardkey; you can also change the mode by rotating the knob.
- **9 Knob** The knob increases or decreases a value, a numeric digit, or scrolls up and down to select an item in a list.
- **10 Data Control Keys** includes the numeric keypad, **ENTER** key and backspace key, change the numeric value of an active function such as center frequency, start frequency, resolution bandwidth, and marker position. if the analyzer is in the remote mode, pressing **ENTER** key returns the analyzer to the local mode and enables front-panel control.

1 Overview

- 11 **RF IN connector** recieves the signal input. The maximum damage level is average continuous power +33 dBm or DC voltage 50 VDC. The impedance is 50Ω . (N-type female).
- **12 PROBE POWER connector** provides power for high-impedance AC probes or other accessories (+15 V, -12 V, 150 mA maximum).
- **13 CAL OUT connector** provides an amplitude reference signal output of 40 MHz at -25 dBm (BNC female).
- 14 **TG SOURCE connector** N-type female, is the source output for the built-in tracking generator. The maximum damage level is average continuous power +30 dBm or DC voltage 50 VDC. The impedance is 50 Ω (for Option TG7)
- **15 Standby Switch** switches on all functions of the analyzer. To switch the analyzer off, press the switch for at least 2 seconds. This deactivates all the functions but retains power to internal circuits so long as the analyzer is connected to line power.
- **16 On LED** (green) lights when the analyzer is switched on.
- **17 Standby LED** lights when the analyzer is connected to the line power.
- **18 Remote LED** lights when the analyzer is remotely controlled by a PC via the USB host interface on the rear panel.
- **19 USB Device Connector** provides a connection between external USB devices and the analyzer, such as a USB memory device.


Display Annotations

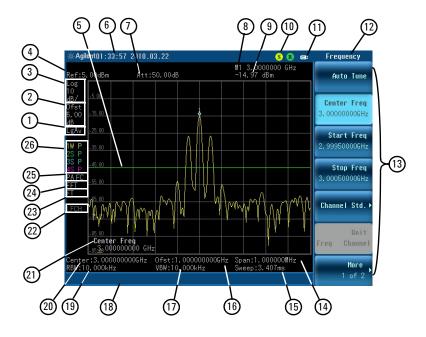

ltem	Description	Notes (Associated function key)	
1	Average Type	[BW] > Average Type	
2	Reference Offset	[Amplitude] > Ref Offset	
3	Amplitude scale	[Amplitude] > Scale Type	
4	Reference level	[Amplitude] > Ref Level	
5	Display Line	[Disp] > Display Line	
6	Time and date display	[System] > Time/Date	
7	RF attenuation	[Amplitude] > Attenuation	
8	Marker frequency	[Marker]	
9	Marker amplitude	[Marker]	
10	Indicator	S - Shift R - Remote Control	
11	USB disk indicator	The USB memory device is in use.	
12	Key menu title	Dependent on key selection.	

13	Softkey menu	Refer to "Key Reference" for details. Dependent on current function key selection.	
14	Frequency span	[SPAN]	
15	Sweep time	[Sweep] > Sweep Time	
16	Fequency offset	[Frequency] > Freq Offset	
17	Video bandwidth	[BW] > Video BW	
18	Display status line	Display status and instrument messages.	
19	Resolution bandwidth	[BW] > Res BW	
20	Center Frequency	[Frequency] > Center Freq	
21	Active function block	The functino in use	
22	Low frequency channel	[Frequency] > LowFrqChannel	
23	Sweep time rule	[Sweep] > Sweep Setup > Swp Time Rule	
24	Sweep type	[Sweep] > Sweep Setup > Sweep Type	
25 - right	Trigger/Sweep F - free run trigger V - video trigger E - external trigger C - continuous sweep S - single sweep	[Sweep] > Trigge	
25 - left	Internal preamp	[Amplitude] > Int Preamp	
26	Trace mode W - clear write M - maximum hold m - minimum hold V - view S - store blank	[Trace]	
	Detect mode N - Normal A - Average P - Positive peak S - Sample N - Neg Peak	[Trace] > Detector	

Rear Panel Overview

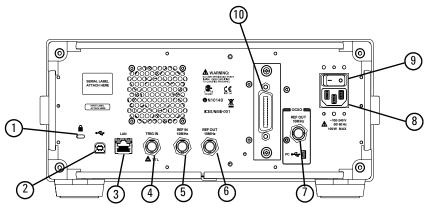

- **1** Kensington Lock lock the instrument and keep its safety.
- **2 USB Host connector** provides a connection between the analyzer and an PC for remote control.
- **3** LAN port A TCP/IP Interface used for remote operation.
- **4 EXT TRG IN (TTL) connector** accepts an external voltage input, the positive edge of which triggers the analyzer sweep function. (BNC female)
- **5 REF IN connector** accepts an external timebase with a frequency of 10 MHz, amplitude of -5 to +10 dBm. (BNC female)
- **6 REF OUT connector** provides a frequency of 10 MHz, amplitude of -10 dBm reference output. (BNC female)
- **7 REF OUT connector** (Option PFR) is an optional connector for precision 10 MHz reference from OCXO.
- 8 AC Power Receptacle accepts a three-pin line power plug.
- **9 Power switch** isolates the analyzer from the AC line power. After switch on, the analyzer enters into standby mode and the orange standby LED on the front panel lights.
- **10 GPIB connector** (Option G01) is an optional interface. This GPIB connector supports remote operation.

Front and rear panel symbols

Λ	The instruction manual symbol : indicates that the user must refer to specific instructions in the manual.
CE	The CE mark: a registered trademark of the European Community.
	The CSA mark: a registered trademark of the Canadian Standards Association International.
ICES/NMB-001	The ISM device complies with Canadian Interference-Causing Equipment Standard-001. Cet appareil ISM est conforme à la norme NMB-001 du Canada.
V N10149	The C-Tick mark : a trademark registered to the Australian Communication Media Authority. It indicates compliance with all Australian EMC regulatory information.
С I	marks the "on/standby" position of the switch.
\sim	indicates that the instrument requires AC power input.
	indicates this product complies with the WEEE Directive (2002/96/EC) marking requirements and you must not discard this equipment in domestic household waste. Do not dispose in domestic household waste. To return unwanted products, contact your local Agilent office, or refer to http://www.agilent.com/environment/product/



Agilent N9322C Spectrum Analyzer User's Guide

Getting Started

2

Check the Shipment and Order List12Safety Notice14Power Requirements15Power On and Check17Environmental Requirements19Electrostatic Discharge Protection22Helpful Tips23

This chapter helps you in preparing the spectrum analyzer for use and provides the information to start using the spectrum analyzer correctly.



Check the Shipment and Order List

After receiving the shipment, first check the shipment and your order list. Inspect the shipping container and the cushioning material for signs of stress. Retain the shipping materials for future use, as you may wish to ship the analyzer to another location or to Agilent Technologies for service. Verify that the contents of the shipping container are complete.

Shipping Problems?

If the shipping materials are damaged or the contents of the container are incomplete, please contact the nearest Agilent Technologies office to arrange for repair or replacement. You will not need to wait for a claim settlement. If you must return an analyzer to Agilent Technologies, use the original (or comparable) shipping materials.

Options

Verify if that the shipment includes your ordered options by checking the option label on the shipping container.

Unless specified otherwise, all options are available when you order a spectrum analyzer; some options are also available as kits that you can order and install/activate after you receive the analyzer. Order kits through your local Agilent Sales and Service Office.

At the time of analyzer purchase, options can be ordered using your product number and the number of the option you are ordering. For example, if you are ordering option TG7, you would order N9322C-TG7.

If you are ordering an option after the purchase of your analyzer, you will need to add a K to the product number and then specify which option you are ordering. For example, N9322CK-TG7.

For the latest information on Agilent N9322C spectrum analyzer options and upgrade kits, visit the following Internet URL: http://www.agilent.com/find/n9322c

Safety Notice

	Read the following warnings and cautions carefully before powering on the spectrum analyzer to ensure personal and instrument safety.
WARNING	Always use a well-grounded, three-pin AC power cord to connect to power source. Personal injury may occur if there is any interruption of the AC power cord. Intentional interruption is prohibited. If this product is to be energized via an external auto transformer for voltage reduction, make sure that its common terminal is connected to a neutral (earthed pole) of the power supply.
WARNING	Personal injury may result if the spectrum analyzer covers are removed. There are no operator-serviceable parts inside. To avoid electrical shock, refer servicing to qualified personnel.
WARNING	Electrical shock may result if the spectrum analyzer is connected to the power supply while cleaning. Do not attempt to clean internally.
CAUTION	Prevent damage to the instrument and ensure protection of the input mixer by limiting average continuous power input to +33 dBm, DC voltage to 50 VDC with \geq 10 dB input attenuation. Instrument damage may result if these precautions are not followed.
CAUTION	To install the spectrum analyzer in other racks, note that they may promote shock hazards, overheating, dusting contamination, and inferior system performance. Consult your Agilent customer engineer about installation, warranty, and support details.

Power Requirements

The spectrum analyzer has an auto-ranging line voltage input. The AC power supply must meet the following requirements:

Voltage:	100 to 240 VAC
Frequency:	50 to 60 Hz
Power:	Maximum 100 W

AC Power Cord

The analyzer is equipped with a three-wire power cord, in accordance with international safety standards. This cable grounds the analyzer cabinet when connected to an appropriate power line outlet. The cable appropriate to the original shipping location is included with the analyzer.

Various AC power cables are available that are unique to specific geographic areas. You can order additional AC power cables for use in different areas. The table **AC Power Cords** lists the available AC power cables, the plug configurations, and identifies the geographic area in which each cable is appropriate.

The detachable power cord is the product disconnecting device. It disconnects the mains circuits from the mains supply before other parts of the product. The front panel switch is only a standby switch and do not disconnect instrument from LINE power.

AC Power Cords


Plug Type	Cable Part Number	Plug ^a Description	For use in Country & Region
250V 10A	8121-1703	BS 1363/A	Option 900 United Kingdom, Hong Kong, Singapore, Malaysia
250V 10A	8120-0696	AS 3112:2000	Option 901 Australia, New Zealand
250V 16A	8120-1692	IEC 83 C4	Option 902 Continental Europe, Korea, Indonesia, Italy, Russia
125V 10A	8120-1521	CNS 10917-2 /NEMA 5-15P	Option 903 United States, Canada, Taiwan, Mexico
250V 10A	8120-2296	SEV 1011	Option 906 Switzerland
230V 15A	8120-4600	SABS 164-1	Option 917 South Africa, India
125V 15A	8120-4754	JIS C8303	Option 918 Japan
250V 16A	8120-5181	SI 32	Option 919 Israel
250V 10A	8120-8377	GB 1002	Option 922 China

a. Plug description describes the plug only. The part number is for the complete cable assembly.

Power On and Check

1 Connect the AC power cord into the instrument. Insert the plug into a power socket provided with a protective ground. Set the tilt adjustors for your preference.

Figure 2-1 Plug in and angle adjustment

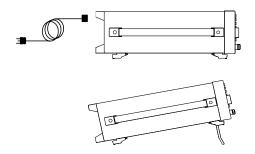

- 2 Press the AC line switch on the rear panel. The standby LED on the front panel will light and the spectrum analyzer is in standby mode (AC power applied).
- 3 Press the standby switch (b) on the front panel. The On LED will light, and the spectrum analyzer boots up.

Self-initialization takes about 25 seconds; the spectrum analyzer then defaults to the menu mode. After power on, let the spectrum analyzer warm up for 45 minutes for stabilization.

NOTE The front panel switch is a standby switch only; it is not a power switch. To completely disconnect the spectrum analyzer from the AC line power, shut off the power switch on the rear panel.

Check for Instrument Messages

The spectrum analyzer has two categories of instrument messages: error and warning messages. A error message is triggered by operation errors, for example, parameter setting conflicts or data input that is out of the range of a parameter. An warning message may be triggered by hardware defects which could result in damage to instrument.

Here are some tips to check the instrument messages.

- Check the display to see if any messages display in the status bar. Press [System] > System Info > Error History to review each message. Refer to Chapter 5, "Instrument Messages" for detailed system message descriptions.
- 2 When you have reviewed and resolved all of the error messages, press [System] > System Info > Error History > Clear error queue to delete the messages.
- **3** Cycle the power to the analyzer and re-check to see if the instrument messages are still there.
- **4** If the error messages cannot be resolved, please contact the Agilent Customer Contact Center for assistance or service.

Environmental Requirements

Agilent Technologies has designed this product for use in Installation Category II, Pollution Degree 2, per IEC 61010-1. Agilent has designed the spectrum analyzer for use under the following conditions:

- Indoor use
- Altitude < 3,000 meters
- Operating temperature range: +5 to +45 °C; Storage temperature range: -20 to +70 °C
- Relative humidity range 15% to 95%

NOTE

This equipment is Class A suitable for professional use and is for use in electromagnetic environments outside of the home.

Ventilation

Ventilation holes are located on the rear panel and one side of the spectrum analyzer cover. Do not allow these holes to be obstructed, as they allow air flow through the spectrum analyzer.

When installing the spectrum analyzer in a cabinet, do not restrict the convection of the analyzer. The ambient temperature outside the cabinet must be less than the maximum operating temperature of the spectrum analyzer by $4 \, {}^{\text{o}}\text{C}$ for every 100 watts dissipated within the cabinet.

Cleaning Tips

To prevent electrical shock, disconnect the spectrum analyzer from line power before cleaning. Use a dry cloth or one slightly dampened with water to clean the external case parts. Do not attempt to clean internally.


Rack Mount


It is recommended to use the Agilent rackmount kit (option 1CM) to install the spectrum analyzer into a rack.

Do not attempt to rack mount the spectrum analyzer by the front panel handles only. This rackmount kit will allow mounting of the spectrum analyzer with or without handles.

Refer to the following instructions when installing the rackmount kit on the spectrum analyzer.

- **1** Remove feet, key-locks and tilt stands.
- 2 Remove side trim strips and one middle screw per side.

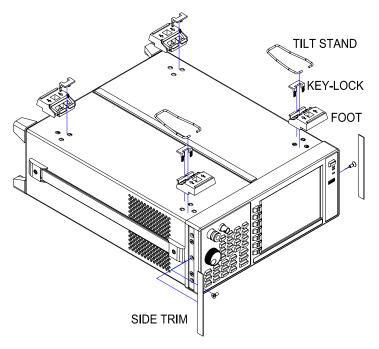

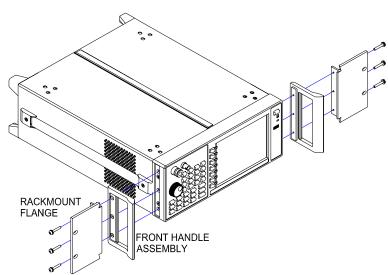

screws per side.

Attach rackmount flange and front handle assembly with 3

4 Attach the spectrum analyzer to the rack using the rackmount flanges with two dress screws per side.

CAUTION

3

Installing the spectrum analyzers into other racks may promote shock hazards, overheating, dust contamination, and inferior system performance. Consult your Agilent customer engineer about installation, warranty, and support details.

Electrostatic Discharge Protection

Electrostatic discharge (ESD) damages or destroys electronic components (the possibility of unseen damage caused by ESD is present whenever transported, stored, or while the instrument is in use).

This product contains components that are easily damaged by electrostatic discharge. To help reduce the possibility of ESD damage that can occur while using test equipment, follow these guidelines:

- Before connecting any coaxial cable to the spectrum analyzer connector for the first time each day, momentarily short the center and outer conductors of the cable together to eliminate any potential electrostatic charges that may exist.
- 2 Personnel should be grounded with an approved type, 1 M Ω resistor-isolated ESD wrist-strap before touching the center pin of any connector, and before removing any assembly from the spectrum analyzer.
- **3** Be sure that all instruments are properly earth grounded to prevent build-up of static charges.

For more information about ESD and how to prevent ESD damage, contact the Electrostatic Discharge Association (*http://www.esda.org*). The ESD standards developed by this agency are sanctioned by the American National Standards Institute (ANSI).

BSA PC software

Agilent HSA PC software is an easy-to-use, PC-based remote control tool for the N9322C spectrum analyzer.

It is able to be discretely used as a spectrum monitor to display and control the trace scans simultaneously with the analyzer, or a file manager to send/get files between the analyzer and PC. It also provides some data analysis function for your further use.

You can get this software in the Help Kit CD, or download from http://www.agilent.com/find/n9322c.

NOTE To connect the analyzer via the USB/LAN port to a PC, no extra driver is required. All you need is the Agilent IO libraries suite, which is in the Help kit CD shipped with your analyzer, or download the IO libraries suite from http://www.agilent.com/find/iolib

For the further description of the BSA PC software, please refer to the online help embedded in this software.

Helpful Tips

The following contains information to help in using and maintaining the instrument for optimum operation, including alignment, external reference, firmware update and option activation.

Perform Calibration

The N9322C provides three manual calibration function to calibrate the time base and amplitude. The analyzer should warm up for 30 minutes before calibration.

Time Base Calibration

Perform a time base calibration to guarantee the frequency accuracy. The analyzer should warm up for approximately 30 minutes before calibration.

When the calibration is triggered, the current measurement is interrupted and a gauge displays on the LCD. The gauge simply indicates calibration is in process. When it is finished, the interrupted measurement restarts.

Please refer to the operation procedures as below:

- 1 Input a 10 MHz, 0 dBn signal to EXT TRIG IN.
- 2 Press [System] > Service > Calibration > Time Base by Ext to initiate the calibration.

Time base calibration takes only a short time when the inner temperature is stable. When the inner temperature is increasing, calibration takes a long period of time or will fail. If the input reference signal is abnormal, the calibration cycle will take a long and unpredictable time to exit, and the LCD displays an error message.

Amplitude Calibration

The analyzer privides the internal amplitude calibration function. Please refer to the procedures below to perform an amplitude calibration:

- 1 Press [System] > More > Service > Calibration > Amp Alignment
- 2 2 Connect the CAL OUT and RF IN connector with a N-BNC cable. Then Press [Enter] to continue.

The calibration will start immediately. The calibration will be completed in serveral minutes.

Using an External Reference

To use an external 10 MHz source as the reference frequency, connect the external reference source to the **REF IN** connector on the rear panel. An EXT REF indicator will display in the upper bar of the display. The signal level must be in the range of -5 to +10 dBm. When the reference signal is ready, the instrument switches the reference from time base to the external reference.

Enable an Options

Option license key information is required to enable product options. Contact your nearest Agilent office for purchasing a license. Refer to the procedures below to activate the options you have purchased.

- 1 Press [System] > More > Service > Add Option
- 2 Enter the option number to be enabled. Press [Enter] to confirm your input.
- **3** Enter the license key in the onscreen window. Press **[Enter]** to confirm your input and terminate the license key input.
- 4 Press Activate License. The option will be enabled immediately.

The analyzer provides the trial license with limited time usage(15/270/365 days) of the wanted options.

Firmware Upgrade

Press **[System] > System Info > Show system** to view the firmware revision. If you call Agilent Technologies regarding your analyzer, it is helpful to have this revision and the analyzer serial number available.

Follow this procedure to finish the firmware update:

- 1 Download the firmware package from www.agilent.com/find/n9322c. Extract and copy the file to the folder "N932xDATA" into the root directory of a USB stick.
- 2 Plug the USB stick into the connector. Press [System] > Service > Upgrade Firmware

The analyzer will perform the update process automatically. The upgrade procedure will take several minutes. Once the upgrade is completed, please follow the instruction to reboot.

CAUTION Any interruption during the update process will result in update failure and system data lost. Do not remove the USB storage device until the update is finished.

IO Configuration

The N9322C spectrum analyzer provides three types of IO connnection: USB, LAN and optional GPIB interface. Press **[System] > More > Port Setting** to set the corresponding interface as your need.

USB

Select USB to enable the USB connection for remote control.

LAN

The N9322C supports LAN port connection for remote control. Press [System] > {More} > {Port Setting} > {IP Config} to set the IP parameters for the network connection.

Press {**IP** Address Static} to manually set the IP address, gateway and subnet mask with the proper LAN information, or just press {**IP** Address DCHP} to set the IP address in LAN dynamically according DCHP.

Press **{Apply}** to enable the LAN connection according to the IP configuration you set.

GPIB

Press [System] > {More} > {Port Setting} > {GPIB Address} to set the GPIB address for the analyzer. This softkey is only vaild after the option G01 is installed.

Timed Power On/Off

Pressing [System] > {Power On/Off Preset} > {Timed Pwr On} or {Timed Pwr Off} sets the time switch to power on/off the N9322C in a user-defined time and date. This function requires the power supply connected.

Press **{Repeat Mode Once/Everyday}** to set the N9322C boot up/off in the pre-saved time everyday. The pre-saved date is invalid in this mode.

Power Preset Last

Press **[System]** > **{Pwr On/Preset}** > **{Power On Last}** to activate this function. For the standard N9322C, this operation only save the last state if the analyzer is turned off by the front panel power switch.

Data Securities

The N9322C offers the optional memory erase function for data security. Press [System] > {More} > {Securities} > {Erase Memory} to erase all the user data in internal memory. Press Enter as a terminator to start the erase process immediately.

The memory erase process takes about 15 minutes. During the time, there must be a constant power supply to ensure the successful erase. If the erase process is interrupted, please reboot the instrument and erase memory again.

Probe Power Output

The Probe Power provides power for high-impedance AC probes or other accessories (+15 V, -12V, 150 mA maximum).

The Porbe Power is set to off as default. Press [System] > {More} > {Port Setting} > {Probe Power On} to switch on the porbe power output.

2 Getting Started



Agilent N9322C Spectrum Analyzer User's Guide

3

Functions and Measurements

Making a Basic Measurement 30 35 **Measuring Multiple Signals** 44 Measuring a Low-Level Signal Improving Frequency Resolution and Accuracy 49 **Tracking Drifting Signals** 51 **Making Distortion Measurements** 53 Stimulus Response Transmission 59 Measuring Stop Band Attenuation of a Lowpass Filter 61 **Channel Scanner** 64 Spectrum Monitor 69 71 **Reflection Measurement** Making a Power Measurement with USB Power Sensor 74 Demodulate the AM/FM signal 84 Analysis the Modulated Signals 87 **Measuring Channel Power** 93 **Files Operation** 95

This chapter provides information on the analyzer functions and specific measurements capabilities of the spectrum analyzer.



Making a Basic Measurement

This section provides information on basic operations. It assumes that you are familiar with the front and top panel buttons and keys, and display annotations of your analyzer. If you are not, please refer to "Front Panel Overview" on page 4 and "Rear Panel Overview" on page 9.

For more details on making measurements, please refer to "Key Reference" on page 101".

Using the Front Panel

This section provides you with the information on using the front panel of the spectrum analyzer.

Entering Data

When setting the measurement parameters, there are several ways to enter or modify the value of the active function:

- **Knob** Increments or decrements the current value.
- Arrow Keys Increments or decrements the current value by a step unit.
- **Numeric Keys** Enters a specific value. Then press the desired terminator (either a unit softkey, or **[Enter]** hardkey).
- **Unit Softkeys** Terminate (enter) a value with a unit softkey from the menu.
 - **Enter Key** Terminates an entry when no unit of measure is required, or the instrument uses the default unit.
 - **ESC Key** To delete the current input digit prior to entering the value.

Using Softkeys

Softkeys are used to modify the analyzer function parameter settings. Some examples of softkey types are:

- **Toggle** Turn on or off an instrument state.
- Submenu Displays a secondary menu of softkeys, {More}.
 - **Choice** Selecting from a list of standard values or filenames.
 - **Adjust** Highlights the softkey and sets the active function.

Presetting the Spectrum Analyzer

Preset function provides a known instrument status for making measurements. There are two types of presets, factory and user:

Factory Preset When this preset type is selected, it restores the analyzer to its factory-defined state. A set of known instrument parameter settings defined by the factory.

User Preset Restores the analyzer to a user-defined state. A set of user defined instrument parameter settings saved for assisting the user in quickly returning to known a instrument measurement setup.

Press **System > Pwr on/Off Preset > Preset Type** to select the preset type.

When **Preset Type** is set to **Factory**, pressing **Preset** triggers a factory preset condition. The instrument will immediately return to the factory default instrument parameter setting.

When **Preset Type** is set to **User**, pressing **Preset** triggers a user preset condition. The instrument will immediately return to the user defined instrument parameter setting.

When **Preset Type** is set to **Last**, pressing **Preset** triggers a last power-off condition. The instrument will immediately return to the parameter setting when it is power off last time.

Setting up a User Preset

To quickly return to instrument settings that are user defined, perform the following steps to save the instrument state as the user-defined preset:

1 Set the instrument parameters to the values and settings necessary for the user preset state. This would include the frequency, span, amplitude, BW, and measurement type and any other setup details desired. 2 Press System > Pwr on/off Preset > Save User, to save the current instrument settings as the 'user preset' state. The user preset will not affect the default factory preset settings. User preset settings can be changed and saved at any time.

Attenuation	20 dB(Auto)	Average Type	Log Pwr
Center frequency	3.5 GHz	Average Number	100 (Off)
Reference offset	0 dB	Peak Excursion	6 dB
Start Frequency	0 Hz	Peak Threshold	-140 dBm
Stop Frequency	7 GHz	Peak Search Type	Max
Hi-Sensitivity	Off	Continuous Pk	Off
Span	7 GHz	Graticule	On
Reference level	0 dBm	Y Scale	On
Log scale/Division	10 dB	Cal Out	Off
Int Preamp	Off	Probe Power	Off
Trace 1	Clear Write	Trigger	Free Run
Trace 2, 3, 4	Blank	Marker Mode	Normal
Sweep Time	328.5 ms(Auto)	Marker Function	Normal
Sweep	Continuous	Marker Table	Off
Limit Line	Off	Measure	Meas Off
Limit	Off	File Catalog	Int
Impedance	50 Ω	File Sort	By Date
Detector	Pos Peak	Gated Sweep	Off
Display line	Off	Gate Delay	12 μs
Video bandwidth	3 MHz(Auto)	Gate Length	84 μs
VBW/RBW ratio	1.000 (Auto)	Gate Source	External
Resolution bandwidth	3 MHz(Auto)	Sweep Time Rule	Speed

Figure 3-1 F	^E actory Default	Preset	Setting
--------------	-----------------------------	--------	---------

Viewing a Signal

Refer to the procedures below to view a signal.

- 1 Press System > Pow on/off Preset > Preset Type > Factory to enable the factory-defined preset state.
- **2** Press **Preset** to restore the analyzer to its factory-defined state.
- **3** Connect the 10 MHz **REF OUT** on the rear panel to the front-panel **RF IN**.

Setting the Reference Level and Center Frequency

- **1** Press **Amplitude > 10 > dBm** to set 10 dBm reference level.
- 2 Press Frequency > 30 > MHz to set 30 MHz to center frequency.

Setting Frequency Span

Press **Span > 50 > MHz** to set 50 MHz frequency span.

NOTE

Changing the reference level changes the amplitude value of the top graticule line. Changing the center frequency changes the horizontal placement of the signal on the display. Increasing the span will increase the frequency range that appears horizontally across the display.

Reading Frequency and Amplitude

1 Press **Peak Search** to place a marker (labeled 1) on the 10 MHz peak.

Note that the frequency and amplitude of the marker appear both in the active function block, and in the upper-right corner of the screen.

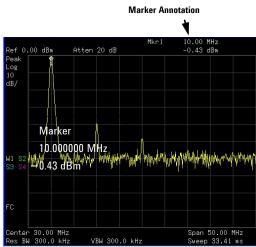


Figure 3-1 10 MHz Internal Reference Signal

2 Use the knob, the arrow keys, or the softkeys in the **Peak Search** menu to move the marker. The marker information will be displayed in the upper-right corner of the screen.

Changing Reference Level

- **1** Press **Amplitude** and note that reference level (**Ref Level**) is now the active function.
- 2 Press Marker > Marker To > Mkr-> Ref Lvl.

NOTE Changing the reference level changes the amplitude value of the top graticule line.

Measuring Multiple Signals

This section provides the information on how to measure multiple signals.

Comparing Signals on the Same Screen Using Marker Delta

The delta marker function allows the user to compare two signals when both appear on the screen at the same time.

In the following example, harmonics of the 10 MHz reference signal available are used to measure frequency and amplitude differences between two signals on the same screen. Delta marker is used to demonstrate this comparison.

1 Preset the analyzer:

Press Preset (With Preset Type of Factory)

- 2 Connect the rear panel **REF OUT** to the front panel **RF IN**.
- **3** Set the analyzer center frequency, span and reference level to view the 10 MHz signal and its harmonics up to 50 MHz:

Press Frequency > 30 > MHz

Press Span > 50 > MHz

Press Ampulitude > 10 > dBm

4 Place a marker at the highest peak on the display (10 MHz):

Press Peak Search

The marker should be on the 10 MHz reference signal. Use the **Next Right Pk** and **Next Left Pk** softkeys to move the marker from peak to peak.

5 Anchor the first marker and activate a second marker:

Press Marker > Mode > Delta

The label on the first marker now reads 1R, indicating that it is marking the reference point.


6 Move the second marker to another signal peak using the front-panel knob or by using **Peak Search**.

Press Peak Search > Next Peak or

Press **Peak Search > Next Right Pk** or **Next Left Pk**. Continue pressing the **Next Pk** softkeys until the marker is on the correct signal peak.

The amplitude and frequency differences between the markers are displayed in the active function block.

Figure 3-2 Delta pair marker with signals on the same screen

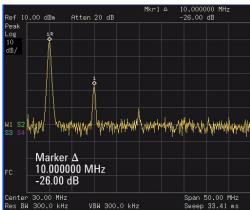

NOTE

To increase the resolution of the marker readings, turn on the frequency count function. For more information, refer to "Improving Frequency Resolution and Accuracy" on page 49.

Comparing Signals not on the Same Screen Using Marker Delta

The analyzer will compare the frequency and amplitude differences between two signals which are not displayed on the screen at the same time. (Inis technique is useful for harmonic distortion tests.)

In this example, the analyzer's 10 MHz signal is used to measure frequency and amplitude differences between a signal on screen, and another signal off screen. Delta marker is used to demonstrate this comparison.

1 Preset the analyzer:

Press Preset (With Preset Type set to Factory)

- 2 Connect the rear panel **REF OUT** to the front panel **RF IN**.
- **3** Set the center frequency, span and reference level to view only the 50 MHz signal:

Press Frequency > 50 > MHz

Press Span > 25 > MHz

Press Amplitude > 10 > dBm

4 Place a marker on the 50 MHz peak and then set the center frequency step size equal to the marker frequency (10 MHz):

Press Peak Search

Press Marker > Marker To > Mkr -> CF Step

5 Activate the marker delta function:

Press Marker > Mode > Delta

6 Increase the center frequency by 10 MHz:

Press Frequency, •

The first marker moves to the left edge of the screen, at the amplitude of the first signal peak.

Figure 3-3 shows the reference annotation for the delta marker (1R) at the left side of the display, indicating that the marker set at the 50 MHz reference signal is at a lower frequency than the frequency range currently displayed.

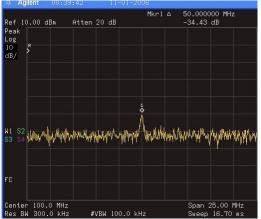


Figure 3-3 Delta Marker with Reference Signal Off-Screen

The delta marker appears on the peak of the 100 MHz component. The delta marker annotation displays the amplitude and frequency difference between the 50 and 100 MHz signal peaks.

7 Press Marker > Mode > Off to turn the markers off.

Resolving Signals of Equal Amplitude

In this example a decrease in the resolution bandwidth (RBW) is used in combination with a decrease in video bandwidth (VBW) to resolve two signals of equal amplitude with a frequency separation of 100 kHz.

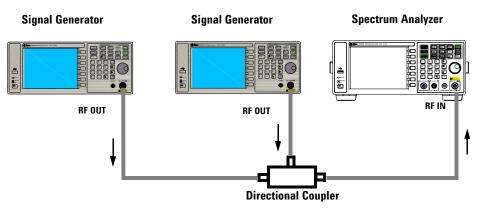


Figure 3-4 Setup for obtaining two signals

Notice that the final RBW selection to resolve the signals is the same width as the signal separation while the VBW is slightly narrower than the RBW.

- **1** Connect two sources to the analyzer input as shown above.
- 2 Set one source to 300 MHz. Set the frequency of the other source to 300.1 MHz. Set both source amplitudes to -20 dBm.
- **3** Setup the analyzer to view the signals:

Press Preset (With Preset Type of Factory)

Press Frequency > 300 > MHz

Press BW > 300 > kHz

Press Span > 2 > MHz

A single signal peak is visible. See Figure 3-5 for example.


If the signal peak is not present on the display, increase the frequency span out to 20 MHz, turn signal tracking on, decrease the span back to 2 MHz and turn signal tracking off:

Press Span > 20 > MHz

Press Peak Search

Press Span > 2 > MHz



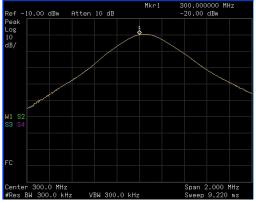

4 Change the resolution bandwidth (RBW) to 100 kHz so that the RBW setting is less than or equal to the frequency separation of the two signals:

Press BW > 100 > kHz

Notice that the peak of the signal has become flattened indicating that two signals are present.

5 Decrease the video bandwidth to 3 kHz:

Press BW > Video BW > 3 > kHz

Two signals are now visible as shown in Figure 3-6. Use the front-panel knob or arrow keys to further reduce the resolution bandwidth and better resolve the signals.

Decreasing the resolution bandwidth improves the resolution of the individual signals and increases the sweep time.

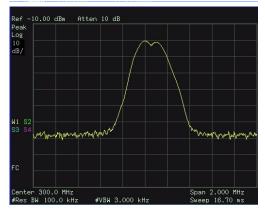


Figure 3-6 Resolving Signals of Equal Amplitude

For fastest measurement times, use the widest possible resolution bandwidth. Under factory preset conditions, the resolution bandwidth is coupled to the span.

Resolving Small Signals Hidden by Large Signals

This example uses narrow resolution bandwidths to resolve two RF signals that have a frequency separation of 50 kHz and an amplitude difference of 60 dB.

- 1 Connect two sources to the **RF IN** as shown in Figure 3-4.
- 2 Set one source to 300 MHz at -10 dBm. Set the other source to 300.05 MHz at -70 dBm.
- **3** Set the analyzer as follows:

Press Preset. (With Preset Type of Factory)

Press Frequency > 300 > MHz

Press BW > 30 > kHz

Press Span > 500 > kHz

4 Set the 300 MHz signal to the reference level:

Press Peak Search

Press Marker > Mode > Mkr -> Ref Lvl

NOTE

The 30 kHz filter shape factor of 15:1 has a bandwidth of 450 kHz at the 60 dB point. The half-bandwidth (225 kHz) is NOT narrower than the frequency separation of 50 kHz, so the input signals can not be resolved.

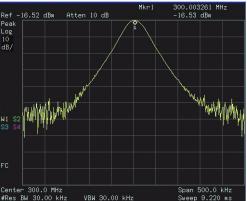


Figure 3-7 Unresolved small signal from large signal

5 Reduce the resolution bandwidth filter to view the smaller signal. The smaller signal will be hidden by the larger signal when the bandwidth settings are wider. Reducing the RBW setting will allow less of the larger signal to pass through the analyzer and the smaller signals peak will then rise out of the noise floor. Place a delta marker on the smaller signal:

 $\mathrm{Press} \; BW > 1 > kHz$

Press Peak Search

Press Marker > Mode > Delta

Press 50 > kHz



Figure 3-8 Resolved small signal from large signal

NOTE

The 1 kHz filter shape factor of 15:1 has a bandwidth of 15 kHz at the 60 dB point. The half-bandwidth (7.5 kHz) is narrower than the frequency separation of 50 kHz, so the input signals can be resolved.

Measuring a Low-Level Signal

This section provides information on measuring low-level signals and distinguishing them from spectrum noise.

Reducing Input Attenuation


The ability to measure a low-level signal is limited by internally generated noise of the spectrum analyzer. The analyzers input attenuator affects the level of a signal passing through the analyzer. If a signal power level is close to the noise floor, reducing the analyzer input attenuation will help raise the signal so that it can be seen rising out of the noise.

CAUTION Ensure that the total power of all input signals at the analyzer RF input does not exceed +30 dBm (1 Watt).

1 Preset the analyzer

Press Preset (With Preset Type of Factory)

 Set the source frequency to 300 MHz, amplitude to -70 dBm. Connect the source RF OUT to the analyzer RF IN.
 Figure 3-9 Setup for obtaining one signal

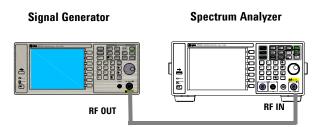

3 Set the center frequency, span and reference level:

Press Frequency > 300 > MHz

Press Span > 2 > MHz


Press Amplitude > 40 > -dBm.


4 Move the desired peak to the center of the display: Press **Peak Search**

Press Marker > Marker To > Mkr -> CF

- 5 Reduce the span to 500 kHz, if necessary re-center the peak: Press Span > 500 > kHz
- **6** Set the attenuation to 20 dB:

Press Amplitude > Attenuation > 20 > dB



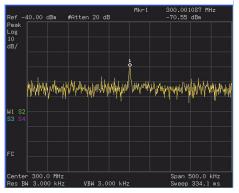


Note that increasing the attenuation moves the noise floor closer to the signal level.

7 To allow more of the signal power to pass through the analyzer, decrease the attenuation to 0 dB.

A lower attenuation value will mean that more of the signal strength will be displayed on screen:

Press Amplitude > Attenuation > 0 > dB

Figure 3-11 Measuring a low-level signal using 0 dB Attenuation

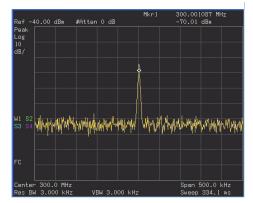

Decreasing the Resolution Bandwidth

Resolution bandwidth settings affect the level of internal noise but have little affect on the displayed level of continuous wave (CW) signals. Decreasing the RBW by a decade (factor of ten) reduces the noise floor by 10 dB.

- **1** Refer to the procedure "Reducing Input Attenuation" on page 44 and follow steps 1, 2 and 3.
- **2** Decrease the resolution bandwidth:

Press **BW** and **▽**

The low-level signal appears more clearly due to the noise level being reduced by the decrease in RBW (see Figure 3-12).

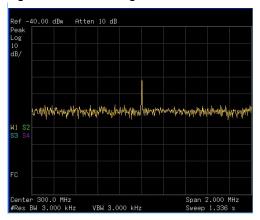


Figure 3-12 Decreasing Resolution Bandwidth

A "#" mark appears next to the Res BW annotation in the lower left corner of the screen, indicating that the resolution bandwidth is uncoupled.

Uncoupled indicates that the function is in manual control mode, not auto control mode. Manual control mode allows the user to change the parameter value for that function without affecting any other settings.

NOTE

The analyzer allows you to change the RBW in a 1-3-10 sequence by the data control keys. The RBWs below 1 kHz are digital and have a selectivity ratio of 5:1 while RBWs at 1 kHz and higher have a 15:1 selectivity ratio. The maximum RBW is 3 MHz and minimum is 10 Hz.

Trace Averaging

Averaging is a digital process in which each sweep of the trace returns measurement values for each point in the trace. These values are then mathematically averaged with the previous sweep trace data which has been stored in the analyzer. The amount of averaging is selected by choosing the number of trace sweeps to be included in the process. The averaging function uses the most recent trace sweep values so that the display shows any signal changes.

Selecting averaging, when the analyzer is auto-coupled, changes the detection mode to **Sample**, smoothing the displayed noise level.

NOTE

This is a trace processing function and is not the same as using the average detector (as described on page 47).


- **1** Refer to the procedure "Reducing Input Attenuation" on page 44 of this chapter and follow steps 1, 2 and 3.
- 2 To turn averaging on, toggle the softkey menu labeled Average:

Press BW > Average (On)

3 Set the number of averages to 20, using the number keypad, up and down arrows, or the knob:

Press 20, Enter

The averaging process smooths the viewed trace, low level signals become more visible (see Figure 3-13). Changes to the average number will restart the averaging process.

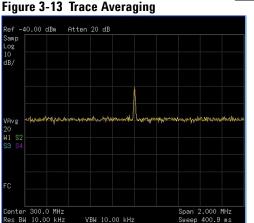

— Counted result

Improving Frequency Resolution and Accuracy

This section provides information on using the frequency counter function to improve frequency resolution and accuracy.

- **1** Press **Preset** (With **Preset Type** of **Factory**)
- 2 Connect a cable from the front panel CAL OUT to RF IN;

Press **System > Service > Calibration > CAL OUT ON** to toggle on and enable the 50 MHz amplitude reference signal.


3 Press Frequency > Auto Tune.

The analyzer will detect the signal peak and locate it to the center of the display (Refer to "Auto Tune" on page 111).

4 Turn the frequency counter on:

Press Marker > Function > Counter.

5 Move the marker, with the front-panel knob, half-way down the skirt of the signal response.

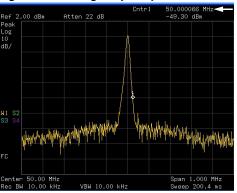



NOTE

The frequency and amplitude of the marker appears in the active function area (this is not the counted result). The counted result appears in the upper-right corner of the display to the right-side of C1.

The marker readout in the active frequency function changes while the counted frequency result (upper-right corner of display) does not. For an accurate count, the marker need not be placed at the exact peak of the signal response.

NOTE	The Frequency counter properly functions only on stable, CW signals or discrete spectral components. The marker power level must be greater than 40 dB above the displayed noise level.
6	To turn off the marker counter:

Press Marker > Function > Off.

NOTE	When using the frequency counter function, the ratio of the resolution
	bandwidth to the span must be greater than 0.02.

Tracking Drifting Signals

This section provides information on measuring and tracking signals that drift in frequency.

Measuring a Source's Frequency Drift

The analyzer will measure source stability. The maximum amplitude level and the frequency drift of an input signal trace can be displayed and held by using the maximum hold function. Using the maximum hold function you can measure and determine how much of the frequency spectrum a signal occupies. For more information, refer to "Max Hold" on page 162.

Use signal tracking to return a signal drifting in frequency to the center of the display. The drifting is captured by the analyzer using the maximum hold function.

- 1 Connect the signal generator to the analyzer **RF IN**.
- **2** Output a signal with the frequency of 300 MHz and amplitude of -20 dBm.
- **3** Set the analyzer center frequency, span and reference level.

Press Preset. (With Preset Type of Factory)

Press Frequency > 300 > MHz

Press Span > 10 > MHz

Press Amplitude > -10 > dBm

4 Place a marker on the peak of the signal:

Press Peak Search

Press Marker > Marker To > Marker to Center

Press Span > 1 > MHz

The signal is in the center of the display.

6 Measure the excursion of the signal with maximum hold:

Press Trace/Det > Max Hold

As the signal varies, maximum hold maintains the maximum responses of the input signal. Annotation on the left side of the screen indicates the trace mode. For example, M1 S2 S3 S4, indicates trace 1 is in maximum-hold mode, trace 2, trace 3, and trace 4 are in store-blank mode.

7 Activate trace 2 and change the mode to continuous sweep: Press Trace/Det > Select Trace > Trace 2

Press Clear Write

Trace 1 remains in maximum hold mode to show any drift in the signal.

8 Slowly increase the frequency of the signal generator. Your analyzer display should look similar to Figure 3-15.

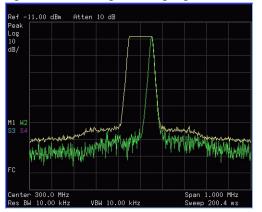


Figure 3-15 Viewing a Drifting Signal With Max Hold and Clear Write

Making Distortion Measurements

This section provides information on measuring and identifying signal distortion.

Identifying Analyzer Generated Distortion

High-level input signals may cause analyzer distortion products that could mask the real distortion measured on the input signal. Use trace and the RF input attenuator to determine which signals, if any, are internally generated distortion products.

In this example, we use the RF output of a signal generator to determine whether the harmonic distortion products are internally generated by the analyzer.


- 1 Connect the signal generator to the analyzer **RF IN**.
- 2 Set the source frequency to 200 MHz, amplitude to 0 dBm.
- **3** Set the analyzer center frequency and span:

Press **Preset**

Press Frequency > 400 > MHz

Press Span > 500 > MHz

Figure 3-16 Harmonic Distortion

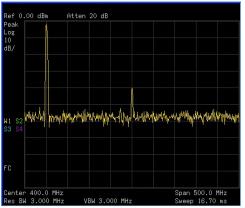

The signal produces harmonic products (spaced 200 MHz from the original 200 MHz signal) in the analyzer input mixer as shown in Figure 3-16.

4 Change the center frequency to the value of the first harmonic:

Press Peak Search > Next Peak

Press Marker > Marker To > Mkr -> CF

5 Change the span to 50 MHz and re-center the signal:

Press Span > 50 > MHz

Press Peak Search

Press Marker > Marker To > Mkr -> CF

6 Set the attenuation to 0 dB:

Press Amplitude > Attenuation > 0 > dB

7 To determine whether the analyzer generates harmonic distortion products, first display the trace data in trace 2 as follows:

Press Trace/Det > Select Trace > Trace 2

Press Clear Write

8 Allow trace 2 to update (minimum two sweeps), then store the data from trace 2 and place a delta marker on the harmonic of trace 2:

Press Trace/Det > View

Press Peak Search


Press Marker > Mode > Delta

The analyzer display shows the stored data in trace 2 and the measured data in trace 1. The **Marker** Δ indicator reads the difference in amplitude between the reference and active markers.

9 Increase the RF attenuation to 10 dB:

Press Amplitude > Attenuation > 10 > dB

Notice the **Marker** Δ amplitude readout. This is the difference of the distortion product amplitude between 0 dB and 10 dB input attenuation settings. If the **Marker** Δ absolute amplitude is approximately ≥ 1 dB for an input attenuator change, the analyzer is generating, at least in part, the distortion.

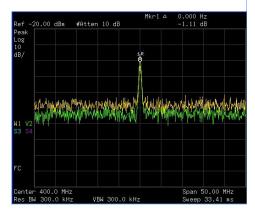

The Marker A amplitude readout comes from two sources:

1) Increased input attenuation causes poorer signal-to-noise ratio. This causes the $Marker\Delta$ to be positive.

2) The reduced contribution of the analyzer circuits to the harmonic measurement causes the **Marker** Δ to be negative.


Large Marker Δ readout indicates significant measurement errors. Set the input attenuator to minimize the absolute value of Marker Δ .

Third-Order Intermodulation Distortion

Two-tone, third-order intermodulation distortion is a common specification in communication systems. When two signals are present in a non-linear system, they may interact and create third-order intermodulation distortion (TOI) products that are located close to the original signals. System components such as amplifiers and mixers contribute to the generation of these distortion products.

This example will test a device for third-order intermodulation through the use of markers. Two sources are used, one set to 300 MHz and the other to 301 MHz.

1 Connect the equipment as shown in figure below. This combination of signal generators, low pass filters, and directional coupler (used as a combiner) results in a two-tone source with very low intermodulation distortion. Although the distortion from this setup may be better than the specified performance of the analyzer, it is useful for determining the TOI performance of the source/analyzer combination. After the performance of the source/analyzer combination has been verified, the device-under-test (DUT) (for example, an amplifier) would be inserted between the directional coupler output and the analyzer input.

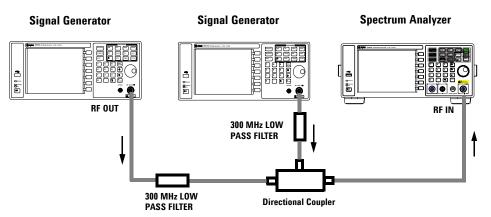

NOTE

The coupler should have a high degree of isolation between the two input ports so the sources do not intermodulate.

- 2 Set one source (signal generator) to 300 MHz and the other source to 301 MHz, for a frequency separation of 1 MHz. Set the sources equal in amplitude as measured by the analyzer (in this example, they are set to -5 dBm).
- **3** Set the analyzer center frequency and span:

Press Preset (With Preset Type of Factory)

Press Frequency > 300.5 > MHz

Press Span > 5 > MHz

4 Reduce the RBW until the distortion products are visible:

Press **BW** and \bigtriangledown

5 Move the signal to the reference level:

Press Peak Search

Press Marker > Marker To > Mkr -> Ref Lvl

6 Reduce the RBW until the distortion products are visible:

Press **BW** and **♥**

7 Activate the second marker and place it on the peak of the distortion product(beside the test signal) using the **Next Peak**:

Press Marker > Mode > Delta

Press Peak Search > Next Peak

8 Measure the other distortion product:

Press Marker > Normal

Press Peak Search > Next Peak

9 Measure the difference between this test signal and the second distortion product (see Figure 3-17):

Press Marker > Mode > Delta

Press Peak Search > Next Peak

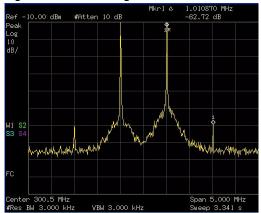



Figure 3-17 Measuring the Distortion Product

Stimulus Response Transmission

The procedure below describes using the built-in tracking generator of the analyzer to measure the rejection of a low pass filter. A type of transmission measurement.

1 To measure the rejection of a low pass filter, connect the equipment as shown in Figure 3-18. A 370 MHz low pass filter as the DUT.



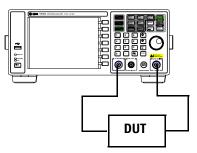

- 2 Press Preset. (With Preset Type of Factory)
- Set the start and stop frequencies and resolution bandwidth: Press Frequency > Start Freq > 100 > MHz Press Frequency> Stop Freq > 1 > GHz Press Bw > 3 > MHz
- 4 Turn on the tracking generator and if necessary, set the output power to -10 dBm:

Press Mode > Tracking Generator > Amplitude (On) > -10 > dBm

CAUTION Excessive signal input may damage the DUT. Do not exceed the maximum power that the device under test can tolerate.

NOTE To reduce ripples caused by source return loss, use 6 dB or greater output attenuation. Tracking generator output attenuation is normally a function of the source power selected. However, the output attenuation may be controlled in the Tracking Generator menu. To increase measurement sensitivity and smooth the noise:
 Press BW > 30 > kHz

Press BW > Video BW > 300 > kHz

A decrease in displayed amplitude is caused by tracking error.

6 Connect the cable from the tracking generator output to the analyzer input. Store the frequency response in trace 3 and normalize:

```
Press Meas > Normalize > Store Ref (1 \rightarrow 4) > Normalize (On)
```

7 Reconnect the DUT to the analyzer and change the normalized reference position:

Press Meas > Normalize > Norm Ref Posn > 8

8 Measure the rejection of the low pass filter: Press Marker > 370 > MHz, Mode > Delta > 160> MHz

The marker readout displays the rejection of the filter at 160 MHz above the cutoff frequency of the low pass filter. See Figure 3-19 as below.

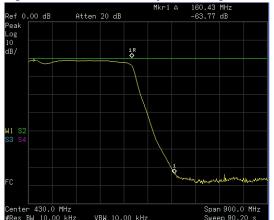


Figure 3-19 Measure the Rejection Range


Measuring Stop Band Attenuation of a Lowpass Filter

When measuring filter performance, it is useful to look at the stimulus response over a wide frequency range. Setting the analyzer y-axis (amplitude) to Log scale type presents the measurement data in a usable format for determining filter characteristics.

The following example uses the tracking generator to measure the stop band attenuation of a 370 MHz low pass filter.

1 To measure the response of a low pass filter, connect the equipment as shown in Figure 3-20. This example uses a 370 MHz low pass filter.

Figure 3-20 Transmission Measurement Test Setup

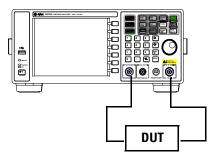

- 2 Press Preset. (With Preset Type of Factory)
- 3 Set the start and stop frequencies and resolution bandwidth: Press Frequency > Start Freq > 100 > MHz Press Frequency > Stop Freq > 1 > GHz Press Amplitude > Scale Type > Log

4 Set the resolution bandwidth to 10 kHz:

Press BW > 10 > KHz

CAUTION

Excessive signal input may damage the DUT. Do not exceed the maximum power that the device under test can tolerate.

5 Turn on the tracking generator and, if necessary, set the output power to -10 dBm:

Press Mode > Tracking Generator > Amplitude (On) > -10 > dBm

6 Connect the test cable (but not the DUT) from the tracking generator output to the analyzer input. Store the frequency response into trace 3 and normalize:

Press Meas > Normalize > Store Ref $(1 \rightarrow 4)$ > Normalize (On)

- 7 Reconnect the DUT to the analyzer. Note that the units of the reference level have changed to dB, indicating that this is now a relative measurement.
- 8 To change the normalized reference position:

Press Meas > Normalize > Norm Ref Posn > 8

9 Place the reference marker at the specified cutoff frequency:

Press Marker > Mode > Delta Pair (Ref) > 370 > MHz

10 Place the second marker at 37 MHz:

Press Delta Pair (Delta) > 37 > MHz

11 In this example, the attenuation over this frequency range is -17.98 dB/octave (one octave above the cutoff frequency).

12 Use the front-panel knob to place the marker at the highest peak in the stop band to determine the minimum stop band attenuation. In this example, the peak occurs with Delta of 563 MHz. The attenuation is -60.93 dB. See Figure 3-21.

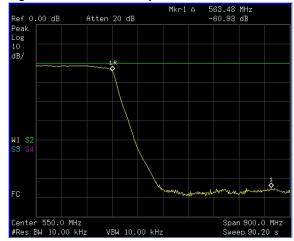


Figure 3-21 Minimum Stop Band Attenuation

Channel Scanner

The channel scanner - option SCN is a tool for coverage test, band clearance, and spectrum monitoring. It measures the channel power of multiple transmitted channels. The power is displayed via either the graphic bar chart or time bar chart. It allows you to set maximum 20 channels for your test. You can continuously log the scanned channel data as CSV file for post processing on your PC.

Top/Bottom N Channel Scanner

Top/Bottom N channel scan is used for searching the top/bottom channels from specified channel range according channel power.

nit:d	lBm	Ref:-1	00.00 📘		
tt	10	FREQ	BW	CHP	
0.00				(dBm)	
	6	65.000M	10.000M	-3.080	
	14	135.000M	10.000M	-4.359	
	7	75.000M	10.000M		
Αv	13	125.000M	10.000M		
	8	85.000M	10.000M		
	12	115.000M	10.000M	-23.563	
С	10	100.000H	10.000M	-28.541	
	11	105.000H	10.000M	-30.110	
	9	95.000M	10.000M	-30.476	
	20	200.000H	10.000M	-46.668	
	19	190.000H	10.000M	-48.936	
	1	10.000M	10.000M	-49.005	
	17	170.000H	10.000M	-49.114	
	15	150.000H	10.000M	-49.154	
	16	160.000M	10.000M		
	18	180.000M	10.000M	-49.471	
	5	50.000M	10.000M		
	4	40.000M	10.000M	-50.234	
	3	30.000M	10.000M		
	2	20.000M	10.000M	-50.432	
dex:	6				

Figure 3-22 Top N Channel Scanner Measurement

Please refer to the procedures below to perform a Top N channel scanner measurement.

- 1 Connect the antenna to RF IN connector.
- 2 Turn on the channel scanner function.

Press Meas > Channel Scanner

- 3 Press Meas > Scan Mode > Top N to set the scan mode to TOP N channel mode. Input the channel number you need to monitoring. Press Enter as a terminator.
- 4 Press **Range Edit** to access the submenu to edit the scan range.

Toggle Edit Method to underline Std. It allows you to set the range according to the embedded communication standard, such as CDMA and GSM which is used specifically in different countries. Press Signal Std to select the standard. Press Recall as a terminator. Press Begin Chn and End Chn to set the begin and end channel for scanning. Press Apply to apply all the range settings.

If you toggle **Edit Method** to underline **Custom**, it allows you to set the customer-defined scan as your need.

Press Start Freq to set the scan start frequency.

Press **Freq Step Size** to set the frequency interval for adjacent channels.

Press **Bandwidth** to set the bandwidth of each frequency channel which is used to calculate the channel power.

Press **Number of Chn** to set the number of frequency channels which will be scanned.

Press Apply as a terminator to apply all the settings above.

- 5 Press Scan Start to initiate the channel scan function.
- 6 Press **Logging Start** to start recording the scan process which includes the channel power and related channel bandwidth value to a CSV file. Press **Logging Stop** to end the logging. The CSVfile will be saved immediately.

List N Channel Scanner

The List N channel scan is used for listing the frequency channels from specific channel standard or customized frequency bandwidth.

Please refer to the procedures below to perform a List N channel scanner measurement.

- 1 Connect the antenna to RF IN connector.
- 2 Turn on the channel scanner function.

Press Meas > Channel Scanner}

- 3 Press Meas > Scan Mode > List to set the scan mode to List N channel mode. Input the channel number you need to monitoring. Press Enter as a terminator.
- 4 Press List Edit to access the submenu to edit the scan range.

Press **Insert** to insert a channel and access the channel setting submenu to customize the channel parameters.

Press **Edit Method Std**. It allows you to set the range according to the embedded communication standard, such as CDMA and GSM which is used specifically in different countries.

Press **Signal Std** to load a standard file as your need. Please refer to "Loading a File" on page 98 for details. Press **Chn ID** to select the specific channel according to the signal standard.

Or press **Edit Method Custom**. It allows you to set the customer-defined scan as your need.

 $\ensuremath{\mathsf{Press}}$ $\ensuremath{\mathsf{Freq}}$ to set the center frequency of the current channel.

Press **Bandwidth** to set the bandwidth of each frequency channel which is used to calculate the channel power.

The first channel editing is completed. Press **Return > Insert** to add more channels as your need.

If there is a need to further edit the channel set previously, press **Index**, rotate the knob to highlight the channel as your need for further editing.

Press Apply as a terminator to apply all the settings above.

- 5 Press Scan Start to initiate the channel scan function.
- 6 Press **Logging Start** to start recording the scan process which includes the channel power and related channel bandwidth value to a CSV file. Press **Logging Stop** to end the logging. The CSV file will be saved immediately.

Please make sure the file catalog is set to INT or USB unless the logging file can not be saved successfully. When the logging file exceeds the maximum volume of the storage catalog, the logging will automatically pause and the file will be saved immediately.

Display

NOTE

In channel scanner mode, the **[Disp]** hardkey is used to adjust the channel scanner display to review the customized scan result.

Press **{Freeze}** to pause the display refresh but the scan is still running.

You can sort the channel by ID or power, in ascending or decending order. Or you can press **{Disp Mode}** to toggle the display mode between bar mode and time mode.

Unit:∢	lBm	Ref: 0.	00		-100.00
Att 50.00 dB	No	FREQ (MHz)	BAND (MHZ)	CHP (dBm)	5. 62 10. 34
ad Ofst	1	934.987	1.250	-75.00	
10.00	2	935.012	1.250	-66.00	
dB	3	935.037	1.250	-64.00	
LgAv	4	935.063	1.250	-75.00	
9999	5	935.087	1.250	-57.00	
₩	6	935.112	1.250	-64.00	
PA C	7	935.137	1.250	-41.00	
Speed	8	935.162	1.250	-38.00	
	9	935.188	1.250	-37.00	
	10	935.212	1.250	-27.00	
	11	935.237	1.250	-38.00	
	12	935.262	1.250	-27.00	
	13	935.287	1.250	-20.00	
	14	935.313	1.250	-17.00	
	15	935.337	1.250	-19.00	
	16	935.362	1.250	-12.00	
	17	935.387	1.250	-4.00	
	18	935.412	1.250	1.00	
	19	935.438	1.250	2.00	
	20	935.462	1.250	18.00	

Figure 3-23 Time display mode in List N channel scanner

Channel Scanner Setup

To customized the channel scan process, you can press **Meas** > **Channel Scanner** > **Setup** to set the measurement interval and rule in the submenu.

The **Meas Interval** is a value of time/distance during which the every two scan process is triggered. When it is set to off, the channel will be scanned with default settings.

The **Interval Type** is toggled between time and distance. When it is set to **Time**, the minimum interval time is 100 ms. When it is set to **Distance**, it allows you to measure the channel with the specific distance on the road test. The minimum interval distance is 1 meter.

The Measure Rule and Search Rule is toggled between Speed and Accuracy.

For each scan process, the analyzer will first search and find out the available channels according to the selected scan mode. Then, a precise measurement will perform to get the scan result.

The accuracy mode in measurement rule is set as default to get the precise measurement for the searching-out channels.

The speed mode will speed the measurement but reduce the measurement accuracy. It is set to default in search rule to search out the available channels approximately.

The **Top Cycle** number is the searching times for each measurement. It allows you to measure the specific searching-out channels continuously.

Spectrum Monitor

The scrolling three-dimensional display is noted for its ability to track the frequency and power behavior over the time, particularly intermittent signals. Spectrum Monitor may be used to analyze the stability of a signal over the time, or to identify intermittent interference signals in communications systems.

The X-axis represents frequency, and amplitude is represented by color; red for a strong signal and blue for noise floor. The Y-axis represents time, with the trace from the newest sweep displayed at the bottom of the screen. Earlier traces move up toward the top with each new sweep. Two coupled markers allow the user to place a marker on any trace in the Spectrum Monitor and view the normal spectrum for the time of that sweep. The time interval between sweeps can be adjusted, and up to 1500 traces can be displayed and saved.

Agilent04:20:02 2010.05.27 Spectrum M1:0.0 Hz -1.74dBm Spectrogram Att:20.00dB Ref:0.00dBm Paus Restart Meas Update Int 100.0ms Spotrg View grad way was a start of the Palette nlor Gra enter:0.0 Hz BW:1.000000MHz Disp Mode VBW:1.000000MHz Sweep:20.26ms Spotrg&Trace H1 Time: 04:19:44 05, 27, 2010 -100.00 dBm 0.00 dBm 🕂 M2 Tine: -Center Freq 0.0 Hz File Logging)

Figure 3-24 Spectrum Monitor Submenu

Please refer to the procedures below to perform a spectrum monitor measurement.

- 1 Connect the omni antenna to RF IN connector.
- 2 Set the center frequency and span.

Press Frequency > 1.8052 > GHz

Press SPAN > 5 > MHz

3 Turn on the spectrum monitor function.

Press Meas > Spectrum Monitor.

4 Set the update interval time between two frames.

Press **Update Int. On**, rotating the knob or pressing numeric keypads to set the update interval time.

5 Turn on Marker 1 and Marker 2.

Press Marker 1 > State On, Marker 2 > State On.

- 6 Press **Frequency**, rotate knob to change the frequency of marker as you want.
- 7 Press **Meas > File Logging > Start Save** to save the spectrogram data. After pressing **Stop Save**, the spectrogram will be saved into a trace or CSV data file for your future use.

Please refer to "Loading a File" on page 98 to load the saved spectrogram trace file.

Spectrum Monitor Audio Alert

The spectrum monitor provides an audio alert with a frequency dependant on the different control parameters. This alert needs two markers to specify the measure channel. The **Band Power** of the channel specified by two markers is measured without the audio alert. The **Alert Limit** is set to specify the lowest band power that makes the buzzer beep.

Please refer to the procedures below to turn on the audio alert.

- 1 Press **Meas > Spectrum Monitor** to access into the spectrogram mode.
- 2 Press Marker > More > Audio Alert to enable the audio alert.

Reflection Measurement

Press **MODE > Reflection Measurement** to access the cable and antenna measurement submenu. There are three different measurement mode for your selection:

- Reflection measurement
- One port cable loss
- Distance to fault

Preparation

Before making a measurement in a specific mode, the HSA requires a calibration to make sure the measurement accuracy. A new calibration must be performed if any components used in the calibration setup are changed. For example, a short coaxial cable used to connect the tester to the DUT

Press **Frequency** and **Span** to set the measurement frequency range. It is best to keep the calibration frequency range as close as possible to the actual sweep frequencies necessary for the measurements. Calibrating over a larger frequency range than the actual measurement range will reduce the accuracy of the test results.

Calibrate with a T-combo calibrator

T-combo calibrator This is a T-shaped mechanical calibrator. It consists of a calibrated open, short and 50 Ω load. Using the T-combo calibrator will result in a more accurate calibration than when using the an electronic calibrator.

Using a T-combo calibrator is a three step process requiring the user to manually change the open-short-load components. The default order of the calibration process is open-short-load.

1 Press **Frequency > Calibrate** to bring up the dialog box for calibration instruction. Follow the on-screen instruction to connect the Open component of the T-combo calibrator to the RF OUT connector of the analyzer. Press **ENTER** to start the open calibration.

- 2 Follow the instruction to connect the short component of the T-combo calibrator to the RF OUT connector of the tester. Press **ENTER** to start the short calibration.
- 3 Connect the Load component of the T-combo calibrator to the RF OUT connector.

Press ENTER to start the load calibration.

A **Calibrated** indicator is shown on the upper left corner of the screen when the calibration is completed. Then, the analyzer is ready for your further cable measurement.

Measuring Cable Reflection

Press **Mode > Reflection Measurement > Reflection Measurement** to select the Reflection Measurement Mode. It allows you to set the Y axis of the graticule as return loss, VSWR or reflection coefficient value.

Measuring Distance to Fault

For this measurement, an internally generated signal emits from the RF OUT port of the tester and is transmitted to the cable and antenna system (DUT). The tester receives and processes the signal power reflected from faults and imperfections. In performing a DTF measurement, the tester uses frequency domain reflectometry. The transmitted and reflected signals contain information about the distance to the faults. This information is used to determine the physical distance to the faults. The tester displays the physical distance to the probable faults, corrected for cable loss and the velocity propagation factor of the cable.

Perform a DTF measurement

To make a DTF-return loss measurement over a frequency range of 50 to 400 MHz, perform the following steps:

- 1 Press the **MODE > Reflection Measurement > Distantce To Fault** to select the DTF mode.
- 2 Press FREQ > Start > 50 > MHz to set the start frequency to 50 MHz.
- 3 Press Stop > 400 > MHz to set the stop frequency to 400 MHz.
- 4 Press **Calibrate** to bring up the calibration process guidance. Follow the instructions to perform a calibration. For more information about calibration, refer to "Preparation" on page 71.
- 5 Remove the calibrator and connect the cable under test (DUT) to the RF OUT connector on the top panel of the tester.

The DTF measurement starts and the results are displayed on the screen. A peak in the horizontal trace indicates a defective location.

Making a Power Measurement with USB Power Sensor

The N9322C spectrum analyzer supports the U2000 and U2020 series USB power sensors.

The U2000 Series USB power sensors do not need manual calibration and zero routines performed. Calibration and zeroing are performed without removing the power sensor from the source, through internal zeroing. With internal zeroing of U2000 Series USB power sensors, there is no need to disconnect the sensor or power-off the DUT. The U2000 Series do not require 50 MHz reference signal calibration, allowing the factory calibration to ensure measurement accuracy. For best accuracy, users are recommended to perform external zeroing for input signals below - 30 dBm for best accuracy.

CAUTION The maximum power for the RF IN port and the RF OUT port of the analyzer is +30 dBm (1 W). The maximum power for the U2000 Series Power Sensor port is +25 dBm (316 mW). When directly coupled to a base station, the test set can be damaged by excessive power applied to any of these three ports.

To prevent damage in most situations when directly connect an analyzer to a base station, use a high power attenuator between the analyzer and the BTS.

NOTE


If you suspect other signals may be present, it is recommended that you turn off all the other channels and measure average power only on the signal of interest. Another option is to measure channel power (which is less accurate), that filters out all other channels (signals).

Making an Average Power Measurement

The average power measurements provide a key metric in transmitter performance.

Base station transmit power must be set accurately to achieve optimal coverage in wireless networks. If the transmit power is set too high due to inaccurate power measurements, undesired interference can occur. If the transmit power is set too low, coverage gaps or holes may occur. Either case affects system capacity and may translate into decreased revenue for service providers. Average power can be measured for the channel of interest while the base station is active. All other channels should be inactive. Average power is a broadband measurement. If other signals are present the analyzer will also measure their power contributions.

Figure 3-25 Connection with base station

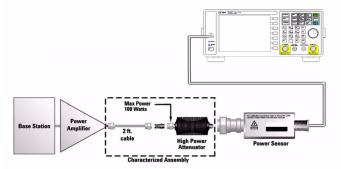

To make an average power measurement, you connect the power sensor and cable, zero and calibrate the meter, before making a measurement. Zeroing of the power meter will occur automatically:

- Every time you use the Power Meter.
- When a 5 degree C. change in temperature occurs.
- Whenever you change the power sensor.
- Every 24 hours.

• Before measuring low level signals—for example, 10 dB above the lowest specified power for your power sensor.

Calibrating the power meter every time you cycle the power on and off.

In most situations, you can press **Zero** to complete the two steps (zero and cal) together.

Follow the steps below to make a basic average power measurement.

- **1** Press **Preset**. (With **Preset Type** of **Factory**)
- 2 Press Mode > Power Meter to access the power meter mode.
- **3** Zero and calibrate the meter. Press **Zero** to make a Zero operation of the power sensor followed by a calibration operation.
- **4** Connect the power sensor to the USB port of N9322C. The analyzer will recognize the power sensor automatically.

CAUTION

To prevent damage to your sensor, do not exceed the power levels below. U2000/1/2A +25 dBm (320 mW) average, 20 VDC +33 dBm (2 W) peak, <10 μs

For more information on the maximum power of U2000 series power sensors, please refer to the *Operating and Service Guide* of Agilent U2000 Series USB Power Sensors.

- **5** Connect the external attenuation, if required, with the power sensor used.
- **6** Connect the analyzer to the base station. Connect the power sensor to the signal to be measured. A typical BTS connection is after the output of the power amplifier and duplexer. The connection requires a cable and two Type-N barrel connectors, in addition to the power sensor and external attenuator.

- 7 Press **Meas Setup > Disp Range** to set the display range of the measurement. when it is set to **On**, the display range will be adjusted automatically according to the signal power dynamic range. When it is set to Off, press **Top** and **Bottom** to set the display range manually.
- 8 Press **General Setup > Freq** to set the power frequency for the DUT. The current frequency will display in the bottom line.
- 9 Press Power Range > Auto Power to toggles the measurement range between On and Off. When it is set to On, the power range will be adjusted automatically. Use auto range when you are not sure of the power level you are about to measure. When it is set to Off, press Range to select the upper range or lower range. The lower range uses the more sensitive path and the upper range uses the attenuated path.

Sensor	Lower range	Upper range
U2000/1/2/4A	–60 dBm to –7 dBm	-7 dBm to +20 dBm
U2000/1/2H	–50 dBm to +3 dBm	+3 dBm to +30 dBm
U2000/1B	–30 dBm to +23 dBm	+23 dBm to +44 dBm

Table 1Power Sensor Range

10 Press Meas > Meas Seup > Disp Mode to set the display in meter. chart or trace display. the measurement result will displays on the screen as shown.



Figure 3-26 Power Measurement

Making a Peak Power Measurement

The Agilent U2020 X-series USB peak and average power sensors enable peak power measurements that have the same accuracy as measurements obtained using traditonal peak power meters, while providing the advantages of being a very compact and portable form factor.

Follow the steps below to make a peak power measurement.

- **1** Press **Mode > Power Meter** to access the power meter mode.
- **2** Connect the power sensor to the USB port of N9322C. The sensor will automatically initialize, perform zeroing (While remianing connectored to the device under test), and calibrate without connecting to an external source.

NOTE You can manually perform zeroing and calibration by perssing **Zeroing** > **Zeroing** and **Calibration** at any time after the sensor is connected and initialized.

3 Press **General Setup > Freq** to set the frequency of the signal under test.

As a wideband device, the power sensor has a frequency response. The power sensor utilizes a complex correction algorithm to remove power measurement error due to linearity error, frquency response, and temperature drift to generate a more accurate measurement. The analyzer provide the customer preset function with U2020 X-series power sensor. Press **Meas > Preset** and the predefined protocol list will pop up. Select the wanted item and press **Preset** as a terminator. The related settings will be set automatically.


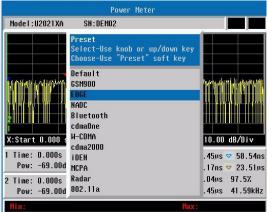


Figure 3-27 Customized Preset the U2020 Power Sensor

4 Press Meas Disp > Disp Mode > Trace to find the measurement results as Figure 3-28 below.



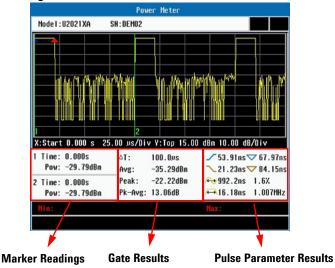

Power Meter Settings

Please find the sections below to find the general power meter measurement settings.

Setting the Power Meter Top and Bottom End-Points

Setting the end points (Disk Range) close to expected measurement value changes the sensitivity of the Power Meter scale resolution. This is an advantage in viewing small changes in power. However, this will not affect the overall range of the sensor. This is only available for Meter and Chart display mode. For Trace display, please press **Meas > Peak Setup > Trace Setup** to set the X and Y scale.

- 1 Press Meas > Meas Disp > Dis Range to access the end-points menu.
- 2 Press **Top** and enter the maximum scale value using the numeric keypad. Then press **dBm** to complete the setup.
- **3** Press **Bottom** and enter the minimum scale value desired using the numeric keypad. Then press **dBm** to complete the setup.

Setting Power Meter Resolution

There are four levels of power meter resolution. Higher resolutions provide more accuracy but slow the measurement speed. The resolution is only available for U2000 series power meter and free-run trigger mode in U2020 series power meter..

Press **Meas > Meas Disp > Resolution**. Select 1,2,3 or 4. The four options represent different resolution as follow:

- [1] = 1
- [2] = 0.1
- [3] = 0.01
- [4] = 0.001

Set the Step Detection

Press **Meas > General Setup > Average > Step Detect** to set the step Detect On and Off. When it is set to on, the filter will re-initialize upon detection of a step increase or decrease in the measured power to reduce the filter settling time after a significant step in the measured power, Step detection can be set in both manual and automatic filter modes.

Set the Measurement Gate

Press **Meas > Peak Setup > Gate Setup** to set the start time and gate length for a measurement gate. A measurement gate allows measurements to be performed on particular sections of the input signal. The gate is defined by a start time relative to the trigger instant and a duration. Signal samples acquired during the time interval specified by the gate are used for the measurements in that gate. A system of up to four independent gates is provided.

Set the Trigger

Press **Meas > Peak Setup > Trig/Acq** to set the trigger parameters listed below for the measurement gate.

Acqn Set the single, free run or continuous trigger mode. Select to enable trace and auto trigger delay for the single and continuous trigger modes. For the free run mode, only auto trigger delay can be enabled.

Source Set the trigger source to internal channel or an external source.

Mode Enable auto level or manually set the trigger level if the internal trigger source is selected.

Level sets the trigger level manually when the Mode is set to manual.

Delay Set the delay time to be applied between the trigger event and all the gate start times. This allows you to time-shift all the gates by the same amount with one setting change.

Slope Select the positive or negative slope type to determine if the trigger event is recognized on the rising or falling edge of a signal respectively.

Holdoff Set the holdoff time to disable the trigger mechanism after a trigger event occurs.

Hysteresis Set the hysteresis to help generate a more stable trigger by preventing triggering unless the RF power level achieves the trigger level and the additional hysteresis value. It can be applied to both rising and falling edge trigger generation.

Hysteresis is only available for the internal trigger source and manual trigger level.

Demodulate the AM/FM signal

The N9322C provide the AM/FM demodulation function.

Demodulating an AM Signal

The demodulation function allows you to demodulate and hear signal information displayed on the analyzer.

Simply place a marker on a signal of interest, set the analyzer in zero span, activate AM demodulation, turn the speaker on, and then listen.

- **1** Press **Preset**. (With **Preset Type** of **Factory**)
- 2 Connect an antenna to the RF IN connector.
- **3** Select a frequency range on the analyzer. For example, the frequency range for AM broadcasts in the United States is 550 to 1650 kHz:

Press Frequency > Start Freq > 550 > kHz > Stop Freq > 1650> kHz.

4 Place a marker on the signal of interest:

Press Peak Search > Next Right Pk or Next Left Pk

5 Set the frequency of interest to center frequency:

Press Marker > Marker To > Mkr -> Center.

6 Change the resolution bandwidth to 100 kHz:

Press BW > 100 > kHz.

- 7 Press Span > Zero Span
- 8 Press Sweep > Sweep Time > 10 s to set the sweep time.
- 8 Set the detector type and turn on AM demodulation:

Press Trace/Det > Detector > Sample.

Press Marker > Function > Demod

Press Demod Setting > Demod Type AM

Demodulating an FM Signal

This section demonstrates how to demodulate and listen to an FM signal using the built-in FM demodulator.

Using the built in FM demodulator you can tune to an FM signal and view the results of the detector output as displayed in the time-domain.

- **1** Press **Preset**. (With **Preset Type** of **Factory**)
- **2** Use a signal source or connect an antenna to recieve FM signal. In this example the signal is modulated at 300 MHz with FM deviation of 10 kHz and FM rate of 1 kHz.

NOTE If you are using a broadcast FM signal, the FM channels are broadcasting between 87.7 MHz to 107.7 MHz.

3 Set the center frequency to the center of the FM signal (in this case 300 MHz):

Press Frequency > 300 > MHz.

4 Set the analyzer to zero span for time-domain analysis:

Press Span > Zero Span.

Press Sweep > Sweep Time > 5 > s.

5 Set the resolution bandwidth to capture the full bandwidth of the FM signal.

Press **BW > 100 > kHz**.

6 Turn on the optional pre-amplifier to detect small signals:

Press Amplitude > Preamp On.

7 Turn on the FM demodulator:

Press Marker > Function > Demod

Press Demod Setting > Demod Type FM

3 Functions and Measurements

Listen to the FM signal.

Press **Demod Setting > Speaker Vol**, rotate the knob to adjust the speaker volume.

The headphone jack is available for the audio signal output alternatively.

Analysis the Modulated Signals

The N9322C provides the optional AM/FM (Option AMA) and ASK/FSK (Option-DMA) modulation analysis function for analysis the modulated signals. These functions can be activated by license key.

AM/FM Modulation Analysis

Optional AM/FM demodulation analysis provides modulation metrics, including carrier power, modulation rate, AM depth/FM deviation, SINAD and carrier frequency offset. User definable limits provide Pass/Fail indicators of four types:

Maximum carrier power, Maximum AM modulation index or FM deviation, Minimum AM modulation index or FM deviation, and Minimum carrier frequency offset.

The user can save the waveforms with metrics for reporting as well as the set-up parameters for future measurements or analysis. In the following example, you can use any source available (such as AM/FM radio) as long as it has AM/FM signal generation capability.

AM Modulation Analysis

Please refer to the procedures below for the AM modulation analysis:

- 1 Connect the signal generator to RF IN connector and turn on the signal generator's AM and RF output.
- 2 Turn on the AM demodulation analysis function.

Press **MODE > Modulation Analysis > AM**.

- **3** Press **Frequency > Carrier Freq > 100 > MHz** to set the carrier frequency.
- 4 Set the attenuation state to Auto (default):


Press Amplitude > Attenuation Auto

- 5 Press Shift > Disp > Y Scale > Scale Coupling On to set the Y scale auto coupling.
- 6 Set the AM depth limit and turn on the limit function:

 $\rm Press\,$ Shift > Limit > AM Depth UP > 51 > % > AM Depth Low > 49 > % > Limits on

The red value in the result indicates the demodulated AM depth exceeds the limits set as above.

Figure 3-29 AM demodulation analysis

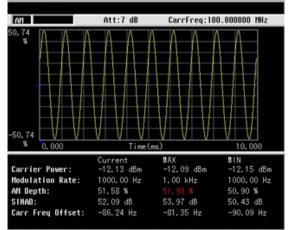

FM Modulation Analysis

Please refer to the procedures below for the FM modulation analysis:

- 1 Connect the signal generator to RF IN connector and turn on the signal generator's FM and RF output.
- 2 Turn on the FM demodulation analysis function.

Press MODE > Modulation Analysis > AM.

- **3** Press **Frequency > Carrier Freq > 100 > MHz** to set the carrier frequency.
- 4 Set the attenuation state to Auto (default):

Press Amplitude > Attenuation Auto

- 5 Press Shift > Disp > Y Scale > Scale Coupling On to set the Y scale auto coupling.
- 6 Set the FM deviation limit and turn on the limit function:
 - Press Shift > Limits > FreqDev UP > 11 > % > FreqDev Low > 9.9 > % > Limits on

The red value in the result indicates the demodulated FM deviation exceeds the limits set as above.

FM Att:8 dB CarrFreq:100.000000 MHz 10.27 kHz 10.27 V kHz 0.000 Time(ms) 10.000 MIN Current -10.95 dBm Carrier Power: -10.90 dBm -10.97 dBm Modulation Rate: 1.00 kHz 1.00 kHz 999.95 Hz Frequency Deviation: 9.96 kHz 9.95 kHz 39.64 dB SINAD: 38.61 dB 37.57 dB Carr Freq Offset: -100.73 Hz -101.47 Hz -80.61 Hz

Figure 3-30 FM modulation analysis

ASK/FSK Modulation Analysis

The ASK/FSK modulation analysis function supports four display modes:

- Symbol
- Waveform
- ASK/FSK Error
- Eye Diagram.

User definable limits provide Pass/Fail indicators of four types:

- Maximum carrier power
- Maximum ASK modulation depth/FSK frequency deviation
- Minimum ASK modulation depth/FSK frequency deviation
- Maximum carrier frequency offset.

The metrics includes carrier power, ASK/FSK error, ASK depth/FSK frequency deviation, and ASK index etc. The waveform with metrics and setup parameters can be saved for reports and future Measurements.

In the following example, you can use any source available (such as your remote key of the car) as long as it has ASK/FSK generation capability. For ASK/FSK signal, its Filter is Nyquist and Alpha is 0.35.

ASK Modulation Analysis

Please refer to the procedures below to analysis the ASK demodulation.

- 1 Connect the signal generator to RF IN connector and turn on the signal generator's ASK modulation and RF output.
- 2 Turn on the ASK demodulation analysis function.

Press MODE > Modulation Analysis > ASK.

- **3** Press **Frequency > Carrier Freq > 100 > MHz** to set the carrier frequency.
- 4 Press Meas > Symbol Rate > 10 > MHz to set the symbol rate.

- 5 Press Filter Setup > Ref Filter > Nyquist to set the filter type.
- 6 Set the attenuation state to Auto (default):


Press Amplitude > Attenuation Auto

- 7 Press Shift > Disp > Y Scale > Scale Coupling On to set the Y scale auto coupling.
- **8** Setting the ASK depth limit and turn on the limit function:

 $\rm Press~Shift > Limits > ASK Depth~UP > 71 > \% > ASK Depth Low > 70 > \% > Limits on$

9 Press Shift > Disp > Display > Eye Diagram to view the eye diagram.



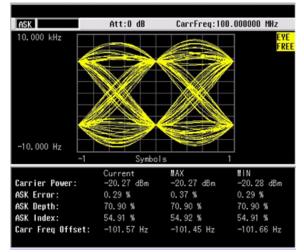

FSK Demodulation Analysis

Please refer to the procedures below to analysis the FSK demodulation.

- 1 Connect the signal generator to RF IN connector and turn on the signal generator's FSK modulation and RF output.
- 2 Turn on the ASK demodulation analysis function.

Press MODE > Modulation Analysis > FSK.

- **3** Press Frequency > Carrier Freq > 100 > MHz to set the carrier frequency.
- 4 Press Meas > Symbol Rate > 10 > ksps to set the symbol rate.
- 5 Press Filter Setup > Ref Filter > Nyquist to set the filter type.
- 6 Set the attenuation state to Auto (default):

Press Amplitude > Attenuation Auto

7 Setting the FSK deviation limit and turn on the limit:

 ${\rm Press}~$ Shift > Limit > FreqDev UP > 85 > kHz > FreqDev Low > 80 > kHz > Limits on

The figure below shows the FSK symbol and the measurement result.

Figure 3-32 FSK Symbol View

			5 100 0	
FSK	Att:0 d	B Car	rFreq:100.0	100000 MHz
				SYMB FREE
1: 0010101001	1100110001	0001001101	1111011101	1001000001
51: 1001110010	0000110001	1011111001	1000111111	0011000110
101: 1111000100	1101111100	1110010100	0001100011	1111011101
151: 0001111100	0101110000	0010000001	0000010001	0111101011
201: 1100111000	0011101101	1011111000	0001010100	1011000000
251: 1010100111	1010100101	0100110101	1010111110	0110001111
301: 1111010001	1011110001	1101000011	0011100110	1000011011
351: 0111111001	0011010001	0110100100	0000100000	0111011011
	Current	∎AX		#IN
Carrier Power:	-13.09 df	Bm −13.	09 dBm	-13.11 dBm
Deviation:	40.01 kH;	z 40.0	1 kHz	39.99 kHz
FSK Error:	1.19 %	1.22	%	1.13 %
Mag Error:	0.59 %	0.81	%	0.59 %
Carr Freq Offset:	-78.78 H	z -78.	78 Hz	-149.47 Hz

Measuring Channel Power

Channel Power measures the power and power spectral density in the specified channel bandwidth. A white frame on the display indicates the edge limits of the channel bandwidth. The user must specify the center frequency, reference level, and channel bandwidth to be used for the measurement.

The power calculation method used to determine the channel power is a traditional method known as the integration bandwidth (IBW) method. A swept spectrum is used as the basis for this calculation. Therefore, it is important to set the resolution bandwidth correctly before making this measurement using the following formula:


$$RBW = \frac{(k(span))}{n}$$

Please refer to the procedures below to set a channal power measurement.

- 1 Press Meas > Channel Power to select the channel power measurement mode
- 2 Press Standard Customize to choose the radio stadard.
- **3** There are four wireless standard options: WCDMA, CDMA, LTE, GSM. Press **WCDMA** as an example.

Once the standard is set, the integration bandwidth and span will be automatically set according to the standard.

4 Press Center Freq to change the center frequency of the current signal channel. Adjust the center frequency to measure other channel power in the same standard.

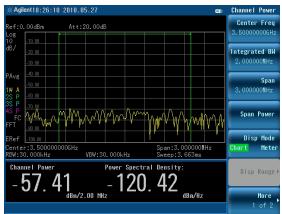

Please follow the similar procedure as above to measure the channel power in the CDMA and LTE standard.

To measure the channel power in GSM standard, the default setting is 10 MHz span, 300 kHz RBW, and the continuous peak search is enabled. The instrument will measure the channel power after the center frequency is changed.

Files Operation

The analyzer will store and retrieve data files similar to using a PC. The analyzer allows you to view and save files in the internal storage of the analyzer or to a USB storage device. This section provides information on how to locate catalogs (file types) and to save files.

Locating and Viewing Files in the Catalog

The analyzer has four types of files:

State	records the current controls and settings of the analyzer. Use
	this file type for saving test parameters for future recall,
	such as frequency and BW settings. (file extension: .STA).

- **Trace** stores trace information (file extension: .TRA).
- **Setup** records the system setting information, such as language, date/time, and power saving mode. This file type is not used for test parameter setup information. (file extension: .SET).
- Screen stores screen captures of the display (file extension: .JPG).
- **Limits** which stores data sets to determine whether a trace has exceeded preset specifications (file extension: .LIM)
 - **CSV** records the trace data and available for review on PC. (file extension: .CSV)
- Task Plannercontains the user-defined measurement tasks in sequence
which make the test task easier in field test.
(file extension: .TPF).
 - **Correction** The amplitude correction file is used for trace amplitude offset compensation. Please refer to "Correction" on page 90 to edit and save the correction file on BSA PC software. (file extension: .TPF).
 - **Standard** contains the frequency range and corresponding parameters for a specific communication standard. It allows you to recall those default settings for the singal searching and testing in that range. (file extension: .STD).

Saving a File

The anlyzer allows you to save files (states, traces, limits or screens) to a USB storage device (**USB**/), or internal storage (**INT**/). The following is an example of how to save a trace to internal storage (**INT**/).

1 Select the save destination for the file. This example will select the internal storage (INT/):

Press File > Directory > Memory Type INT

- 2 Press **Return > Save as**, the pop-up window displays for your further setting.
- **3** Edit a file name.

A file name can consist of letters and digits. A single key stroke on the numerical keypad inputs a digital number; and consecutive key stroke selects and inputs a letter.

- **4** Rotate the knob to choose the file type you need.
- 5 Press Enter to save the file. The file will be saved immediately and "File saved" will be shown in the status bar.

CAUTION When saving a file to a USB storage device, do not disconnect the USB device during the save operation. To do so may cause unexpected data loss.

Quick Saving a File

Press [Save] to quickly save a trace or a screen to either the local memory or an external USB device, depending upon the setup of the save path.

Refer to the steps for saving a trace/screen:

- 1 Press File > Setup > Qsave Type to set the quick save file type.
- 2 Press File > Directory > Media Type to select the file directory.
- 3 Press Return > Save to save a trace or a screen copy to the pre-defined memory. The trace or screen will be automatically assigned with a default file name. A trace will be assigned with a file name, such as *HYTRACE*,

HYTRACE_1, and consecutive decimal numbers appended to the alphabetic file name, such as *HYSCREEN*, *HYSCREEN_1* and consecutive decimal numbers appended to the alphabetic file name.

Saving a User State

The analyzer allows you to recall the frequently used state file with **User** hardkey. Please follow the steps below to create the user menu.

- **1** Follow the file saving procedure above to save a state file in internal memory.
- **2** Rotate the knob to highlight the saved file.
- **3** Press Files Operation > Copy to
- 4 Rotate the knob to highlight the folder named *USER*. Press **Browse Folder** to access into this folder.
- 5 Rotate the knob to highlight the folder named *State*. Press **Browse Folder** to access into this folder.
- 6 Press **Copy** to copy the file into the *User/State* folder.

The state file is available for your quick recall by pressing $\ensuremath{\textbf{User}}$.

Loading a File

This feature will recall (load) onto the displayed screen a previously saved filename and type compatible with this analyzer. The file types are described above.

- 1 Press File > Directory > {Memory Type} to select a directory.
- **2** Rotate the knob to highlight a file.
- **3** Press **Recall** to recall this file.

The wanted file will be loaded immediately.

Loading a Task Planner File

Please refer to the following procedures to load a task planner file.

- 1 Press Mode > Task Planner or File > View FileType > TPF to view the task planner file list.
- **2** Rotate the knob to highlight the task planner file which you need.
- **3** Press **Recall** to load the task planner file. The measurement task will list in sequence.
- 4 Press **Run** to initiate the measurement in sequence.
- NOTE

The task planner file is created by the BSA PC software. For the task planner saving and editing, please refer to the software online help for details.

For the automatic task, all the measurement tasks are executed automatically without interruption. For the manual task, the program is paused and releases a result report when each measurement is finished. The program will be continued once you input the next instruction.

For the manual-if-failed task, the measurement tasks are executed continuously unless there is a failed result.

Copying a File

To copy a file from internal storage to a USB storage device, follow this procedure:


- 1 Connect a USB storage device to the USB connector.
- 2 Press File > Directory > Memory Type to select the path to INT.
- 3 Select the type of file. Assume you need to copy a trace file: Press Return > View FileType > Trace
- **4** Using the knob or arrow keys to highlight the file name you need.
- 5 Press File Operation > Copy To to access the copy submenu. Chose the location for copy desitination, then press Copy to copy the file immediately.

Deleting a File

Perform the following process to delete a specific file. Note that once a file is deleted from local memory, it cannot be recovered.

- 1 Press File > Directory > Memory Type to select the path
- **2** Using the knob or arrow keys to highlight the file name you want to load.
- **5** Press **File Operation > Delete**. Press **Enter** as a terminator and the file will be deleted immediately.

Functions and Measurements

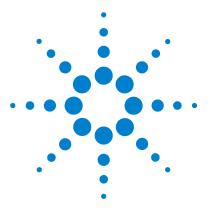

Agilent N9322C Spectrum Analyzer User's Guide

4 Key Reference

This chapter describes each front panel hardkey and their associated softkeys (menus). The front panel key descriptions are organized alphabetically. The lower level softkeys are listed as they appear in the softkey menus.



Amplitude

Press **Amplitude** hardkey to activate the reference level function and access the amplitude softkey menu. The softkey menu selections are described as follows:

Ref Level Sets the reference level. This function is activated when Amplitude is pressed. The reference level is the amplitude power or voltage represented by the top line of the graticule on the display. Setting the reference level changes the absolute amplitude level (in the selected amplitude units) of the top graticule line.

Key access: Ampiltude > Ref level

AttenuationToggles the input attenuation between Auto and Man. The
attenuation level can be set in as little as 1 dB increments
when Man is selected. The analyzer input attenuator is
normally coupled to the reference level control, it reduces
the power level of the input signal at the input mixer.
Selecting Auto re-couples the attenuator. Change the
attenuation by using the arrow keys, the knob, or the
numeric keypad.

Key access: Ampiltude > Attenuation

Preamp (Option P07) Toggles the internal pre-amplifier function
On Off between on and off. Pressing Preamp (On) results in a correction being applied to compensate for the gain of the preamp. Amplitude readings then represent the signal value at the input connector. When the preamp is on, a "PA" indication appears on the left side of the display. The preamp operates over a range of 100 kHz to 7 GHz.

Key access: Ampiltude > Preamp

Scale/Div Sets the logarithmic units per vertical graticule division on the display. The valid logarithmic units are 1, 2, 5 and 10 dB per division. The Scale/Div function is available only when the Scale Type key is set to Log.
 Kev access: Ampiltude > Scale/Div

Scale TypeScales the vertical graticule divisions in logarithmic unitsLog LinScales the vertical graticule divisions in logarithmic units are 1, 2, 5and 10 dB per division. When Lin is underlined, the vertical divisions are linearly scaled with default amplitude units of volts. The top of the graticule represents the reference-level value; the bottom of the graticule represents zero volts. (Each division is one-tenth of the reference level.)

Key access: Ampiltude > Scale Type

Y Axis Unit Accesses the softkeys that change the amplitude units (logarithmic or linear). Change the amplitude units by pressing dBm, dBmV, dBuV, dBuA, Watts, Volts, and Amps. Key access: Ampiltude > Y Axis Unit

Hi-Sensitivity Set this softkey to **On** to set 0 dB attenuation, -50 dBm reference level and turn the preamplifier on. It's very helpful to observe the low-level signals with this settings.

Key access: Ampiltude > More > Hi-Sensitivity

Ref Offset Adds an offset value which ranges from -327.6 dB to +327.6 dB, to the displayed reference level. Reference-level offsets are only entered by using the numeric keypad. Entering an offset does not affect the trace or the attenuation value. Reference-level offsets are used when gain or loss occurs between a device under test and the analyzer input. Thus, the signal level measured by the analyzer may be referred to as the level at the input of an external amplitude-conversion device. When an amplitude offset is entered, its value appears on the left side of the display under Offset (as opposed to frequency offsets which appear at the bottom of the display). To eliminate an offset, press **Ref Offset > 0 > dB**.

Key access: Ampiltude > More > Rel Offset

- **Corrections** Accesses the corrections submenu to enable the corrections function for amplitude compensation. The amplitude correction is used to compensate the gain/attenuation from antenna/cable. Please refer to the procedures below to use the amplitude correction function.
 - 1 Please refer to the procedures below to create a correction file in BSA PC software.
 - a Open the PC software.
 - **b** Press **File > New > Correction** to access the correction file editing pop-up menu.
 - **c** Refer to to add the pount data with frequency and amplitude offset value.

Figure 4-1 Editing correction file in PC software

		Frequency(Hz)	Amplitude(dB)
	1	500,000,000.00	0
	2	600,000,000.00	-2
	3	700,000,000.00	-5
	4	800,000,000.00	-8
	5	900,000,000.00	-5
	6	1,000,000,000.00	-2
*	7	1,100,000,000.00	0
		Frequency(Hz):	110000000

d When the editing is completed, press **Save/Save As** to save the correction file.

	2 Set a folder named N932xDATA in a USB disk and put the saved correction file in. Insert the USB disk on top panel for further loading.
	3 Press Amplitude > More > Corrections to acess the correction function.
	4 Press Cable/Antenna/Other/User to select the corrction type.
	5 Press Recall to load this correction fie. The correction file name will be shown on the Correction1 softkey and the Apply Corrections is set to On automatically which indicates the amplitude compensation has been applied to the displayed trace.
	Press Apply Corrections off to turn off all the corrections.
	Set Antenna Unit to On to switch to graticule unit from dBm to dBmV/m for field strength measurement.
	Key access: Ampiltude > More > Correction
Impedance 50ohm 75ohm	Toggles the computational input impedance between 500hm and 750hm. This is only software function in which sets the input impedance for unit conversions. This set affects the results when the y axis unit is voltage or current units (dBmV, dB μ V, dB μ A, V, A) but does not affect the results when it is power units (dBm, W). The selected impedance is for computational purposes only, since the actual impedance is set by internal hardware to 50 ohm.
	Key access: Amplitude > More > Impedance
PSD Function On Off	Press this softkey to turn on the power spectral density function. When it is set to On, the measurement result and amplitude parameters will be shown in power spectral density. The PSD function can only be enabled in Spectrum Analysis and Spectrum Monitor mode.
	Key access: Amplitude > More > PSD Funtion

4 **Key Reference**

BW

This hardkey activates the resolution bandwidth function and accesses the softkey menus that control the bandwidth and averaging functions.

Res BW controls the 3 dB resolution bandwidth of the analyzer from Auto Man 10 Hz to 3 MHz using the knob or arrow keys. There are four available bandwidths less than 1 KHz are 10, 30, 100 Hz or 300 Hz. If an invalid bandwidth is entered using the numeric keypad, the analyzer chooses the closest acceptable bandwidth. As the resolution bandwidth is decreased, the sweep time is modified in order to maintain amplitude accuracy. Resolution bandwidth is also coordinated with the frequency span. As the span is decreased, the resolution bandwidth decreases. When the VBW/RBW is set to AUTO, if the resolution bandwidth changes, the video bandwidth changes to maintain the VBW/RBW ratio.

> A "#" mark appears next to "Res BW" on the display when it is not coupled. To recouple the resolution bandwidth, press Res BW (Auto).

Key access: **BW** > **RBW**

Video BW changes the analyzer post-detection filter from 1 Hz to 3 Auto Man MHz using the knob or arrow keys. If an invalid bandwidth is entered, the analyzer chooses the closest available bandwidth. As the video bandwidth decreases, the sweep time will increase to maintain amplitude accuracy. A "#" mark appears next to "VBW" on the bottom of the analyzer display when it is not coupled. To couple the video


bandwidth, press Video BW (Auto).

Kev access: **BW > VBW**

VBW/RBW Sets the ratio between the video and resolution bandwidths. Auto Man When a signal is weak and is visually masked by the noise floor, set the ratio to less than 1 to lower the noise. When the Preset Type is set to Factory and Preset is pressed, the ratio is set to 1. Change the ratio by using the arrow keys,

knob, or numeric keypad. When **VBW/RBW (Auto)** is selected, the ratio is determined automatically by the rules in Figure 4-1.

Figure 4-1 VBW/RBW Ratio Auto Rules

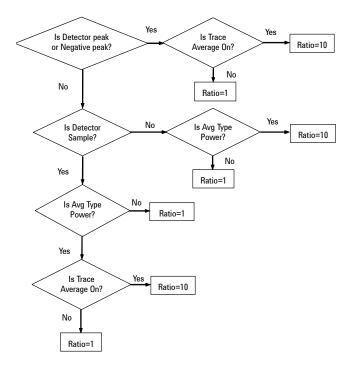

Key access: **BW > VBW/RBW**

Average Type Chooses one of the following averaging scales: log power (video), power (RMS), or voltage averaging. When trace average is on, the average type is shown on the left side of the display. Selecting an average type manually causes the analyzer to use that type without regard to other analyzer settings.

Key access: **BW > Average Type**

- **Voltage** Selects the logarithmic (decibel) scale for all filtering and averaging processes. This scale is "Video" because it is the most common display and analysis scale for the video signal within a spectrum analyzer. This scale is excellent for finding CW signals near noise. When this type of averaging is selected, LgAv appears on the left side of the display.
- **Power** In this average type, all filtering and averaging processes work on the power (the square of the magnitude) of the signal, instead of its log or envelope voltage. This scale is best for measuring the true time power of complex signals. When this type of averaging is selected, PAvg appears on the left side of the display.
- **Log Pwr** In this Average type, all filtering and averaging processes work on the voltage of the envelope of the signal. This scale is good for observing rise and fall behavior of AM or pulse-modulated signals such as radar and TDMA transmitters. When this type of averaging is selected, VAvg appears on the left side of the display.

There are actually four types of averaging processes within a N9322C. All, except VBW filtering, are affected by this setting. They are listed as follows:

Trace averaging

Averages signal amplitudes on a trace-to-trace basis. (Press **Log Pwr** or **Pwr**)

Average detector

Averages signal amplitudes during the time or frequency interval and represents the result as a single measurement point.

Noise marker

Averages signal amplitudes across measurement points to reduce variations for noisy signals.

VBW filtering

Performs a form of averaging of video signal.

Display

Press **Shift > Disp** to control detector and display functions.

Graticule Press this softkey to turn on the graticule display for the trace.

Key access: **Shift > Disp**

Y Scale Press this softkey to turn on the amplitude scale unit display on the left of the graticule. The unit is determined by the **Y Axis Unit** softkey.

Key access: **Shift > Disp**

Display Line Activates an adjustable horizontal line that is used as a visual reference line. The display line, used for trace arithmetic, has amplitude values that correspond to its vertical position when compared to the reference level. The value of the display line appears in both the active function block and on the softkey. The arrow keys, knob, or numeric keypad may be used to adjust the display line. Pressing any digit, 0 through 9, on the numeric keypad brings up the selected terminator menu. To deactivate the limit line, press **Display Line (Off)**

4 Key Reference

Enter

Terminates a front-panel keypad numeric entry and enters that value into the analyzer. (For most applications, it is better to use the units softkeys to terminate value entry.) When in **File** menu, the **Enter** key is used to terminate filename entries.

When the analyzer is in the remote mode, pressing **Enter** returns the analyzer to the local control mode and enables front-panel inputs.

ESC <-

This hardkey provides mainly two types of functions:

Clear

- Clears any numeric entry and cancels the active function.
- Clears any title entry and cause the title to revert to the previous name.
- Clears input or output overloads
- Clears error messages from the status line along the bottom of the display.

Association with other functions

Provides a permitted setting for triggering other functions such as:

- Activates LIMIT function for pass/fail judgements.
- Activates SAVE function for current trace saving.

CAUTION

When pressing [**ESC**<-], the current parameter annotation in the lower left corner, which is an indicator of available settings of **Limit** and **Save**, disappears.

Frequency

	The hardkey activate the center frequency function, and access the menu softkeys for frequency functions. The center frequency, or start and stop frequency values appear below the graticule on the display.
NOTE	When changing both the center frequency and span, change the frequency first. The frequency value may limit the span.
Auto Tune	performs the following functions automatically: 1 Run Peak Search in full span
	2 Run Mkr -> CF
	3 Select the appropriate reference level according to the amplitude of searching signal.
	4 Set span to 1 MHz and all auto couple to view the signal.
NOTE	The Auto Tune functions in the frequency range of 5 MHz to 7 GHz. The minimum detectable amplitude is –65 dBm.
	For more information about Peak Search , refer to "Peak Search" on page 148.
	Key access: Frequency > Auto Tune
Center Freq	activates the center frequency function and sets the horizontal center of the display to a specific frequency. Key access: Frequency > Center Freq
Start Freq	sets the frequency starting at the left side of the graticule. The left and right sides of the graticule correspond to the start and stop frequencies. Key access: Frequency > Start Freq
Stop Freq	sets the frequency at the right side of the graticule. The left and right sides of the graticule correspond to the start and stop frequencies.
	Key access: Frequency > Stop Freq

- CF Stepchanges the step size for the center frequency function. On
selecting a step size and activating the center frequency
function, the arrow keys change center the frequency by the
step-size value. The step size function is useful for finding
harmonics and sidebands beyond the current frequency span
of the analyzer. Selecting auto-couple sets the center
frequency step size to one division (10 percent of the span).
Key access: Frequency > CF Step
- **Channel Std.** The Channel Standard softkey is a shortcut to loada factory-preset standard file (*.STD) which is located in system memory as default. The standard file list includes most communication protocol standards which is used in several countries. Please refer to "Loading a file" on page 72 for how to recall a file.

Key access: Frequency > Channel Std.

Freq Offset inputs a frequency offset value added to the frequency readout of the marker, to account for frequency co versions external to the analyzer. Offset entries are added to all frequency readouts including marker, start frequency, and stop frequency. Offsets may only be entered using the numeric keypad. Offsets are not added to the span or frequency count readouts. Entering an offset does not affect the trace display. When a frequency offset is entered, its value appears on the bottom of the display. To eliminate an offset, perform a **Factory Preset**, or press **Freq Offset**, **0**, **Hz**.

When a frequency offset is entered, its value appears on the bottom of the display (as opposed to reference level offsets, which appear on the left side of the display). To eliminate an offset, press **Freq Offset**, **0**, and **Enter**. Pressing **Preset** also sets the offset to zero.

Key access: Frequency > CF Step

Low Frequency
ChannelThis softkey toggles the baseband channel on and off. When
it is set to On, the SSB and DANL performance will be
better from 3 kHz to 12 MHz. This softkey is only visible
when the option BB1 has been installed and only available
in Spectrum Analysis, Spectrum Monitor mode.

Key access: Frequency > CF Step

4 Key Reference

Marker

This hardkey accesses the marker control softkeys to select the type and number of markers. Markers are diamond-shaped characters that identify points of traces. Up to six pairs of markers may appear on the display simultaneously; only one pair can be controlled at a time. The marker that is controlled is called the "active" marker. Pressing **MARKER** activates the Normal menu key.

Marker Selects one of the twelve possible markers. If a marker has already been selected it will become the active marker. Key access: **Marker > Slect Marke**

Marker TracePlaces a marker on the selected trace, if no markers have
been previously turned on. If a marker is currently active,
press Marker Trace until 1, 2, 3, or 4 is underlined: the active
marker moves to the selected trace.

Selecting **Auto** mode moves the marker to the automatically selected trace. The trace selection will search for the lowest numbered trace in the following mode order: **Clear-write**, **Max-hold**, **Min-hold and View**. If there are no traces in any of these modes, it selects trace **1**.

Key access: Marker > Marker Trace

Mode Normal Activates a single frequency marker at the center of the active trace if not already displayed.

Displaying a marker before enabling the **Normal** function enables the marker at the position of the selected marker. The marker number shows above the marker. The knob and/or arrow keys move the marker left or right. Entering a value from the numeric keypad moves the marker to the trace point nearest to that value. Annotation in the active function block and in the upper-right corner indicates the frequency and amplitude of the marker (time and amplitude, if in zero span.) Pressing **Normal** turns off the **Delta** function and moves the active marker to the delta marker position. Key access: **Marker > Mode > Normal** **Delta** activates a second marker at the position of the first marker. If no marker is present, two markers with the same identification number will appear at the center of the display. The marker number is indicated above the delta marker, and the same number is indicated with an R (for example, 1R) above the reference marker. The amplitude and frequency (or time) of the first marker is fixed. Use the data control keys to position the delta marker. Annotation in the active function block and in the upper-right corner indicates the differences between the two markers, frequency/time and amplitude.

Key access: Marker > Mode > Delta

Delta Pair Toggles the **Delta Pair** between the reference (start) and delta (stop) markers. The start marker number is indicated with a number and an R (reference) above the marker (for example, 1R). The delta marker is identified with the marker number only.

Key access: Marker > Mode > Delta Pair

Span Pair Toggles the **Span Pair** function between the span and center markers. The start marker number is indicated with a number and an R above the marker (such as 1R) and the stop marker is indicated with only the marker number. Adjusting the span changes the frequency difference between the two markers while maintaining the midpoint at a fixed frequency. Selecting **Center** changes the center point between the two markers while maintaining the frequency difference.

Key access: Marker > Mode > Span Pair

NOTE	Ref and Delta markers maintain their displayed x-axis location. But,
NUL	the frequency values will change if the frequency or span parameters
	define the x-axis scale are changed. Reset these markers, if necessary,
	when parameters such as span or center freq are changed.

Off Turns off the active function markers. Key access: **Marker > Mode > Off** **Marker To** Accesses the following marker function menu keys:

To Center Sets the center frequency of the analyzer to the marker frequency. In Delta mode, this softkey sets the center frequency to the marker delta value. The function is not available in zero span.

To Start Changes the start frequency so that it is equal to the frequency of the active marker. In Delta mode, this softkey sets the start frequency to the marker delta value. To Start is not available in zero span.

To Stop Changes the start frequency so that it is equal to the frequency of the active marker. In Delta mode, this softkey sets the stop frequency to the marker delta value. To Stop is not available in zero span.

To Reference Changes the reference level to the active marker value, moving the marked point to the reference level (top line of the graticule). In Delta mode, this softkey sets the reference level to the amplitude difference between the markers.

Key access: Marker > Marker To

Function Accesses the marker function softkeys listed below.

Normal Activates the default readout mode. This function is set to default marker function.

Counter Activates a frequency counter mode.

Noise Activates a noise readout mode for evaluating power density.

Band Power Indicates the power over that part of the trace between the reference and active markers.

Demod Activates the demodulation mode.

Demod Setting Accesses the menu keys to select AM demodulation, FM demodulation or demodulation Off. It also accesses the Speaker Vol, and Delay Time menu keys described below.

Key access: Marker > Function

- Marker TableCompresses the graticule and displays marker information in
a table. The information includes the marker number, trace
number, marker type, X axis value, and the amplitude.
Key access: Marker > Marker Table
 - **Read Out** Accesses the following menu keys that allow you to change the active marker readout. This function is only available in non-zero span.

Frequency Sets the marker to Frequency. The default selection in non-zero spans, displays the absolute frequency of a normal marker or the frequency of the delta marker relative to the reference marker.

Period Sets the marker readout to **Period**. Displays the reciprocal of the above frequency.

Time Sets the marker readout to Time. The default selection in zero span, displays the time interval between a normal marker and the start of the sweep or the time of the delta marker relative to the reference marker.

Key access: Marker > More > Read Out

- **Zoom In/Out** Activates the marker zoom in/out function which triggers a series of operation as below:
 - Save current state as a backup state file.
 - Set center frequency as current marker frequency value.
 - narrow the span to 1/10 as previous span.
 - If RBW is set to Auto, the RBW will be coupled with span automatically. If RBW is set to manual, the RBW will be narrowed as 1/10.

Zoom out resumes the state before Zoom in is pressed.

Key access: Marker > More > Read Out

Delta Ref Adjusts the delta marker reference level manually. This function is exclusive when marker mode is set to delta.

Key access:	Marker >	More >	Delta Ref
-------------	----------	--------	-----------

All Off Turns off all markers, including markers used for signal track, and marker annotations.

Key access: Marker > More > All Off

LoggingPress this softkey to start recording the marker value to aStart/StopCSV file. The frequency and amplitude value of the marker
will be continuously recorded in the file.

Press this softkey (Logging Stop) again to stop logging and save the CSV file immediately.

Key access: Marker > More > Read Out

Meas

In the **Spectrum Analyzer** mode (see **MODE**), **Meas** key displays a menu for measurements such as adjacent channel power, occupied bandwidth, channel power, spectrum emission mask and TOI. Press **Measure Off** to turn the measurement off.

Channel Power

Channel Power measures the power and power spectral density in the specified channel bandwidth. A white frame on the display indicates the edge limits of the channel bandwidth. The user must specify the center frequency, reference level, and channel bandwidth to be used for the measurement.

Center Freq Sets the center frequency of display. Key access: Meas > Channel Power

Integ BW Specifies the range of integration used in calculating the power in a channel. For example, set the main (center) channel bandwidth. Note that the white frame indicates the integration bandwidth. Be sure the span is set between 1 and 10 times the integration bandwidth. Change integration bandwidth by using the knob and the arrow keys.

Key access: Meas > Channel Power

- Span Sets the sweep span of display. Key access: Meas > Channel Power
- **Span Power** Set the integrated bandwidth to the sweep span of display. The channel power and power spectral density display on the screen simultaneously.

Key access: Meas > Channel Power

4 Key Reference

Disp Mode	This softkey toggles the display mode bwteen chart and Meter .
	Key access: Meas > Channel Power

Disp ModeThis softkey is only avaiable when the display mode is set to
Meter. Pressing Auto Range toggles the display mode bwteen
On and Off. When Auto Range is set to off (manual), press Top
and Bottom to set the display range of the channel power
meter.

Key access: Meas > Channel Power

RRC Filter This softkey is a combined key to set the Root-Raised Cosine filter state and the filter Alpha value. When the filter is set to On, there will be an annotation "RRC ON" on the display. Key access: **Meas > Channel Power**

Filter BW Press this softkey to set the filter bandwidth of the RRC filter. The default value is 2 MHz.

Key access: **Meas > Channel Power**

Occupied BW

Occupied Bandwidth integrates the power of the displayed spectrum. The power-bandwidth routine first computes all signal power contained in the trace, then calculates the span containing the power of the specified percentage. The percentage value default is 99% of the occupied bandwidth power.

For 99% occupied power bandwidth, Markers are placed at the frequencies on either side of 99% of the power. 1% of the power is evenly distributed outside the markers. The difference between the marker frequencies is the 99% power bandwidth.

This is the main menu of occupied bandwidth measurement including all related parameters and measurement results.

The occupied bandwidth function also indicates the difference between the center frequency and the center frequency of the channel. This "Transmit Freq Error" is defined

as the difference between the $(f_1 + f_2)/2$ and the tuned center frequency of the signal.

NOTE

To get the correct measurement result, first set the center frequency, reference level, and channel spacing.

• Selecting a Method

Press MEAS > OBW > Method to toggle the occupied bandwidth measurement mode between percentage (%) and dBc.

• Setting Percentage (%)

Press **{OBW > Method > Percent** to edit the percentage of signal power used when determining the occupied bandwidth. Press **{%}** to set the percentage ranging from 10.00% to 99.99%.

• Setting dBc

Press $\{0BW\} > \{Method\} > \{dBc\}$ to specify the power level used to determine the emission bandwidth as the number of dB down from the highest signal peak, within the occupied bandwidth span. This function is an independent calculation from the OBW calculation. The x dB bandwidth result is also called the emissions bandwidth (EBW). This sets the green frame (f1 and f2 are the two cross points of the signal and the pair of vertical lines of the displayed green frame) to your specified dB value below the maximum power, and compute the total power in the frame. The emission bandwidth is then calculated ranging from 0.1 dB to 100 dB (the default value is set to 26 dB).

ACPR

	Adjacent Channel Power Ratio (ACPR) measures the power present in adjacent transmit channels. The span is automatically set according to the six available offsets and their associated integration bandwidths as defined by the user.
Center Freq	Sets the center frequency of the main channel power. Key access: Meas > ACP
Main Channel	Specifies the range of integration used in calculating the power in the main channel. Use the knob, the arrow keys, or the numeric keypad to set the bandwidth. Key access: Meas > ACP
Adjacent Chn State	Press Adjacent Chn to choose the number of the adjacent channel. There are optional 6 adjacent channels. Press adjacent Chn State to turn on/off each adjacent channel power display. Key access: Meas > ACP
Adjacent Channel BW	Specifies the range of integration used in calculating the power in the adjacent channel. Use the knob, the arrow keys, or the numeric keypad to set the bandwidth. Key access: Meas > ACP
Adj Chn Space	Sets the space value between the center frequency of main channel power and that of the adjacent channel power. Key access: Meas > ACP
RRC Filter	This softkey is a combined key to set the Root-Raised Cosine filter state and the filter Alpha value. When the filter is set to On, there will be an annotation "RRC ON" on the display. Key access: Meas > ACP
Filter BW	Press this softkey to set the filter bandwidth of the RRC filter. The default value is the integrated bandwidth. Key access: Meas > ACP

Spectrum Emission Mask

Spectrum Emission Mask measurement includes the in-band and out-of-band spurious emissions. As it applies to W-CDMA (3GPP), this is the power contained in a specified frequency bandwidth at certain offsets relative to the total carrier power. It may also be expressed as a ratio of power spectral densities between the carrier and the specified offset frequency band. For WLAN, the reference power is taken as the peak PSD in the signal, and all offset results are also the peak PSD in that offset as opposed to the integrated power.

- Avg NumberSet Avg Number to On to specify the number of measurement
averages used when calculating the measurement result. The
average will be displayed at the end of each sweep. Setting
Avg Number to Off disables measurement averaging.
Key access: Meas > SEM
 - Meas Type Displays a menu to select a measurement reference type, Total Pwr Ref or PSD Ref.

Key access: Meas > SEM

- **Total Pwr Ref** When **Total Pwr Ref** is selected, the power in the carrier is used as the reference in computing the relative power values for the offsets.
- **PSD Ref** When **PSD Ref** is selected, the mean power spectral density of the carrier is used in computing the relative power spectral density values for the offsets.
- Ref Channel
 Accesses the softkeys to change the reference channel settings.

 Key access: Meas > SEM
 Chan Integ BW

 Specifies the integration bandwidth used in
 - calculating the power in the main channel.
 - **Chan Span** Specifies the span used in measuring the power in the main channel.

Sweep Time Auto Man	Specifies the sweep time used in measuring the power in the main channel.
Res BW Auto Man	Specifies the resolution bandwidth used in measuring and the power in the main channel.
Total Pwr Ref (PSD Ref) Auto Man	Displays the type of power measurement reference selected by Measure Type . Total Pwr Ref is the power in the carrier that is used as the reference in computing the relative power values for the offsets. When Man is selected, this can be set by the user. When Auto is selected, this is the measured power in the reference carrier. PSD Ref is the mean power spectral density in the carrier that is used as the reference in computing the relative power spectral density values for the offsets. When Man is selected, this can be set by the user. When Auto is selected, this is the measured mean power spectral density in the reference carrier. Key access: Meas > Spectrum Emission Mask > Ref Channel

Offset/Limits Displays the menus to change the following parameters for offset frequency settings and pass/fail tests: **Offset**, **Start Freq**, **Stop Freq**, **Sweep Time**, **Res BW**, and **Limits**. Refer to the tables below for default settings of particular radio standards of interest.

Key access: Meas > Spectrum Emission Mask

Offset	Start Freq (MHz)	Stop Freq (MHz)	Res BW (kHz)	Abs Start (dBm)	Abs Stop (dBm)	Abs Couple	Rel Start (dBc)	Rel Stop (dBc)	Meas BW
A. On	2.515	2.715	30.00	-14.00	-14.00	Couple	-30.00	-30.00	1
B. On	2.715	3.515	30.00	-14.00	-26.00	Man	-30.00	-30.00	1
C. On	3.515	4.000	30.00	-26.00	-26.00	Couple	-30.00	-30.00	1
D. On	4.000	8.000	1000.00 30.00	-13.00	-13.00	Couple	-30.00	-30.00	1 33
E. On	8.000	12.500	1000.00	-13.00	-13.00	Couple	-30.00	-30.00	1

Table 4-1 Offsets & Limits Defaulted for W-CDMA (3GPP) Base Station Measurements^a

a. Fail Mask is set to Absolute and Rel Stop is set to Couple.

Table 4-2 Offsets & Limits Defaulted for W-CDMA (3GPP) Mobile Station Measurements^a

Offset	Start Freq (MHz)	Stop Freq (MHz)	Res BW (kHz)	Abs Start (dBm)	Abs Stop (dBm)	Rel Couple	Rel Start (dBc)	Rel Stop (dBc)	Meas BW
A. On	2.515	3.485	30.00	-71.07	-71.07	Man	-35.23	-49.78	1
B. On	4.000	7.500	1000.0	-55.84	-55.84	Man	-35.50	-39.00	1
C. On	7.500	8.500	1000.00	-55.84	-55.84	Man	-39.00	-49.00	1
D. On	8.500	12.000	1000.00	-55.84	-55.84	Couple	-49.00	-49.00	1
E. Off	12.500	15.000	1000.00	-55.84	-55.84	Couple	-49.00	-49.00	1

a. Abs Stop is set to Couple and Fail Mask is set to Abs AND Rel.

Offset	Start Freq (MHz)	Stop Freq (MHz)	Abs Start (dBm)	Abs Stop (dBm)	Abs Couple	Rel Start (dBc)	Rel Stop (dBc)	Rel Couple	Meas BW
A. On	9.00	11.00	16.00	-4.00	Man	0.00	-20.00	Man	1
B. On	11.00	20.00	-4.00	-12.00	Man	-20.00	-28.00	Man	1
C. On	20.00	30.00	-12.00	-24.00	Man	-28.00	-40.00	Man	1
D. On	30.00	50.00	-24.00	-24.00	Couple	-40.00	-40.00	Couple	1
E. Off	50.00	100.00	-24.00	-24.00	Couple	-40.00	-40.00	Couple	1

Table 4-3 Offsets & Limits Defaulted for 802.11a and HiperLAN/2 Radio Standards^a

a. Res BW is set to 100 kHz and Fail Mask is set to Rel.

Table 4-4 Offsets & Limits Defaulted for 802.11b Radio Standard^a

Offset	Start Freq (MHz)	Stop Freq (MHz)	Abs Start (dBm)	Abs Stop (dBm)	Rel Start (dBc)	Rel Stop (dBc)	Meas BW
A. On	11.00	22.00	-10.00	-10.00	-30.00	-30.00	1
B. On	22.00	50.00	-30.00	-30.00	-50.00	-50.00	1
C. Off	50.00	70.00	-30.00	-30.00	-50.00	-50.00	1
D. Off	70.00	90.00	-30.00	-30.00	-50.00	-50.00	1
E. Off	90.00	100.00	-30.00	-30.00	-50.00	-50.00	1

a. Res BW is set to 100 kHz, Fail Mask is set to Rel, and Abs Stop and Rel Stop are both set to Couple.

OffsetSelect the offset pairs (upper and lower) that the softkeys
will affect, and displays the memory selection menu from A
to E (the analyzer can store up to 5 sets of values for Start
Freq, Stop Freq, Sweep Time, Res BW, Meas BW, Abs Start, Abs
Stop, etc.). Press Offset to select the letter of the desired
offset is underlined. Only one selection at a time is shown on
this key label.

Key access: Meas > SEM > Offset/Limits

Start Freq On Off	Specifies the inner limit (frequency closest to the carrier) for both segments of the specified offset pair. When Start Freq (Off) is selected, the offset pair is not measured. Key access: Meas > SEM > Offset/Limits
Stop Freq	Specifies the outer limit (frequency furthest from the carrier) for both segments of the specified offset pair. The minimum frequency difference between Start Freq and Stop Freq is limited to 100 Hz. Key access: Meas > SEM > Offset/Limits
Sweep Time Auto Man	Specifies the sweep time for the currently selected offset, and toggles this function between Auto and Manual for each offset. Key access: Meas > SEM > Offset/Limits
Res BW Auto Man	Specifies the resolution bandwidth used in measuring the offset pair. When set to Auto , the Res BW are used. When set to Man , the allowed range is 1 kHz to 1MHz. Key access: Meas > SEM > Offset/Limits
Abs Start	To enter an absolute level limit at Start Freq for the currently selected offset ranging from -200.00 to +50.00 dBm with 4 significant digits. Key access: Meas > SEM > Offset/Limits > More
Abs Stop Couple Man	To enter an absolute level limit at Stop Freq for the currently selected offset ranging from -200.00 to +50.00 dBm with 4 significant digits, and to toggle this function between Couple and Man . If set to Couple , this is coupled to Abs Start to make a flat limit line. If set to Man , Abs Start and Abs Stop the user can enter different values to make a sloped limit line. Key access: Meas > SEM > Offset/Limits > More
Rel Start	Enters a relative level limit at Start Freq ranging from -150.00 to +50.00 dBc with 4 significant digits. Key access: Meas > SEM > Offset/Limits > More

Rel Stop Couple Man	Enters a relative level limit at Stop Freq ranging from -150.00 to +50.00 dBc with 4 significant digits, and to toggle this function between Couple and Man . If set to Couple , this is coupled to Rel Start to make a flat limit line. If set to Man , Rel Start and Rel Stop the user can enter different values to make a sloped limit line. Key access: Meas > SEM > Offset/Limits > More	
Fail Mask	Displays the menu to select one of the following logic keys for fail conditions between the measurement results and the test limits: Absolute, Relative, Abs AND Rel, and Abs OR Rel. Key access: Meas > SEM > Offset/Limits > More > More	
	Absolute	Sets the limit test to show Fail if one offset is larger than the corresponding limit for Abs Start and/or Abs Stop . This is the default selection for each offset for BTS measurements.
	Relative	Sets the limit test to show Fail if one offsets spectrum emission mask measurement results is larger than the corresponding limit for Rel Start and/or Rel Stop .
	Abs AND Re	I Set the limit test to show Fail if one offset's spectrum emission mask measurement results is larger than both the corresponding limit for Abs Start and Abs Stop and the limit for Rel Start and Rel Stop .
	Abs OR Rel	Set the limit test to show Fail if one offset's the absolute spectrum emission mask measurement results is larger than the corresponding limit for Abs Start and Abs Stop or the limit for Rel Start and Rel Stop .
Meas BW	Specifies the bandwidth to use when measuring the offset. When using the front panel, only the currently selected offset is affected. All the offsets are affected when remote control.	

is affected. All the offsets are affected when remote control. This is the multiplier applied to the resolution bandwidth to determine the bandwidth to integrate when calculating the power. Meas BW is restricted to be 1 and not changeable. Key access: **Meas > SEM > Offset/Limits > More > More**

MODE

Selects the measurement mode of your analyzer. **Spectrum Analyzer** mode is the default mode and is for general purpose measurement use.

Tracking Generator

Accesses the tracking generator functions. (Option TG3) Key access: **Mode**

Amplitude Toggles the tracking generator output between on and off. The power level can then be adjusted using the numeric keypad, arrow keys or knob. Pressing any digit, 0 through 9, on the numeric keypad brings up the selected terminator menu. The output level range is -30 dBm to 0 dBm. When Amplitude (Off) is selected, the output attenuation is set to the maximum attenuation.

Key access: Mode > Tracking Generator

CAUTION Power-level sensitive devices connected to the tracking generator output may be accidentally damaged. This is because the actual source amplitude will be greater than the amplitude indicated on the analyzer, when the power sweep function is being used. The source amplitude value is used as the starting amplitude for a power sweep. The ending amplitude for a power sweep is higher then the source amplitude value and it may actually be set to values beyond specified output levels. Therefore, exercise caution when connecting a power-level sensitive device to the tracking generator output.

Amptd StepSets the step size of the power level range of the tracking
generator. The default setting is one vertical scale division
when in a logarithmic amplitude scale.

Key access: Mode > Tracking Generator

Amptd Offset offsets the displayed power of the tracking generator. Using the amplitude offset capability of the tracking generator allows you to take system losses or gains into account, thereby displaying the actual power delivered to the device under test.

Key access: Mode > Tracking Generator

Normalize access a submenu to set the parameters as below.

Store RefCopies trace 1 into trace 3. Softkey menu Store(1->3)Ref (1->3) must be pressed before pressing
Normalize (On).

NormalizeActivates the normalize function. On eachOn Offsweep, the normalized trace (Trace 3) is
subtracted from Trace 1 and the result is added
to the normalized reference level.

The trace data is normalized with respect to the normalized reference level, even if the value of the normalized reference level is changed. This function remains in effect on all subsequent sweeps until it is turned off.

The normalize function is most useful for applying correction data to a trace while making a stimulus response measurement with a tracking generator. For example, connect the cables and a thru line, in place of the device to be measured, between the tracking generator and the analyzer input. Notice that the frequency response is not perfectly flat, showing the response of the cables, as well as the flatness of both the tracking generator and the analyzer. Now press Store Ref (1->3), Normalize (**On**). Notice that the displayed trace is now flat, or normalized. The position of the normalized trace can now be moved to a different position on the display by changing the normalized reference position. This may be useful if the device to be tested has positive gain, such as an

		amplifier. Now, replace the thru line with the device under test, and an accurate measurement of the gain or loss can be made.
	Norm Ref Lvl	Sets the level (in dB) of the normalized reference.
	Norm Ref Posn	Offsets the displayed trace without affecting the instrument gain or attenuation settings. This allows the displayed trace to be moved without decreasing measurement accuracy. The normalized reference position is indicated with a (>) character on the left side of the display and a (<) character on the right side of the display.
	Ref Trace View Blank	Allows you to view or blank the reference trace on the display.
NOTE	When in the Tracking Generator mode, resolution bandwidths < 30 kHz are not available.	

Power Meter

Press **Mode > Power Meter** to access the optional power meter functions. When this mode is selected, the power meter related softkey menu will be displayed and many of the instrument hardkeys will be disabled as they are not necessary for this mode.

Mode toggles the measurement between AVG and Peak. When it is set to AVG, the result showned in screen is the power sensor's measurement result. When it is set to Peak, the result shown in screen is the power sensor's gate measurement result.

Key access: Mode > Power Meter

Zeroing Accesses the associated Zeroing submenu.

Key access: Mode > Power Meter

Zeroing Makes a Zero operation of the power sensor.

The U2000 Series USB Power Sensors have their sensor calibration tables stored in non- volatile memory which means that the reference calibration factor is automatically loaded upon power-up.

Key access: Mode > Power Meter > Zero/Cal

- Zero Type Toggles the zeroing type of the Power Sensor between internal and external. When this type is set to EXT, pressing Zero will bring up a message which indicates the external signal need be pulled out. This setting is not affected by the preset in Power Meter menu. Key access: Mode > Power Meter > Zero/Cal
- CalibrationToggles the zeroing type of the Power Sensor
between internal and external. When this type is
set to EXT, pressing Zero will bring up a message
which indicates the external signal need be pulled
out. This setting is not affected by the preset in
Power Meter menu.
Key access: Mode > Power Meter > Zero/Cal
- **Meas Disp** Accesses the Meas Disp submenu for defining the display range and resolution while in Power Meter mode.

Key access: Mode > Power Meter

Disp	Accesses the associated Disp Range submenu.
Range	Key access: Mode > Power Meter > Meas Disp

Auto	Toggles the auto range function between		
Range	On and Off. When the Auto Range is set		
	to On, the Top and Bottom value of the power meter's display range will be set automatically according to the measurement data:		
	Top = Max. data + 0.5		
	Bottom = Min. data - 0.5		
	The default setting is Off.		
Тор	Sets the top value of the power meter' display range.		
	Range from (Bottom + 0.01) to 200 dBm.		
	The default value is 20 dBm.		

	Bottom	Sets the bottom value of the power meter' display range.
		Range from - 200 to (Top - 0.01) dBm.
		The default value is - 70 dBm.
	Accesses	the associated Resolution submenu.
1234	paramete digits. W 1 throug	e measurement suffix is W or %, this er represents the number of significant hen the measurement suffix is dB or dBm, h 4 represents 1, 0.1, 0.01, and 0.001 dB rely. The default value is 3.
	Key acce	ess: Mode > Power Meter
Gerneral Setup Accesses the power meter measurement setup submenu.		
Key access: Mode > Power Meter		
Dis Mode Meter Chart	Changes the display mode between Meter and Chart . The default mode is Meter.	
Dis Mode Meter Chart	-	
	The def	ault mode is Meter.
	The def Key acc Accesse disable	
Meter Chart	The def Key acc Accesse disabled the disp	Fault mode is Meter. Sess: Mode > Power Meter > Meas Setup Sess the Chart View submenu. This soft key is Set when the measurement is in process or if
Meter Chart	The def Key acc Accesse disabled the disp This su chart.	Cault mode is Meter. Teess: Mode > Power Meter > Meas Setup s the Chart View submenu. This soft key is d when the measurement is in process or if play mode is set to Meter.
Meter Chart	The def Key acc Accesse disabled the disp This su chart.	Fault mode is Meter. Teess: Mode > Power Meter > Meas Setup as the Chart View submenu. This soft key is a when the measurement is in process or if play mode is set to Meter. bmenu is used to view the measurement
Meter Chart	The def Key acc Accesse disabled the disp This su chart. Key acc	<pre>Fault mode is Meter. Fault mode is Meter. Fault mode > Power Meter > Meas Setup Setup</pre>

		Next View the next points of the chart.
Pause/		Continues or pauses the current measurement.
C	ontinue	When the measurement is in process, this softkey is displayed as "Pause"; when the measurement is paused, the softkey is displayed as "Continue".
		Key access: Mode > Power Meter > Meas Setup
Preset	condition	power meter softkey menu options to the preset as. For example, the upper and lower limits are set preset limit values.
	Key access: Mode > Power Meter	

Spectrum Monitor

Press **Mode > Spectrum Monitor** to access the submenu listed as below:

- Spectrogram
Run/PauseToggles the spectrogram monitoring between Run and Pause.
Key access: MODE > Spectrum Monitor
- Restart MeasResets the spectrogram display.Key access:MODE > Spectrum Monitor
- Update IntervalEnables you to set the interval of time to update data to 1
or more seconds. Or, you may set it to automatically
determine the Update Interval that provides the maximum
data collection speed.
A data sample is taken every time interval for display on the
spectrogram. Increasing the update time allows data
capturing over a longer period of time in the spectrogram.
Key access: MODE > Spectrum Monitor

Spec View	Enables you to view the details in the captured spectrogram. when the Spectrogram is running, Pressing Spec View pauses the running spectrogram.
	Press Home/End to view the first /last spectrogram in cache.
	Press Playback to playback the spectrogram process. The direction and the update interval is changeable as your need.
	Key access: MODE > Spectrum Monitor
Palette	Toggles the spectrogram color mode between full color and gray scale.
	Key access: MODE > Spectrum Monitor
Disp Mode	Allows you to set the spectrogram display mode as trace, spectrogram or both trace and spectrogram.
	Key access: MODE > Spectrum Monitor
File Logging	Accesses the submenu for spectrogram file operation. • Start/Stop Save
	This softkey allow you to start or stop the automatic save function. Once the spectrogram measurement frames reached the file size set in the File Size , a file (*.SPE or *.CSV) will be automatically saved, and the spectrogram measurement will restart.
	Key access: MODE > Spectrum Monitor
NOTE	The save process takes a few seconds to read from cache. During this period, the measurement is paused.

• Timed Setting

This submenu allows you to configure automatic time save function. You can set start date, time, stop date, time in this menu. Press **{Timed Save On}**, the analyzer will start the auto-saving function from the **Start Time**.

• File Type

Toggles the saved file type between trace and CSV.

• File Path

Allocate the path where the file is saved.

File Size

Set the number of frames for the spectrogram trace file. The allowed input range is 200 to 1500 frames.

Reflection Measurement

The reflection measurement mode provides the reflection measurement, one port cable loss and distance to fault measurement function.

Auto Scale

Press this softkey to adjust the amplitude scale automatically to include the peak and valley level in graticule.

Key access: Amplitude > Auto Scale

Calibrate

This softkey activates the calibration process for the measurement.

Key access: Frequency > Calibrate

Cal Type

This softkey toggles the calibration type between full span calibration and selected span calibration.

Full span calibration runs an open-short-load calibration across the full frequency span.

A FullSpan calibration ignores the frequency changes during measurements.

Selected span calibration performs an open-short-load calibration across a user-defined frequency span. A SelectedSpan Cal requires a re-calibration of the analyzer, after changing the measurement frequency range. Normally, the selected span should be set as close to the actual swept frequency range.

Key access: Freq > Cal Type

Run/Hold

This softkey toggles the frequency sweep between run and pause status.

Key access: Sweep > Run/Hold

Data->Mem

This softkey is used to store the active data trace into memory. The trace in memory will be refreshed in the next sweep once you press this softkey. There are three trace refresh mode for your selection:

Data Only the activated trace is viewable. The trace memory is not viewable.

Memory Only the trace in memory is viewable.

Data&Memory The trace both activated and in memory is viewable.

Key access: Trace > Data->Mem

Disp Mode

This softkey allows you to set the Y axis of the graticule as return loss, VSWR or reflection coefficient value.

Key access: Meas > Disp Mode

IIM On/Off

This softkey toggles IIM between on and off. When there is a need to measure the antenna feed line in field, there are probably some interference signals coupled into the device, which will be detected as spurs in the measurement result. When IIM is set to on, the analyzer will compensate those spurs by IIM algorithm.

Key access: Meas > IIM

AM/FM Modulation Analysis

Use the arrow keys to highlight the mode you need and press [ENTER] as a terminator. When this mode is selected, the AM/FM modulation analysis menu will be displayed.

Carrier Freq Sets the modulated carrier frequency. Key access: Mode > AM/FM Modulation Analysis

IFBW This specifies the IF bandwidth for the signal to be analyzed. The measurement accuracy will be impacted if this value isn't set precisely.

Key access: Mode > AM/FM Modulation Analysis

- EqLPF This specifies the IF bandwidth for the signal to be analyzed. The measurement accuracy will be impacted if this value isn't set precisely. Key access: Mode > AM/FM Modulation Analysis
- Filter Setup
 Accesses the Filter setup submenu for further configuration.

 Key access:
 Mode > AM/FM Modulation Analysis
 - MeasSelects the Measure Filter as Root Nyquist,FilterNyquist, and Gaussian.
 - **Ref Filter** Selects the Measure Filter as Root Nyquist, Nyquist, and Gaussian.
 - Alpha/BbT Sets the root-off factor α for Root Nyquist and Nyquist filter or BbT for Gaussian filter.
 - FilterSets the symbol numbers for the selected filter.SymbolsThe allowed value range is from 2 to 25.
 - View Accesses the submenu to select four display mode: Symbol - displays the binary symbol in full screen/window.

Waveform - displays the signal waveform.

AM Error - displays the AM error.

Eye Diagram - Displays the Eye diagram.

Key access: Mode > AM/FM Modulation Analysis

X ScaleAccesses the submenu to configure the X scale parametes:Scale/Div sets the number of symbols in one division.

Ref Value sets the starting value in term of times at the reference position.

Ref position sets the display reference position to either Left, Ctr (center), or Right. If the **Auto scale** key is set to on, these parameters are adjusted automatically according to the measurement result.

Key access: Mode > AM/FM Modulation Analysis

 $\label{eq:cale_constraint} \textbf{YScale} \quad \text{Accesses the submenu to configure the } X \text{ scale parametes:}$

Scale/Div sets the number of symbols in one division.

Ref Value sets the starting value in term of times at the reference position.

Ref position sets the display reference position to either Top, Ctr (center), or Bottom.

The **Ext Gain** is set to add the external gain to the test result. If the **Auto scale** key is set to on, these parameters are adjusted automatically according to the measurement result.

Key access: Mode > AM/FM Modulation Analysis

Meas Length Sets the number of symbols which will be used in calculating the measurement.

Key access: Mode > AM/FM Modulation Analysis > More

AverageSpecifies the display measurement result format. When theOn OffAverage Number is set to off, the column title "Average" in
numerical results view will be changed to "Current".Key access:Mode > AM/FM Modulation Analysis > More

Trigger Enables you to configure the trigger. When using a trigger source other than Free Run, the analyzer will begin a sweep only with the selected trigger conditions are met. A trigger event is defined as the point at which your trigger source signal meets the specified trigger level.

Free Run - New sweep starts as soon as possible after the current sweep ends.

RF Trigger - Activates the trigger condition that starts the next sweep if the detected RF envelope voltage rises to a level set by the RF trigger level.

Ext Rise/Fall - Activates the trigger condition that will start a sweep when the external voltage passes through 2 volts. The external trigger signal must be a 0 V to +5 V TTL signal. Sets the trigger polarity to positive/negative.

Trig Delay - Allows you to set and turn on or off a delay, during which the analyzer will wait to begin a sweep after receiving an external trigger signal.

Key access: Mode > AM/FM Modulation Analysis > More

Limits Set a limit value to warn you if the measured value exceeds the value specified here. The test reuslt will be in purple if this reslut exceeds the corresponding limit value.

Limit - Turns on/off the limit function

CarrPow Upr - Sets the carrier power upper limit

FreqDev Up/Low - Sets the frequency deviation upper/lower limit

CarrFreOff Up - Sets the carrier frequency offset upper limit

Key access: Mode > AM/FM Modulation Analysis > More

Sweep Togglese the sweep type between single and continuous in AM/FM mode. When this softkey is set to Single, press the next **Single** softkey to execute a new sweep as soon as the trigger condition is met.

Key access: Mode > AM/FM Modulation Analysis > More

Single When the analyzer is in continuous sweep mode, pressing this softkey will change the sweep setting to single sweep. It will then begin a sweep after the trigger conditions are met.

If the analyzer is already in single sweep, pressing this softkey will execute a new sweep as soon as the trigger condition is met.

If average is on pressing this softkey will halt averaging of the current value, and then continue averaging from the current count number when a single sweep function triggers.

Key access: Mode > AM/FM Modulation Analysis > More

CarrFreq Step Changes the step size for the center frequency function. Once a step size has been selected and the center frequency function is activated, the arrow keys change the center frequency by the step-size value. The step size function is useful for finding harmonics and sidebands beyond the current frequency span of the analyzer.

Key access: Mode > AM/FM Modulation Analysis > More > More

Auto CarrFreqThis function can remedy the carrier frequency deviationOn Offwhen the deviation less than symbol rate 5.

Key access: Mode > AM/FM Modulation Analysis > More > More

ASK/FSK Modulation Analysis

Use the arrow keys to highlight the mode you need and press [ENTER] as a terminator. When this mode is selected, the ASK/FSK modulation analysis menu will be displayed.

Carrier Freq Sets the modulated carrier frequency. Key access: Mode > ASK/FSK Modulation Analysis

Symbol Rate This specifies the fundamental symbol rate of the signal to be analyzed. The values should be positive. The non-positive value will be converted to 1Hz. The measurement accuracy will be impacted if this value isn't set precisely. Key access: Mode > ASK/FSK Modulation Analysis

 Filter Setup
 Accesses the Filter setup submenu for further configuration.

 Key access:
 Mode > ASK/FSK Modulation Analysis

MeasSelects the Measure Filter as Root Nyquist,FilterNyquist, and Gaussian.

Ref Filter Selects the Measure Filter as Root Nyquist, Nyquist, and Gaussian.

Alpha/BbT Sets the root-off factor α for Root Nyquist and Nyquist filter or BbT for Gaussian filter.

FilterSets the symbol numbers for the selected filter.SymbolsThe allowed value range is from 2 to 25.

 View Accesses the submenu to select four display mode: Symbol - displays the binary symbol in full screen/window.
 Waveform - displays the signal waveform.
 ASK Error - displays the ASK error.
 Eye Diagram - Displays the Eye diagram.
 Key access: Mode > ASK/FSK Modulation Analysis

X Scale	Accesses the submenu to configure the X scale parametes:
	Scale/Div sets the number of symbols in one division.
	Ref Value sets the starting value in term of times at the reference position.

Ref position sets the display reference position to either Left, Ctr (center), or Right. If the **Auto scale** key is set to on, these parameters are adjusted automatically according to the measurement result.

Key access: Mode > ASK/FSK Modulation Analysis

 $\label{eq:cale_constraint} \textbf{YScale} \quad \text{Accesses the submenu to configure the } X \text{ scale parametes:}$

Scale/Div sets the number of symbols in one division.

Ref Value sets the starting value in term of times at the reference position.

Ref position sets the display reference position to either Top, Ctr (center), or Bottom.

The **Ext Gain** is set to add the external gain to the test result. If the **Auto scale** key is set to on, these parameters are adjusted automatically according to the measurement result.

Key access: Mode > ASK/FSK Modulation Analysis

 Meas Length
 Sets the number of symbols which will be used in calculating the measurement.

 Key access:
 Mode > ASK/FSK Modulation Analysis > More

Average
On OffSpecifies the display measurement result format. When the
Average Number is set to off, the column title "Average" in
numerical results view will be changed to "Current".
Key access: Mode > ASK/FSK Modulation Analysis > More

Trigger Enables you to configure the trigger. When using a trigger source other than Free Run, the analyzer will begin a sweep only with the selected trigger conditions are met. A trigger event is defined as the point at which your trigger source signal meets the specified trigger level.

Free Run - New sweep starts as soon as possible after the current sweep ends.

RF Trigger - Activates the trigger condition that starts the next sweep if the detected RF envelope voltage rises to a level set by the RF trigger level.

Ext Rise/Fall - Activates the trigger condition that will start a sweep when the external voltage passes through 2 volts. The external trigger signal must be a 0 V to +5 V TTL signal. Sets the trigger polarity to positive/negative.

Trig Delay - Allows you to set and turn on or off a delay, during which the analyzer will wait to begin a sweep after receiving an external trigger signal.

Key access: Mode > ASK/FSK Modulation Analysis > More

Limits Set a limit value to warn you if the measured value exceeds the value specified here. The test reuslt will be in purple if this reslut exceeds the corresponding limit value.

Limit - Turns on/off the limit function

CarrPow Upr - Sets the carrier power upper limit

FreqDev Up/Low - Sets the frequency deviation upper/lower limit

CarrFreOff Up - Sets the carrier frequency offset upper limit

Key access: Mode > ASK/FSK Modulation Analysis > More

Sweep Togglese the sweep type between single and continuous in ASK/FSK mode. When this softkey is set to Single, press the next **Single** softkey to execute a new sweep as soon as the trigger condition is met.

Key access: Mode > ASK/FSK Modulation Analysis > More

Single When the analyzer is in continuous sweep mode, pressing this softkey will change the sweep setting to single sweep. It will then begin a sweep after the trigger conditions are met.

If the analyzer is already in single sweep, pressing this softkey will execute a new sweep as soon as the trigger condition is met.

If average is on pressing this softkey will halt averaging of the current value, and then continue averaging from the current count number when a single sweep function triggers.

Key access: Mode > ASK/FSK Modulation Analysis > More

CarrFreq Step Changes the step size for the center frequency function. Once a step size has been selected and the center frequency function is activated, the arrow keys change the center frequency by the step-size value. The step size function is useful for finding harmonics and sidebands beyond the current frequency span of the analyzer.

Key access: Mode > ASK/FSK Modulation Analysis > More > More

Auto CarrFreqThis function can remedy the carrier frequency deviationOn Offwhen the deviation less than symbol rate 5.

Key access: Mode > ASK/FSK Modulation Analysis > More > More

Peak Search

Places a marker on the highest peak based on the settings of the "**Peak Criteria**" on page 149.

NOTE All peak search functions ignore the L0 feed through signal. The process for determining if the Peak is the L0 feed through takes into account Start Frequency, Span, Resolution Bandwidth, Resolution Bandwidth shape factor, and Frequency Accuracy. If there is no point of inflection within the L0 feed through range, the point on the trace with maximum amplitude, that is higher in frequency than the L0 feed through, will be selected.

 Peak Search
 Performs peak search as described above.

 Key access:
 Peak Search

- Next PeakPlaces the marker on the next highest peak. The signal peak
must exceed the peak threshold value by the peak excursion
value. If there is no peak, the marker will not move.
Key access: Peak Search > Next Peak
- **Next Left PK** Moves the marker to the next peak to the left of the current marker position. The signal peak must exceed the peak threshold value by the peak excursion value. If there is no peak to the left, the marker will not move and the "No Peak Found" error message will appear on the display.

Key access: Peak Search > Next Left Peak

Next Right PKMoves the marker to the next peak to the right of the
current marker position. The signal peak must exceed the
peak threshold value by the peak excursion value. If there is
no peak to the right, the marker will not move and the "No
Peak Found" error message will appear on the display.
Key access: Peak Search > Next Right Peak

Pk-Pk SearchFinds and displays the frequency (or time, if in zero span),
and amplitude differences between the highest and lowest
trace points.Key access:**Peak Search > Pk-Pk Search**

To CenterThis is a hot key of marker to center.Key access:Peak Search > Pk-Pk Search

Continuous PkWhen Continuous Pk is on, the marker will remain on the peak
signal even if the frequency of that signal changes. The
marker will remain on that signal as long as the amplitude
of the signal does not change by more than 3 dB from one
sweep to another.

If the signal is lost, the marker will attempt to find it again and maintain on the peak. If there are other signals on screen near the same amplitude, one of them may be found instead. Signals near 0 Hz cannot be maintained effectively.

This function is intended to maintain the marker on signals with a frequency that is changing, and an amplitude that is not changing.

Key access: Peak Search > Continuous PK

Peak Table Peak Table Displays a list of up to ten signal peaks that is updated at the end of each sweep. The peaks can be sorted in order by descending amplitude or by ascending frequency. Peaks above or below the display line can be excluded from the table. The peak table function works with trace 1 only.

Exprt Table to CSV Press this softkey to save the current peak table to a CSV file for your data analysis on PC.

Key access: **Peak Search > More**

Peak CriteriaAccesses the submenu to set the criteria for peak search.Key access: Peak Search > More

Peak Excursion Sets the minimum amplitude variation of signals that the marker identifies as a peak. If a value of 10 dB is selected, the marker moves only to peaks that rise and fall more than 10 dB above the peak threshold value. When the peak excursion is 6 dB or higher,

NOTE

Two signal peaks, which are so close together that the amplitude drop between them is less than the peak-excursion value, are not recognized as two peaks. A signal peak is recognized only if it has a peak excursion drop above the noise floor, on both sides of the signal.

	the marker-peak does not recognize signals less than peak-excursion value above the noise floor. To correct this, when measuring signals near the noise floor, reduce the excursion value. To prevent the marker from identifying noise as signals, reduce the noise floor variance less than the peak-excursion value by reducing the video bandwidth or by using video averaging. Key access: Peak Search > More
Peak Threshold	Sets the minimum amplitude that the marker can identify as a peak. For example, if set to -90 dBm, the marker moves only to peaks that rise and fall more than the peak excursion above -90 dBm. Only functional when in Excursion and Threshold marker mode. Key access: Peak Search > More
Peak Type	Toggles the peak type between maximum value and minimum value. Key access: Peak Search > More

System

Pwr

	This softkey utility setti		s the submenu to set the system and
Time/Date	accesses th the time ar		nte menu keys used to set and display
	Key access:	System >	Time/Date
Language	chooses the	e 11 lang	uages for softkeys display.
	Key access:	System >	Time/Date
r on/Preset		he following softkeys for the preset settings. : System > Pwr On/Off	
	Power on DFT User Last	t analyzer recalls t Preset fu analyzer	nes the state of the analyzer when the is turned on. Power On set to Preset he analyzer settings previously with the nction. Power On set to Last recalls the settings when the analyzer is turned off ront panel power switch.
	Preset Type	Selects l	Jser or Factory preset settings.
		User	Pressing Preset recalls the analyzer settings defined by Save User Preset .
		Factory	Pressing Preset recalls the analyzer settings originally set at the factory.
		Last	Pressing Preset recalls the analyzer settings to the last time power-off.
	Save User	User Pre	e active settings of the analyzer into the eset register. To recall these settings, reset Type to User.

System Info Accesses the submenu to check the system information as below.

Key access: System > More

Show System Displays the number and description of the options installed in your analyzer. It also displays the instrument model number, product number, serial number, the date of production, etc.

Installed Options displays the installed option list.

Error History Accesses a list of the 100 most recent errors reported. The most recent error will appear at the bottom of the list. If the same error occurs continuously, that error message will not be added repeatedly to the list. Refer to "Instrument Messages" on page 167 for details.

Prev Page/	Access the previous/next page of error
Next Page	messages.
Clear Error Queue	Clears all the errors in the errors queue.

Service Accesses the submenu to set the service settings as below.

Key access: **System > More > Service**

Calibration Accesses the submenu to calibrate the time base of the analyzer, load default values for the alignment system.

Time Base by Ext	Calibrates the time base of the analyzer with external source.
Amp Alignment	Adjust the amplitude accuracy according the internal cal out signal.
CAL OUT On Off	Turns the internal amplitude reference signal on or off. When this signal is on, the RF input is disabled.

Upgrade Enables the firmware upgrade process once the USB disk with the firmware upgrade package plug connected.

Diagnostics Accesses the **Front Panel** softkey to verify the functionality of each front-panel key. The number next to each key name increments once each time the key is pressed. Rotating the knobs causes the number of pulses to be counted. Press **Return** will go back to the main menu.

Add Option Accesses the security system to enable licensing for individual options. A user may not turn off an option using this system. Once an option has been licensed for a given analyzer, it cannot be transferred to a different analyzer.

Port Setting Access the submenu to set the ports as below. Key access: System > More > Port Setting

Ip Config Toggles the IO port between **USB**, **LAN** and **GPIB**(option) for remote control.

Probe Power Provides power for high-impedance AC probes or other accessories (+15 V, -12V, 150 mA maximum). Key access: **System > More > Port**

GPIB Address sets the GPIB address (option G01 required).

4 Key Reference

Span

Accesses the span function and the submenu softkeys for span functions. Pressing **Span** changes the frequency range symmetrically about the center frequency. The frequency-span readout describes the total displayed frequency range. To determine frequency span per horizontal graticule division, divide the frequency span by 10.

Span Enter the span frequency range value. Key access: Span

Full SpanChanges the span to full span showing the full frequency
range of the analyzer.
Key access: Span

Zero Span Changes the frequency span to zero. In this mode, the current center frequency is displayed in the time domain (the x-axis is displayed in units of time), like a conventional oscilloscope.

Key access: Span

Last Span Changes the span to the previous span setting. Key access: Span

Sweep

Accesses the Sweep softkeys for selection of the sweep mode and trigger mode of the analyzer. The softkey menu selections are defined as follows:

Sweep Time
Auto ManSelects the sweep time for the analyzer to tune across the
displayed frequency span (or, in zero span, the time the
analyzer take to sweep the full screen).Inputs may be made
using the knob, the arrow keys, or numeric keypad.

In non-zero spans

When the sweep time is auto-coupled, the analyzer selects the optimum (shortest) sweep time ranging from 10 ms to 1000 s. The auto selection is determined by three measurement settings:

- Frequency Span
- The selected Resolution Bandwidth
- The selected Video Bandwidth

Note that changing one of the three factors above will change the sweep time. The sweep time is in direct ratio to frequency span and is in reverse ratio to the selected resolution bandwidth and video bandwidth when auto-coupled.

CAUTION

With sweep time set to a value less than the minimum auto-coupled value, an annotation "Data out of range" appears in the active function block and the sweep time is automatically converted to the minimum auto-coupled value.

In zero span

Auto-coupled does not function when in a zero span. The sweep time can only be set manually. The sweep time is selectable from 6 s to 200 s in zero span.

In FFT Mode

In FFT mode, the sweep time default is auto-coupled. The submenu, sweep time is invalid in FFT mode.

Key access: Sweep

SweepPressing Sweep Single puts the analyzer in single-sweepSingle Contmode. Press Sweep Single to initiate a sweep when in
single-sweep mode. Press Sweep Cont Performs one sweep
after another as soon as it is triggered. Pressing Preset
(When Preset Type is set to Factory) sets the sweep mode to
continuous sweep.

Key access: Sweep

Single SweepWhen the analyzer is in continuous sweep mode and not in
a measurement mode (MEAS > Measure Off), pressing Sweep >
Single Sweep will change the sweep setting to single sweep. It
will then begin a sweep after the trigger conditions are met.
If the analyzer is already in single sweep, pressing Sweep >
Single Sweep will execute a new sweep as soon as the trigger
condition is met.

If average is on (TRACE > More > Average Number On), pressing Sweep > Single Sweep will halt averaging of the current value, and then continue averaging from the current count number when a single sweep function triggers.

Key access: Sweep

Trigger Accesses the menu of keys that allow you to select the trigger mode of the analyzer. This softkey is only available in zero span.

Free Run New sweep starts as soon as possible after the current sweep ends.

Video Activates the trigger condition that starts the next sweep if the detected RF envelope voltage rises to a level set by the video trigger level. When **Video** is pressed, a line appears on the display. The analyzer triggers when the input

signal exceeds the trigger level at the left edge of the display. Change the trigger level by using the arrow keys, the knob, or the numeric keypad.

NOTE This function is not available when the Resolution Bandwidth is less than 1 kHz. Selecting a Resolution Bandwidth less than 1 kHz while in Video Trigger mode, changes the Trigger mode to Free Run.

External Activates the trigger condition that will start a sweep when the external voltage (connected to **EXT TRG IN** on the rear panel) passes through approximately 2 volts. The external trigger signal must be a 0 V to +5 V TTL signal.

Key access: Trace > More

Gated Sweep The analyzer provides two sweep time rules to meet the different sweep time requirements:

Gate View

Toggles the Sweep type between Sweep and FFT mode. The default setting is sweep mode.

View SweepTime

Toggles the Sweep type between Sweep and FFT mode. The default setting is sweep mode.

Gate Delay

Toggles the Sweep type between Sweep and FFT mode. The default setting is sweep mode.

Gate Length

Toggles the Sweep type between Sweep and FFT mode. The default setting is sweep mode.

Gate Source

Toggles the Sweep type between Sweep and FFT mode. The default setting is sweep mode.

Swp Time Rule	The analyzer provides two sweep time rules to meet the
	different sweep time requirements:

• Speed

Activates the default fast sweep time rule.

• Accuracy

Activates the normal sweep time rule to ensure the measurement accuracy.

Speed sweep time rule provides a fast measurement function that decreases the sweep time. Using Fast Sweep will decrease the measurement accuracy.

Key access: Sweep > Sweep Setup

Sweep TypeThis softkey toggles the Sweep Type between swept modeSwept FFTand FFT mode. This FFT mode is only available when RBWis set to 1 kHz, 3 kHz, or 10 kHz.

Key access: Sweep > Sweep Setup

Limit

Limits Accesses softkeys that allow you to control and define the parameters of limit lines.

Key access: Shift > Limit

- Limit 1 selects either of the available limits. The Limit 1 and
- Limit 2 Limit 2 keys access softkeys to set parameters for the selected limit.

Key access: **Shift > Limit**

Typedefines the limit to be edited as an upperUpper loweror lower limit. An upper limit will
indicate a fail if trace 1 exceeds this limit.
A lower limit will indicate a fail if trace 1
falls below the limit.
Key access: Shift > Limit > Limit 1/2LimitToggles the limit line function to on or

On Off off. The limit line function to on or limit function can be turned on. Either **Limit** or **Margin**, as well as **Test**, must be turned on for a limit test. Limit points must be defined before the Limit function can be turned on.

Key access: Shift > Limit > Limit 1/2

Test On Off	Toggles the testing of the limit lines between on and off. If trace 1 is at or within the bounds of the set limit or margin, "Limit_# Pass" or "Margin_# Pass" is displayed in the upper left corner of the measurement area limit line. Only positive/negative margins are allowed for lower/upper limits. If the trace is out of the limit or margin boundaries, "Limit_# Failed" or "Margin_# Failed" is displayed. Either Limit or Margin must be turned on for test.
	Key access: Shift > Limit > Limit 1/2
Margin On Off	Toggles the margin function to on or off. Use Margin to set a limit line offset for the selected limit line. Either Limit or Margin as well as Test , must be turned on for a limit test to work. Key access: Shift > Limit > Limit 1/2
Edit	Accesses the submenu to edit the limit point, and also accesses the limits table. Use arrow keys to move between the rows in the limits table. New limit segments will only be applied after close the editor. Pressing Return , or any key not associated with the editor, will close the editor.
	Key access: Shift > Limit > Limit 1/2
	Point
	Creates or edit a limit point. Up to 20 points can be defined for each limit line. Enter the point number using the numeric keypad, then Press [Enter], or use the knob or arrow keys to move to an existing point.

Key access: Shift > Limit > Limit 1/2 > Edit

Frequency

Edits the frequency value for a limit point. After editing, the limit table will place the frequency or time in correct order. For a new point, the **Amplitude** default is 0 dBm, and **Connected** default is **Yes**.

Key access: Shift > Limit > Limit 1/2 > Edit

Amplitude

Sets the amplitude value for the current point. Key access: Shift > Limit > Limit 1/2 > Edit

 $\operatorname{Rey access. } \operatorname{Sint} \geq \operatorname{Linit} \geq \operatorname{Linit} 1/2 \geq \mathsf{L}$

Connected To Previous Pt Yes No

Defines if the current point being edited is to be connected to the previous point. Pressing this key toggles the **Connected** value between **Yes** and **No**. Key access: **Shift > Limit 1/2 > Edit**

Delete Point

Deletes the current point in the limit line. Pressing this key will delete the point immediately. Key access: Shift > Limit > Limit 1/2 > Edit

Delete LimitDeletes the current limit set. Pressing this
key will delete the limit line entirely.
Key access: Shift > Limit > Limit 1/2

DeletePurges data from the limit-line tables. Pressing this keyAll Limitswill delete all the limit line data immediately.
Key access: Shift > Limit

4 Key Reference

Trace

Accesses the trace keys to store and manipulate trace information. Each trace consists of a series of points in which amplitude data is stored. The analyzer updates the information for any active trace with each sweep.

- **Trace** Selects the trace for current use.
- 1234 Key access: Trace/Det > Trace 1234
- **Clear Write** Erases any data previously stored in the selected trace, then continuously displays any signals during each sweep of the analyzer. This function is activated for trace 1 at power-on and **Factory Preset**.

Key access: Trace/Det > Clear Write

- Max HoldRetains the maximum level for each trace point of the
selected trace. Updates the trace point value if a new
maximum level is detected in successive sweeps.
Key access: Trace/Det > Max Hold
- **Min Hold** Retains the minimum level for each trace point of the selected trace. Updates each minimum trace point if a new minimum level is detected in following sweeps.

Key access: Trace/Det > Min Hold

View Holds and displays the amplitude data of the selected trace. The trace register is not updated as the analyzer sweeps. press **View** to retrieve a stored trace previously deactivated by pressing **Blank**.

Key access: Trace/Det > View

Blank Stores the amplitude data for the selected trace, then removes the trace from the display. The selected trace register no longer updates as the analyzer sweeps. To activate this function for traces 2, 3 and 4 at power-on press Preset (when Preset Type is set to Factory and Factory Def).

Key access: Trace/Det > Blank

Detector Softkey presents a submenu to select a specific detector (detector type) type, or allows the analyzer to select the appropriate detector for a particular measurement.

Regarding detectors, it is important to understand what is a trace "bucket". For every trace point displayed, there is a finite time during which the data for that point is collected. The analyzer looks at all of the data collected during that time and present a single point of trace data based on the detector mode. The interval during which the data for that trace point is being collected, is called the "bucket".

Thus a trace is more than a series of single points. It is actually a series of trace "buckets". The data may be sampled many times within each bucket.

- Average displays the power average in the bucket.
- **Sample** displays the instantaneous level of the signal at the center of the bucket represented by each display point.
- **Positive Peak** displays the max. of the signal in the bucket.
- Negative Peak displays the min. of the signal in the bucket.

The detector in use is indicated on the left side of the display. A "#" will appear next to it if the detector has been manually selected.

Key access: **Shift > Dsip > More**

Positive Peak	Obtains the maximum video signal between the last display point and the present display point and stores this value in memory. It's used primarily when measuring sinusoidal components. When Positive Peak is selected, "Peak" appears in the upper-left corner.
Negative Peak	Is a peak detector, but selects the minimum video signal value. This detection should not be used to measure the accurate amplitude. "NPk" also appears in the upper-left corner, When Negative Peak is selected.

	Average	measures the average value of the amplitude across each trace interval (bucket). When Average is selected, "Avg" appears on the left corner.
	Sample	Sample detection is used primarily to display noise or noise-like signals. It should not be used to measure the accurate amplitude of non noise-like signals. In sample mode, the instantaneous signal value of the present display point is placed in memory. When Sample detection is selected, "Samp" appears in the upper-left corner of the display.
	Normal	Selects the maximum and minimum video signal values alternately. When selecting Normal detection, "Norm" appears in the upper-left corner.
Average Number On Off	Initiates a digital averaging routine that averages the trace points in a number of successive sweeps resulting in trace "smoothing". The number of sweeps (average number) is changeable when setting Average (Off) . Increasing the average number will further smooth the trace. pressing BW > Avg Type to select the type of averaging.	
	To restart averaging:	
	• Enter a new average number	
	-	ny related parameter (e.g., Center Frequency)
		the sweep stops and an average trace displayed.
	averages is new sweep old average	ntinuous sweep mode, the specified number of taken, then the averaging continues with each averaged in with a weight of $\frac{1}{AverageNumber}$ and the reduced by multiplying it by
	averages is new sweep old average AverageNumber	taken, then the averaging continues with each averaged in with a weight of $\frac{1}{AverageNumber}$ and the

To turn averaging off, press Average Number (Off).

Key access: Trace/Det > More > Average Number On/Off

Average Dura.Initiates a digital averaging routine that averages the trace
points in an average duration resulting in trace "smoothing".
Increasing the average duration will further smooth the
trace.

The average is restarted when any of the following occurs:

- A new average duration is entered.
- Any related parameter (e.g., center frequency) is changed.
- {Avg Restart} is pressed

Press Average Dura. (Off) to turn off averaging.

Key access: Trace/Det > More > Average Number On/Off

Trace Math This softkey provides a submenu for the traces operation.

Key access: Trace/Det > More > More > Trace Math

Variable A, B, C Press those softkeys to select a trace (for variable A, B, and C) or a display line (for variable A and B) for the trace calculation.

A-B->C Turn this softkey on to calculate variable A minus variable B. The result will display as variable C when all the variables is set to on. This function and A+B->C can not be set to on simultaneously.

A+B->C Turn this softkey on to calculate variable A plus variable B. The result will display as variable C when all the variables is set to on. This function and **A-B->C** can not be set to on simultaneously.

Math By This softkey toggles the caculation type between power and logarithmic power. When it is set to **power**, the variable A and B will be calculated in power and the result variable C will display in converted logarithmic power. When it is set to **log power**, the variable A and B will be calculated in lograithmic power and the result variable C will display in logarithmic power.

4 Key Reference



Agilent N9322C Spectrum Analyzer User's Guide

Instrument Messages

Overview 168 Command Errors 169 Execution Conflict 171 Device-Specific Errors 173



Agilent Technologies

5 Instrument Messages

Overview

If an improper operation occurs during the instrument configuration, a message will appear on the status line indicating the incident and the how the spectrum analyzer corrected the setting automatically. press **System > System Info > Errors History** to read the specific descriptions of those messages.

Example

In this example, a failure explanation is generally included with each error to further define its meaning. The instrument messages in this guide are listed numerically.

<number></number>	<code></code>	<message></message>
1.	-330	Self-test failed

A self-test failure occurred.

<Explanation in manual>

Command Errors

The messages listed below are command errors, which are saved into local registers.

-100 Command error

An unrecognized command or data type was encountered. This message is used when the device cannot detect more specifics described for errors -101 to -109.

- -101 Invalid character A syntactic element contains an invalid character.
- -102 Syntax error An unrecognized command or data type was encountered.
- -103 Invalid separator The parser was expecting a separator and encountered an illegal character.
- -104 Data type error The parser recognized a data element that is not allowed.

-108 Parameter not allowed

More parameters were received than expected for the header. For example, the *ESE common command only accepts one parameter, so receiving *ESE 0,1 is not allowed.

-109 Missing parameter

Fewer parameters were received than required for the header. For example, the *ESE common command requires one parameter, so receiving *ESE is not allowed.

-110 Command header error

An error was detected in the header. This message is used when the device cannot detect more specifics described for errors -111 to -119.

5 Instrument Messages

- -112 Program mnemonic too long The header contains more than 12 characters.
- -113 Undefined header The header is correct in syntax, but it is undefined for this device.

-128 Numeric data not allowed

A legal numeric data element was received, but the device does not accept one in this position for the header.

-130 Suffix error

This error is generated when parsing a suffix. This message is used when the device cannot detect more specifics described for errors - 131 to - 139.

-131 Invalid suffix

The suffix does not follow the syntax described in *IEEE* 488.2, or the suffix is inappropriate for the device.

-134 Suffix too long The suffix contained more than 12 characters.

-138 Suffix not allowed A suffix was encountered after a numeric element which does not allow suffixes.

- -144 Character data too long The character data element contains more than 12 characters.
- -148 Character data not allowed A legal character data element was encountered where prohibited by the device.

Execution Conflict

The system messages listed below are execution conflicts, indicating settings conflict during your operation.

-200 Execution Error This is the generic syntax error for devices that cannot detect more specific errors.

-222 Data out of range

A legal program data element was parsed but could not be executed because the interpreted value was outside the legal range defined by the device. The displayed results may be clipped.

-223 Too much data not all points entered

Indicates that a legal program data element of block, expression, or string type was received that contained more data than the device could handle due to memory or related device-specific requirements.

-224 Illegal parameter value

An attempt was made to select a user file that contains 0 bits. Select another user file that contains at least 1 bit.

-241 Hardware missing

Missing device hardware. For example, the RF board is not installed.

-253 Corrupt media

A source media (possibly EEPROM) for a data file is corrupt. This error is usually seen in conjunction with errors concerning a certain file.

-300 Device-specific error

This is the device-specific error for devices that cannot detect more specific errors.

5 Instrument Messages

-330 Self-test failed A self-test failure occurred. Report this error to Agilent Technologies.

-340 calibration failed

An expected file was not found while trying to load internal calibration.

Device-Specific Errors

- 102 Set 50 MHz signal < 0 dBm, do alignment again The 50 MHz energy is too high at the RF port for alignments to run. Reduce input power to less than 0 dBm and run alignments again.
- 104 1st LO Unlock

The first LO on has lost phase lock. Report this error to the nearest Agilent Technologies sales or service office.

105 2nd LO Unlock

The second LO has lost phase lock. Report this error to the nearest Agilent Technologies sales or service office.

201 Option not installed

The desired operation cannot be performed because a required option is not installed.

204 TG Frequency Limit

The tracking generator has reached the limit of its allowable frequency range.

- 211 RBW limited to 1 kHz when Span > 1 MHz In spans greater than 1 MHz, narrow (digital) resolution bandwidths, below 1 kHz, are not available.
- 213 Span limited to 1 MHz when RBW < 1 kHz In narrow (digital) resolution bandwidths, below 1 kHz, spans greater than 1 MHz are not available.
- 214 TG start freq is less than 9 kHz Tracking generator uncalibrated below 9 kHz.

5 Instrument Messages

- 215 TG start freq is less than 1/2 res bw Tracking generator uncalibrated at start frequencies below 1/2 the current resolution bandwidth.
- 224 Option not licensed

The selected option requires a license. Refer to the installation procedures in the user guide provided for this particular option.

- 238 VBW filter or Average Detector cannot use both
- 501 RF over load Either increase input attenuation or decrease the input signal level.
- 502 IF over load

Either increase input attenuation or decrease the input signal level.

604 File already exists

You attempted to save to a file that already exists. Either delete or rename the existing file or select a new name, then try again.

605 Media is protected

A save was attempted to a write-protected device.

610 File access is denied

The file is protected or hidden and cannot be accessed.

612 File not found

The analyzer could not find the specified file.

651 Connect TG OUT to RF IN

Attempt to align the tracking generator without its output connected. Connect the **TG SOURCE** to **RF IN**.

- 652 Connect CAL OUT to RF IN you must connect the CAL OUT to RF IN with the appropriate cable.
- 751 Instrument state set to initial values While trying to load a trace or state, the state information was found to be in error. This may be because the state had been stored on a later revision of analyzer firmware. A default set of state variables was loaded instead. There is nothing wrong with the analyzer.
- 752 Unable to load state from file Attempt to load a state from a file failed.
- 753 Unable to save state to file Attempt to save a state to a file failed. See the associated error messages for the cause.
- 757 Unable to load user state A user preset failed, so the factory preset values were used. Save a valid state into user preset and try again.
- 758 Unable to save user state Attempt to save a user preset state failed.
- 760 Unable to query state Query of state over the remote interface was unsuccessful.
- 762 Unable to load file A failure occurred while loading a file.
- 764 Unable to save file Attempt to save a file failed; the file was not saved.

5 Instrument Messages

767 Fatal LDS error

Attempt to initialize the instrument state has failed. Cycle instrument power. If this fails to correct the problem, contact your nearest Agilent Technologies service center.

768 Unable to load user state

Attempt to load a state failed, because the state was saved with a measurement personality that is not currently loaded. Load the appropriate personality and try again.

770 Incorrect filename

You sent a remote command to save a screen file but did not specify a valid extension.

- 780 No Peak Found No signal peak was found that meets the criteria under Peak Search > Peak Criteria.
- 781 Video Trigger cannot be active

You sent a remote command to do one of the following:

- Turn on video trigger while the Average Detector or a Marker Function is active.
- Turn on the Average Detector or a Marker Function while Video Trigger is active.
- 782 Video Trigger cannot be used with Mkr Func Due to the Average Detector, the video Trigger cannot be used with Maker function.
- 783 Allowable span for current CF exceeded
- 784 Allowable CF for current span exceeded
- 805 Doing Alignment



Agilent N9322C Spectrum Analyzer User's Guide

Troubleshooting

This chapter includes information on how to check for a problem with your Agilent Technologies spectrum analyzer, and how to return it for service.

If you experience a problem or would like additional information about your analyzer, Agilent Technologies' worldwide organization is ready to provide the support you need.



Check the basics

Before calling Agilent Technologies, or returning an analyzer for service, perform the quick checks listed below. This check may eliminate the problem.

- Is there power at the receptacle?
- Is the analyzer turned on? Listen for internal fan noise to determine if the analyzer cooling fan is running. Feel the rear side of the analyzer for air flow.
- If other equipment, cables, and connectors are being used with your spectrum analyzer, make sure they are connected properly and operating correctly.
- Review the measurement procedures being performed when the problem first appeared. Make sure all of the settings are correct.
- If the analyzer is not functioning as expected, return the analyzer to a known state by pressing **Preset**.

Some analyzer settings are not affected by a Preset. If you wish to reset the analyzer configuration to the state it was in when it was originally sent from the factory, press System, Power On/Preset, Preset Type, Factory. Then press the green Preset key on the front panel.

- Is the measurement being performed, and the results that are expected, within the specifications and capabilities of the analyzer? Refer to the *Technical Overview* for your analyzer.
- Is the analyzer displaying an error message? If so, refer to *User's Guide* for details.
- To meet specifications, the analyzer must be aligned. For more information on how to align the analyzer, refer to "Time Base Calibration" on page 23.

WARNING

NOTE

No operator serviceable parts inside. Refer servicing to qualified personnel. To prevent electrical shock, do not remove covers.

NOTE If the analyzer is still under warranty or is covered by a maintenance contract, it will be repaired under the terms of the warranty or plan (the warranty is located at the front of this manual).

If the analyzer is no longer under warranty or is not covered by an Agilent Technologies maintenance plan, Agilent Technologies will notify you of the cost of the repair after examining the analyzer.

If a problem persists, please contact the Agilent Technologies office for further information and service.

Warranty and Service Options

Agilent N9322C spectrum analyzer provides 1-year return-to-Agilent warranty as standard.

Agilent Technologies offers several optional maintenance plans to service your analyzer after the warranty has expired:

R-51B-001-3C

extends this service to 3 years.

R-50C-011-3

Agilent calibration upfront support plan, 3-year coverage.

The calibration cycle of N9322C spectrum analyzer is one year.

NOTE

A button cell provides power to the real time clock of the spectrum analyzer. It is not rechargeable. If you find your N9322C encounters a clock defect, please contact your nearest Agilent Customer Contact Center (CCC) for service.

Contact Agilent Technologies

Agilent Technologies has offices around the world to provide you with complete support for your spectrum analyzer. To obtain servicing information or to order replacement parts, contact the Agilent Technologies customer contact center listed below. In any correspondence or telephone conversations, refer to your spectrum analyzer by its product number and full serial number..

Online assistance: http://www.agilent.com/find/assist

United States	Canada	China		
(tel) 800 829 4444 (fax) 800 829 4433	(tel) 877 894 4414 (fax) 800 746 4866	(tel) 800 810 0189 (fax) 800 820 2816		
Europe	Japan	Korea		
(tel) +31 20 547 2323 (fax) +31 20 547 2390	(tel) +81 426 56 7832 (fax) +81 426 56 7840	(tel) 080 769 0800 (fax) 080 769 0900		
Latin America	Taiwan	Australia		
(tel) +1 (305) 269 7500	(tel) 0800 047 866 (fax) 0800 286 331	(tel) 1 800 629 485 (fax) +61 (3) 9210 5947		
Other Asia Desitie Countries				

Other Asia Pacific Countries

(tel) +65 6375 8100 (fax) +65 6755 0042 Email: tm_ap@agilent.com




Agilent N9322C Spectrum Analyzer User's Guide

Menu Maps


This chapter provides a visual representation of the front panel keys and their associated menu keys (in Spectrum Analyzer mode). Refer to Chapter 4, "Key Reference," starting on page 101 for key function descriptions. The name editor menu is shown separately, though it is accessed when entering data for many keys. The front-panel key menus appear in alphabetical order as follows.




Amplitude Menu

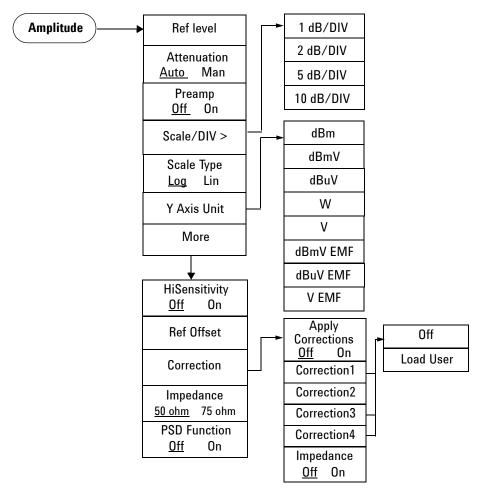


BW Menu

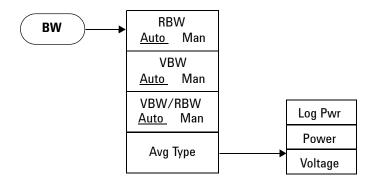


Sweep Menu

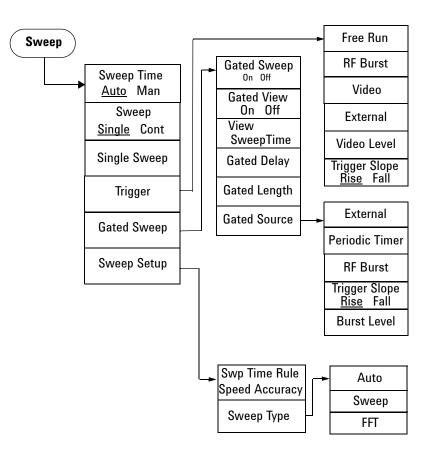


Display Menu

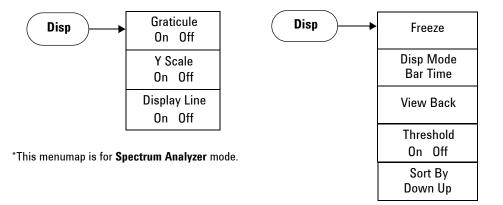

*This menumap is for Channel Scanner measurement.

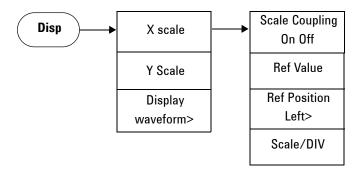

*This menumap is for ASK/FSK modulation analysis.

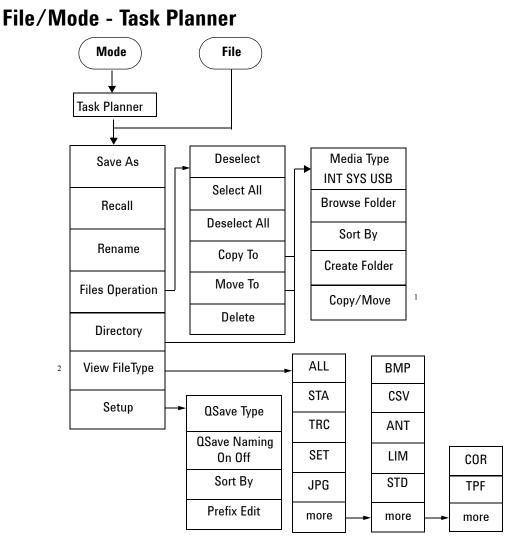


1

*The softkey *Copy/Move* only exists in the submenu of *Copy To/Move To.*


*The softkey View FileType is fixed as TPF in Task Planner Mode.

Frequency Menu

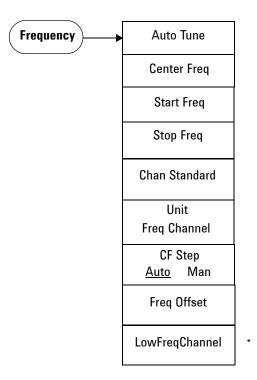


*This softkey is only visible when option BB1 is installed.


Limit Menu

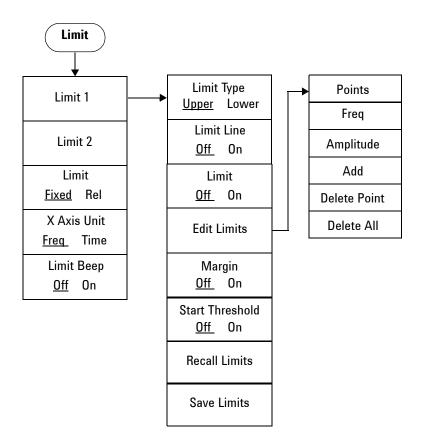


Marker Menu

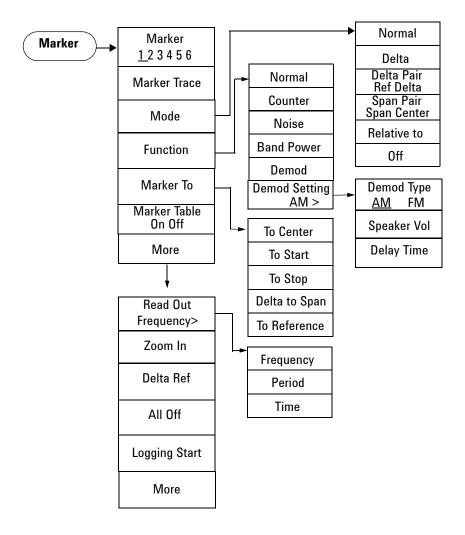


Peak Search Menu

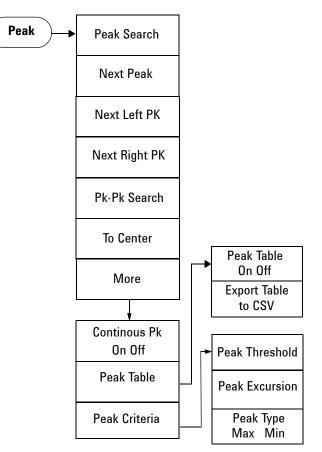


Measure Menu (1 of 2)

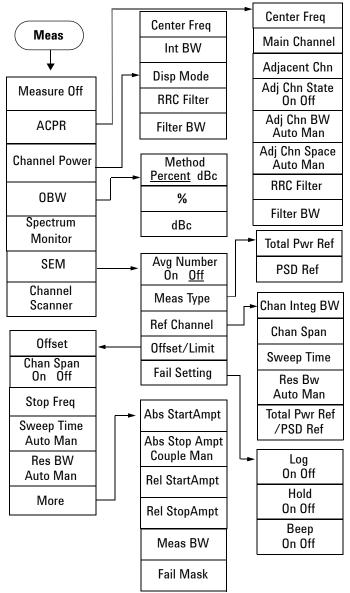


Measure Menu (2 of 2)

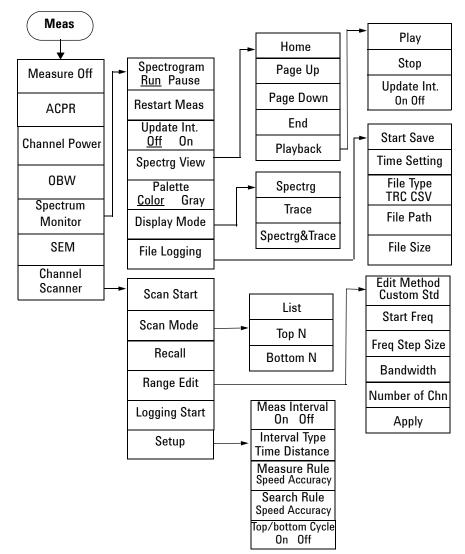


Mode - Tracking Generator

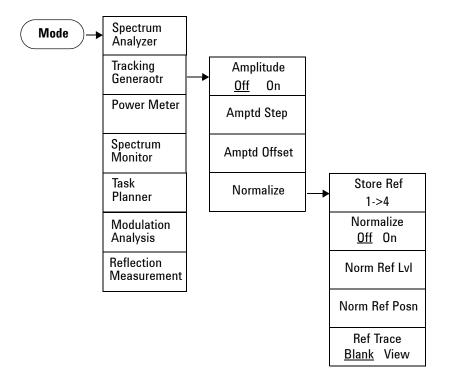


Mode - Power Meter

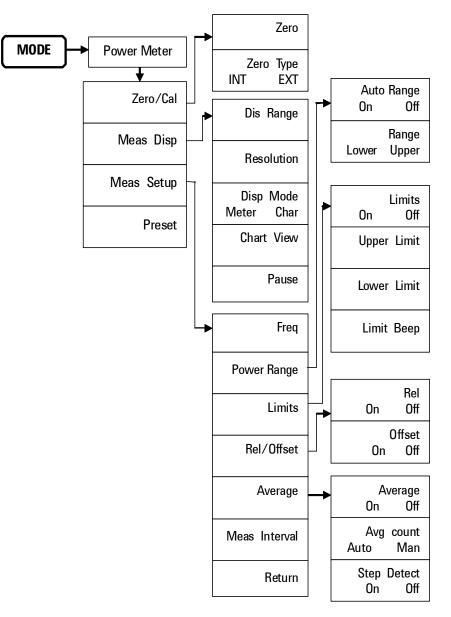




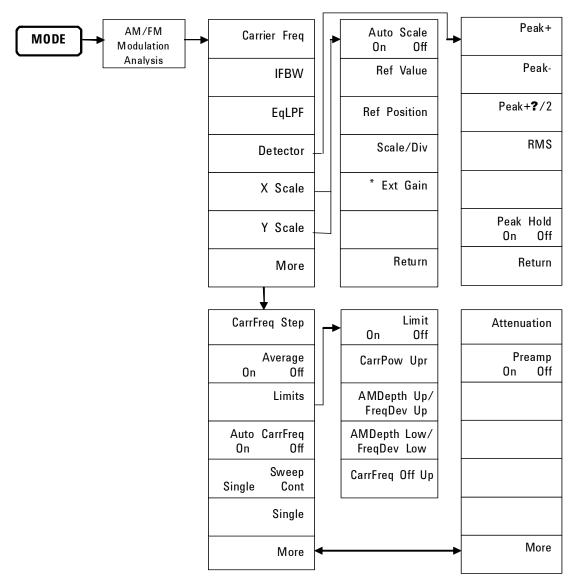

* Ext Gain is only available in Y Scale submenu.

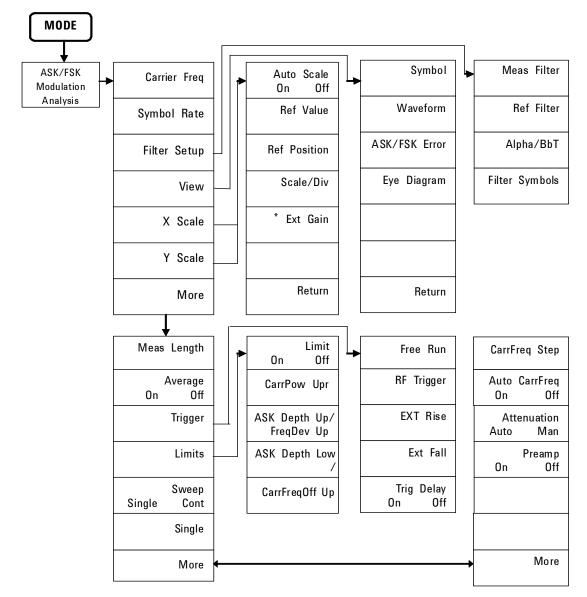

Mode - ASK/FSK Modulation Analysis

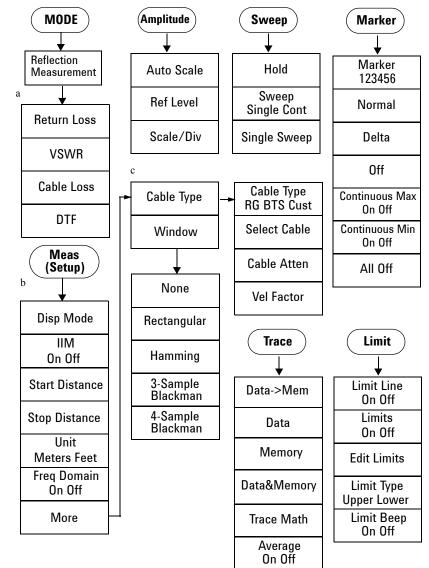

Mode - Reflection Measurement


a. Press Meas twice to toggle the submenu between Meas setup and Mode setup.

b. The Meas submenu is specific for DTF measurement.


c. The Cable Type and Window submenu is specific for DTF measurement.

7 Menu Maps


Name Editor Menu

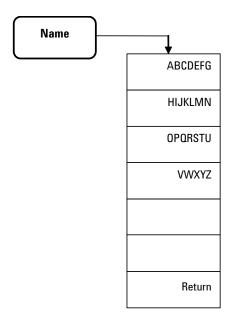


System Menu

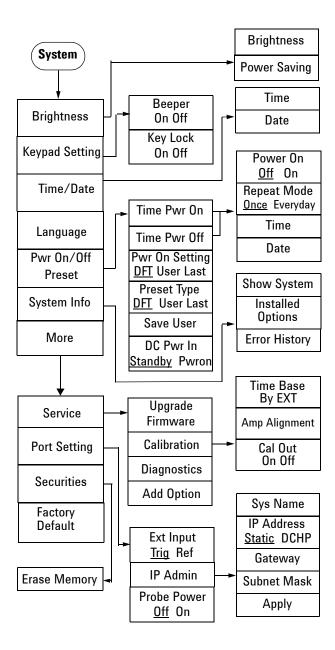

SPAN Menu

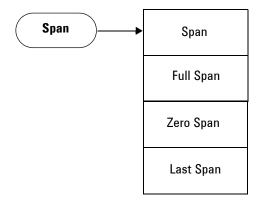

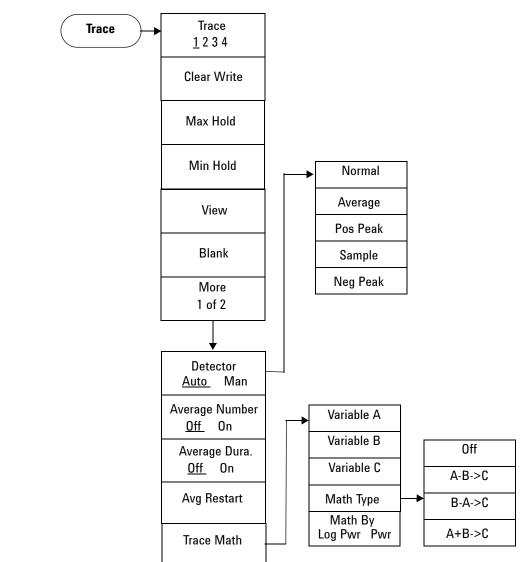

Trace/Det Menu

7 Menu Maps

Index

Numerics

3GPP W-CDMA, 126 802.11a, 127 802.11b, 127

A

Abs Start, 128 Abs Stop, 128 adjacent channel power, 123 Amplitude key, 102 annotation, marker, 34 Attenuation, 102 attenuation, reducing, 44 Average, 164

B

BW/Avg key, 106

C

Calibrate, using T-combo, 71 calibration, freq change, 138 Calibration, span changes, 71 CE mark, 10 Center Freq, 111 CF Step, 112 channel power, 119 comparing signals off screen, 37 on the screen, 35 Continuous PK, 149 CSA mark, 10 c-tick mark, 10

D

delta marker, 115 Det/Display key, 109 Detector, 163 distortion, measuring, 53 DTF Measurement, 73

E

Enter key, 110 error message, 17 ESC/CLR, 110 ESD, 21 external reference, 24

F

Fail Mask, 129 firmware revision, update, 25 front panel overview, 4 front panel, using, 30

Η

harmonic distortion measuring, 53

improving frequency resolution and accuracy, 49 instruction manual, 10 instrument messages, 167 Int Preamp, 102

L

Limits, 159

Μ

Marker key, 114 Marker Table, 117 Meas key, 119 measuring ACP, 123 channel power, 119 distortion, 53 low-level signal, 44 multiple signals, 35 occupied BW, 121 SEM. 124 source's frequency drift, 51 TOI, 56 menu maps, 181 messages, 17 MODE key, 130

Ν

Next Peak, 148

0

occupied BW, 121 Offset/Limits, 125 options enable, 24 order list, 12

P

Peak Search key, 148 power cord, 14 power requirements, 14 preset factory, 31 user, 31

Index

Preset/System key, 151 Pwr on/Preset, 151 W WEEE, 10

R

rack mount, 19 Ref level, 102 Rel Start, 128 Rel Stop, 129 requirements ventilation, 18 Res BW, 106 resolving signals equal amplitude, 39 hidden by large signals, 42

S

Scale/Div, 102 Search Criteria, 149 Show System, 152 SPAN key, 154 spectrum emission mask, 124 Start Freq, 111 Stop Freq, 111 symbols, 10

Т

TOI measuring, 56 tracking drifting signals, 51

U

Uncoupled, definition, 47 using frequency counter, 49

V

VBW/RBW, 106 ventilation, 18 Video BW, 106 View/Trace key, 162 viewing signal, 33





Manufacturer's Name:	Agilent Technologies (Chengdu) Co., Ltd.
Manufacturer's Address:	No. 116, 4th Tian Fu Street
	Chengdu Hi-Tech Industrial Development Zone (South),

Declares under sole responsibility that the product as originally delivered

Product Name:	Spectrum Analyzer
Model Number:	N9322C
Product Options:	This declaration covers all options of the above product(s)

Chengdu, 610041, China

complies with the essential requirements of the following applicable European Directives, and carries the CE marking accordingly:

Low Voltage Directive 2006/95/EC EMC Directive 2004/108/EC

and conforms with the following product standards:

EMC	Standard	Limit
	IEC 61326-2-1:2005 / EN 61326-2-1:2006	
	Reference Standards	
	CISPR 11:2003 / EN 55011:2007	Class A Group 1
	IEC 61000-4-2:2001 / EN 61000-4-2	4 kV/4 kV contact/air
	IEC 61000-4-3:2002 / EN 61000-4-3	3 V/m, 80-2000 MHz, 1 V/m, 2-2.7 GHz
	IEC 61000-4-4:2004 / EN 61000-4-4	0.5 kV signal lines, 1 kV power lines
	IEC 61000-4-5:2001 / EN 61000-4-5	0.5 kV line-line, 1 kV line-ground
	IEC 61000-4-6:2003 / EN 61000-4-6	3 V, 0.15-80 MHz
	IEC 61000-4-11:2004 / EN 61000-4-11	1 cycle, >95%
		·

Canada: ICES/NMB-001:2006 Australia/New Zealand: AS/NZS CISPR 11:2004

The product was tested in a typical configuration with Agilent Technologies test systems.

Safety IEC 61010-1:2010(3rd Edition) / EN 61010-1:2010(3rd Edition) Canada: CAN/CSA-C22.2 No. 61010-1-04, USA: ANSI/UL 61010-1:2004,

Supplementary Information:

This DoC applies to above-listed products placed on the EU market after:

Oct 23, 2012 Date

Shi Wen Quality Manager

For further information, please contact your local Agilent Technologies sales office, agent or distributor, or Agilent Technologies Deutschland GmbH, Herrenberger Straße 130, 71034 Böblingen, Germany.

www.agilent.com

© Agilent Technologies, Inc. 2012

Printed in China First Edition, Nov 2012



N9322-90002



Agilent Technologies